

AD-A143 388


NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS  
CRYSTAL LAKE DAM CT 8. (U) CORPS OF ENGINEERS WALTHAM  
MA NEW ENGLAND DIV JAN 88


1/2

UNCLASSIFIED

F/G 13/13

NL

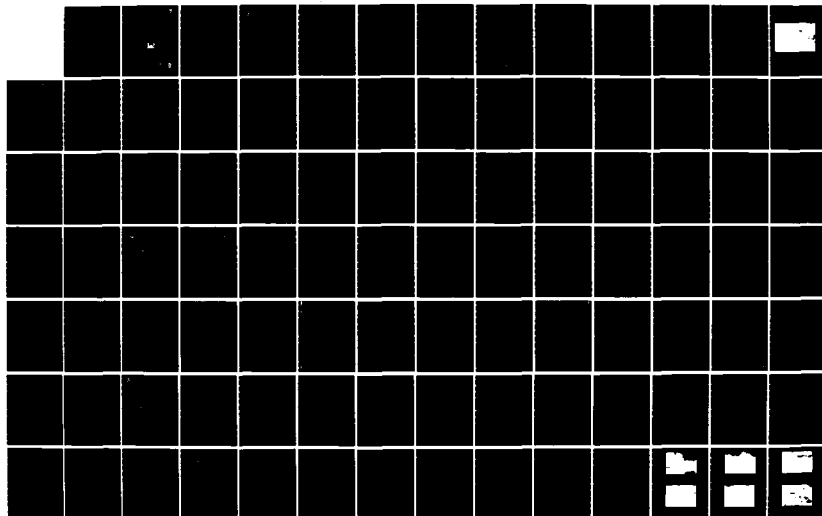

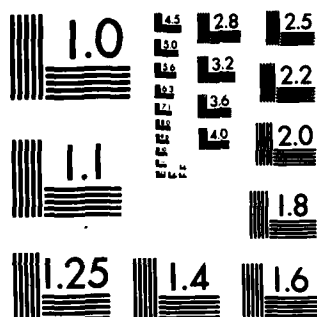

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS-1963-A

AD-A143 308

LOWER CONNECTICUT RIVER BASIN  
MIDDLETOWN , CONNECTICUT

**CRYSTAL LAKE DAM**  
**CT 00138**

**PHASE I INSPECTION REPORT**  
**NATIONAL DAM INSPECTION PROGRAM**



DEPARTMENT OF THE ARMY  
NEW ENGLAND DIVISION, CORPS OF ENGINEERS  
WALTHAM , MASS. 02154

DTIC FILE COPY

JANUARY 1980

This document has been approved  
for public release and sale; its  
distribution is unlimited.

DTIC  
ELECTE  
JUL 25 1984  
S D  
E

84 07 23 044

**UNCLASSIFIED**

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER  CT 00138	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle)  Crystal Lake Dam NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS		5. TYPE OF REPORT & PERIOD COVERED  INSPECTION REPORT
7. AUTHOR(s)  U.S. ARMY CORPS OF ENGINEERS NEW ENGLAND DIVISION		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS DEPT. OF THE ARMY, CORPS OF ENGINEERS NEW ENGLAND DIVISION, NEDED 424 TRAPELO ROAD, WALTHAM, MA. 02254		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE January 1980
		13. NUMBER OF PAGES 60
		15. SECURITY CLASS. (of this report)  UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report)  APPROVAL FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Cover program reads: Phase I Inspection Report, National Dam Inspection Program; however, the official title of the program is: National Program for Inspection of Non-Federal Dams; use cover date for date of report.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)  DAMS, INSPECTION, DAM SAFETY,  Lower Conn. River Basin Middletown, Conn. Crystal Lake Dam		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Crystal Lake is an earthen embankment dam with a maximum ehight of 50 ft. and a length of 130 ft. The upstream and downstream slopes are faced with riprap. The dam is judged to be in generally fair condition. The vertical and horizontal alignment of the dam is good. Some minor erosion along the dam adjacent to the left abutment was noted.		



DEPARTMENT OF THE ARMY  
NEW ENGLAND DIVISION, CORPS OF ENGINEERS  
424 TRAPELO ROAD  
WALTHAM, MASSACHUSETTS 02154

REPLY TO  
ATTENTION OF  
NEDED

MAY 19 1987

Honorable Ella T. Grasso  
Governor of the State of Connecticut  
State Capitol  
Hartford, Connecticut 06115

Dear Governor Grasso:

Inclosed is a copy of the Crystal Lake Dam Phase I Inspection Report, which was prepared under the National Program for Inspection of Non-Federal Dams. This report is presented for your use and is based upon a visual inspection, a review of the past performance and a brief hydrological study of the dam. A brief assessment is included at the beginning of the report. I have approved the report and support the findings and recommendations described in Section 7 and ask that you keep me informed of the actions taken to implement them. This follow-up action is a vitally important part of this program.

A copy of this report has been forwarded to the Department of Environmental Protection, the cooperating agency for the State of Connecticut. In addition, a copy of the report has also been furnished the owner, Dept. of Environmental Protection Hartford, Connecticut,.

Copies of this report will be made available to the public, upon request, by this office under the Freedom of Information Act. In the case of this report the release date will be thirty days from the date of this letter.

I wish to take this opportunity to thank you and the Department of Environmental Protection for your cooperation in carrying out this program.

Sincerely,

*Max B. Scheider*  
MAX B. SCHEIDER

Colonel, Corps of Engineers  
Division Engineer

Incl  
As stated

CRYSTAL LAKE DAM

CT 00138

LOWER CONNECTICUT RIVER BASIN

MIDDLETOWN, CONNECTICUT

PHASE I INSPECTION REPORT

NATIONAL DAM INSPECTION PROGRAM

Accession For	
NTIS GRA&I	<input checked="checked" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Avail and/or	
Dist	Special
A-1	

NATIONAL DAM INSPECTION PROGRAM  
PHASE I INSPECTION REPORT

Identification No.: CT 00138  
Name of Dam: Crystal Lake Dam  
Town: Middletown  
County and State: Middlesex, Connecticut  
Stream: Tributary - Sumner Brook  
Date of Inspection: 1 November, 1979

BRIEF ASSESSMENT

Crystal Lake is an earthen embankment dam with a maximum height of 50 feet and a length of 130 feet. The upstream and downstream slopes are faced with riprap. The dam has a water control structure with a 36-inch diameter outlet pipe controlled by two sluice gates and a stop log spillway.

The dam impounds Crystal Lake which is used for recreational purposes. The lake has a storage volume of 350 acre-feet. Based upon the height of the dam, the size classification is intermediate. A breach of the dam could affect about 20 homes in the probable impact area. State Highway Route 155 would also be flooded. With the potential for the loss of more than a few lives and the probability of excessive economic losses, the dam has been classified as having a high hazard potential.


The dam is judged to be in generally fair condition. The crest is level, and no lateral movement was observed. The vertical and horizontal alignment of the dam is good. Some minor erosion along the dam adjacent to the left abutment was noted. The riprap paving on the upstream face is in good condition. The rockfill downstream face is also in good condition. Small trees and scrub brush are growing on the upstream and downstream slopes and could cause problems if not removed.

The total capacity of the water control structure and the 36-inch diameter outlet pipe is adequate to pass the spillway test flood with a freeboard of 0.8 feet.

Within one year of receipt of the Phase I Inspection Report, the owner, the State of Connecticut, should study and evaluate the following: 1) develop methods to monitor and ensure proper operation of the pressure relief wells; and 2) develop methods of determining potential for seepage through the dam; 3) maintain clear of trees and brush the dam embankment, an area within 25 feet of the downstream toe, and the outlet channel for a distance of 100 feet downstream of the dam.

The owner should also carry out the following operations and maintenance procedures: 1) engage a qualified registered engineer

to make a comprehensive technical inspection once every year;  
2) establish a surveillance program for use during and  
immediately after heavy rainfall and also a warning program  
to follow in case of emergency conditions and 3) remove grate  
or establish provisions for quick release at downstream end  
of 36 in. diameter outlet pipe.

  
\_\_\_\_\_  
S. Giavara, P.E.  
President

Registered CT. 7634



This Phase I Inspection Report on Crystal Lake Dam has been reviewed by the undersigned Review Board members. In our opinion, the reported findings, conclusions, and recommendations are consistent with the Recommended Guidelines for Safety Inspection of Dams, and with good engineering judgment and practice, and is hereby submitted for approval.



ARAMAST MAHTESIAN, MEMBER  
Geotechnical Engineering Branch  
Engineering Division



CARNEY M. TERZIAN, MEMBER  
Design Branch  
Engineering Division



RICHARD DIBUONO, CHAIRMAN  
Water Control Branch  
Engineering Division

APPROVAL RECOMMENDED:



JOE B. FRYAR  
Chief, Engineering Division

## PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation: however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

The Phase I Investigation does not include an assessment of the need for fences, gates, no-trespassing signs, repairs to existing fences and railings and other items which may be needed to minimize trespass and provide greater security for the facility and safety to the public. An evaluation of the project for compliance with OSHA rules and regulations is also excluded.

## TABLE OF CONTENTS

<u>Section</u>	<u>Page</u>
Letter of Transmittal	
Brief Assessment	
Review Board Page	
Preface	i
Table of Contents	ii - iv
Overview Photo	v
Location Map	vi

### REPORT

1. PROJECT INFORMATION	1
1.1 General	1
a. Authority	1
b. Purpose of Inspection	1
1.2 Description of Project	1
a. Location	1
b. Description of Dam and Appurtenances	1
c. Size Classification	2
d. Hazard Classification	2
e. Ownership	2
f. Operator	2
g. Purpose of Dam	3
h. Design and Construction History	3
i. Normal Operational Procedures	3
1.3 Pertinent Data	3
2. ENGINEERING DATA	7
2.1 Design Data	7
2.2 Construction Data	7
2.3 Operation Data	
2.4 Evaluation of Data	7

<u>Section</u>	<u>Page</u>
3. VISUAL INSPECTION	8
3.1 Findings	8
a. General	8
b. Dam	8
c. Appurtenant Structures	8
d. Reservoir Area	9
e. Downstream Channel	9
3.2 Evaluation	9
4. OPERATIONAL AND MAINTENANCE PROCEDURES	10
4.1 Operational Procedures	10
a. General	10
b. Description of any Warning System in Effect	10
4.2 Maintenance Procedures	10
a. General	10
b. Operating Facilities	10
4.3 Evaluation	10
5. EVALUATION OF HYDRAULIC/HYDROLOGIC FEATURES	11
5.1 General	11
5.2 Design Data	11
5.3 Experience Data	12
5.4 Test Flood Analysis	12
5.5 Dam Failure Analysis	13
6. EVALUATION OF STRUCTURAL STABILITY	14
6.1 Visual Observation	14
6.2 Design and Construction Data	14
6.3 Post-Construction Changes	14
6.4 Seismic Stability	14

<u>Section</u>	<u>Page</u>
7. ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES	15
7.1 Dam Assessment	15
a. Condition	15
b. Adequacy of Information	15
c. Urgency	15
7.2 Recommendations	15
7.3 Remedial Measures	15
a. Operation and Maintenance Procedures	15
7.4 Alternatives	16

#### APPENDIXES

<u>Appendix</u>	<u>Description</u>
A	INSPECTION CHECKLIST
B	ENGINEERING DATA
C	PHOTOGRAPHS
D	HYDROLOGIC AND HYDRAULIC COMPUTATIONS
E	INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS



Overview Photo: Crystal Lake Dam



4:1 for the first 50 feet, and then slopes at 3:1. The construction plans indicate that the center of the dam contains an impervious fill core and a grout cap cut off wall. In addition, the plans indicate a stone drainage blanket and a pressure relief well.

The appurtenant structures consist of a water control structure and a sluiceway through the dam. The water control structure functions as a wet intake tower. The water control structure receives water from a submerged concrete intake structure located at the reservoir floor 100 feet from the face of the dam. Water is transmitted from the intake structure to the water control structure via a 36-inch diameter concrete pipe with an inlet invert elevation of 150.0 feet. The first two chambers of the water control structure contain water to an elevation of 175.0 feet with the outlet gates in the closed position. Water enters the third chamber (dry during normal operation) over a stop log spillway with a crest elevation of 175.0 feet. Water is transmitted from the third chamber through the dam via a 36-inch concrete sluiceway conduit with an inlet invert elevation of 147.0 feet and an outlet invert elevation of 130.0 feet. The outlet pipe ends at the toe of the dam at a concrete endwall with wingwalls.

The outlet works consist of two 24 inch x 24 inch sluice gates at the base of the water control structure. These gates are manually operated by metal stems which extend above the top of this structure.

c. Size Classification. Crystal Lake has a storage volume of 350 acre-feet and a dam height of 50 feet above streambed. A height greater than 40 feet classifies this structure in the "intermediate" category according to guidelines established by the Corps of Engineers.

d. Hazard Classification. The dam is classified as having a "high" hazard potential. Approximately 50 dwellings are located in the dam failure impact area. In addition, the center of the City of Middletown is located approximately 2 miles downstream. Approximately 15 houses are in areas where flooding depths of 1 to 3 feet (above first floor levels) are estimated. About 3 houses would have flooding of 3 to 5 feet. There is significant commercial and industrial development which would be inundated by a flood resulting from dam failure resulting in excessive economic loss. With the potential for the loss of more than a few lives and excessive economic losses, the dam has been classified as having a high hazard potential.

e. Ownership. This dam is presently owned by the Connecticut Department of Environmental Protection, Division of Conservation and Preservation, 165 Capitol Avenue, Hartford, Connecticut; Dennis P. DeCarli, Deputy Commissioner; Phone: 566-4522. The previous dam at this site was owned by Russell Manufacturing Company, Middletown, Connecticut.

f. Operator. The dam is operated by the Connecticut Department of Environmental Protection, Division of Conservation and Preservation, Region III Headquarters, East Hampton, Connecticut; John Spencer, Region Manager; phone: 295-9523.



g. Purpose of Dam. The dam impounds Crystal Lake which is used for recreational purposes. The previous dam and reservoir was used for water storage purposes by the Russell Manufacturing Company.

h. Design and Construction History. The existing dam was designed in 1963 and constructed in 1966. A Construction Permit was issued on March 24, 1964 and a Certificate of Approval was issued on April 27, 1966 for the construction of this dam by the State Water Resources Commission. Construction plans and specifications were prepared by Onderdonk and Lathrop, Consulting Engineers, Glastonbury, Connecticut. Pertinent construction plan sheets are contained in Appendix B. Results of borings and hydraulic/hydrologic design information is also included on these plans.

The original dam at this site failed on April 27, 1961. The cause of failure was thought to be due to excessive seepage. The flood wave resulted in three persons being slightly injured and eleven homes were damaged (see Appendix B for Hartford Times account).

i. Normal Operation Procedures. Water levels in the lake are normally maintained at the spillway crest elevation of 175.0 feet. During the fall months, the water surface level is drawn down by opening the sluice gates to aid in the control of aquatic vegetation.

### 1.3 PERTINENT DATA:

a. Drainage Area. The drainage area of Crystal Lake is 0.26 square miles which consist of moderately sloping hillsides surrounding the lake. The land use is limited to the scattered residential dwellings which are located around the perimeter of the lake. The watershed is about 4,500 feet in length and has a maximum width of about 2,000 feet.

#### b. Discharge at Dam Site.

1) The outlet works utilize the 36-inch diameter concrete sluiceway conduit which passes through the dam. This conduit transmits all spillway and outlet works flow. The outlet works consist of two 24 inch x 24 inch sluiceways at the bottom of the water control structure. These gates are manually operated by two valve stems located on top of this structure. The 36-inch diameter concrete sluiceway conduit has an inlet invert elevation of 147.0 feet and an outlet invert elevation of 130.0 feet. The discharge capacity of the outlet works (gates opened) under 28 feet of head (elevation 175.0 feet) is 180 cfs.

2) There are no known records of past floods or flood stage heights at the dam.

3) The ungated spillway capacity at the top of dam - 196 cfs @ El. 180.5.

4) The ungated spillway capacity at test flood elevation - 184 cfs @ EL. 179.7.

5) The gated spillway capacity at normal pool elevation is not applicable at this dam.

6) The gated spillway capacity at test flood elevation is not applicable at this dam.

7) The total spillway capacity at test flood elevation - 184 cfs @ El. 179.7.

8) The total project discharge at the top of dam elevation is not applicable at this dam.

9) The total project discharge at test flood elevation - 184 cfs @ El. 179.7

c. Elevation (ft. above MSL).

1) Streambed at toe of dam .....	130.0
2) Bottom of cutoff .....	128 <sub>+</sub>
3) Maximum tailwater .....	N/A
4) Recreation pool .....	175.0
5) Full flood control pool .....	N/A
6) Spillway crest .....	175.0
7) Design surcharge (Original Design) .....	177.0
8) Top of dam .....	180.5
9) Test flood design surcharge .....	179.7

d. Reservoir (Length in feet).

1) Normal pool .....	3,700
2) Flood control pool .....	N/A
3) Spillway crest pool .....	3,700
4) Top of dam .....	3,720
5) Test flood pool .....	3,715

e. Storage (acre-feet).

1) Normal pool .....	154
2) Flood control pool .....	N/A
3) Spillway crest pool .....	154
4) Top of dam .....	350
5) Test flood pool .....	322

f. Reservoir Surface (acres).

- 1) Normal pool ..... 30.8
- 2) Flood control pool ..... N/A
- 3) Spillway crest ..... 30.8
- 4) Test flood pool ..... 38.5
- 5) Top of dam ..... 39.7

g. Dam.

- 1) Type ..... Earth embankment
- 2) Length ..... 130 feet
- 3) Height ..... 50 feet
- 4) Top Width ..... 20
- 5) Side Slopes ..... Downstream: 2 horizontal to 1 vertical  
Upstream: Varies 4 to 3 horizontal to  
1 vertical
- 6) Zoning ..... Impervious fill core with pervious fill  
embankment
- 7) Impervious Core ..... Yes
- 8) Cutoff ..... Grout cap cutoff wall to elevation 128+
- 9) Grout curtain ..... Grout surface seal

h. Diversion and Regulating Tunnel.

- 1) Type ..... Not applicable
- 2) Length ..... Not applicable
- 3) Closure ..... Not applicable
- 4) Access ..... Not applicable
- 5) Regulating Facilities ..... Not applicable

i. Spillway.

- 1) Type ..... Stop log spillway contained within  
water control structure
- 2) Length of weir ..... 6.0 feet

- 3) Crest elevation ..... 175.0
- 4) Gates ..... No
- 5) U/S Channel ..... Reservoir
- 6) D/S Channel ..... Natural stream channel with gravel and  
cobble

j. Regulating Outlets.

- 1) Invert ..... 147.0 feet
- 2) Size ..... 36" circular conduit
- 3) Description ..... Reinforced concrete pipe
- 4) Control mechanism ..... Hand-operated valve  
stems

## SECTION 2 - ENGINEERING DATA

### 2.1 DESIGN:

The principal engineering data available are:

- a. Plans - Construction of Dam, Crystal Lake, Sheets 1-8, 16 September, 1962. Plans prepared by Onderdonk and Lathrop, Glastonbury, CT (see Appendix B).
- b. Specifications for Construction of Dam, Crystal Lake, Middletown, Connecticut, Agriculture and Natural Resources, Board of Fisheries and Game, Project BI-BB-53, August, 1962.
- c. Several items of correspondence pertaining to the project (see Appendix B).

### 2.2 CONSTRUCTION:

No information is available concerning the foundation preparation or embankment construction. Details shown on the contract drawings are in good agreement with field observations.

### 2.3 OPERATION DATA:

Operation of the dam by the State DEP, Region III, is on an informal basis to satisfy the recreational interests of lake users.

### 2.4 EVALUATION:

- a. Availability. The information available concerning the embankment consists of a design cross section and the identification of the embankment materials as "impervious core fill" and "pervious fill." No engineering data is available concerning the properties of the embankment materials. No information is available about the foundation materials encountered during the construction of the embankment.
- b. Adequacy. The available data are not sufficient to evaluate the soils in the core and shells and in the foundation of the dam. The evaluation must be based primarily on the results of the visual inspection which is adequate for the purposes of the Phase I investigation.
- c. Validity. No conflicts have been noted between the available data and the observations made during the inspection. In general, there is no reason to question the validity of the available data.

## SECTION 3 - VISUAL INSPECTION

### 3.1 FINDINGS:

a. General. Based on visual inspection, history and general appearance, Crystal Lake Dam and its appurtenances are judged to be in fair condition. The crest is level, and no lateral movement was observed. The vertical and horizontal alignment of the dam is good. Some minor erosion along the dam adjacent to the left abutment was noted. The riprap paving on the upstream face is in good condition. The rockfill downstream face is also in good condition. Small trees and scrub brush is growing on the upstream and downstream slopes and could cause problems if not removed. The gate mechanism on the outlet structure was not operated during the inspection.

b. Dam. Crystal Lake Dam is an earth embankment about 50 feet high, 130 feet long and 20 feet wide at the crest.

1) Upstream Slope - Most of the upstream side of the dam is covered by large flat riprap blocks. Brush and grass are growing between the riprap blocks as shown in Photos No. 1 and No. 2. A small concrete cutoff wall, 1-ft.-wide by 2-ft.-deep, is located on the crest of the upstream slope as indicated in Photo No. 3.

2) Crest - The crest of the dam is covered with grass over most of its length. The grass has not been mowed recently, but there is a footpath which is bare of vegetation near the downstream edge of the crest. The contact between the earthen embankment and the right abutment is not clearly defined (Photos No. 3 and No. 4). Three 2½-inch diameter pipe casings extend about 2 feet above the crest of the dam, the purpose of these pipes are unknown.

3) Downstream Slope - The downstream side of the dam consists of rockfill overlying the embankment section (Photos No. 5 and No. 6). The rockfill extends to the downstream toe of the dam and is covered by extensive small trees and fallen logs as indicated in Photo No. 7. A portion of the contact with the left abutment has been covered with trash and debris as shown in Photo No. 9. Bedrock is exposed at the contact with the right and left abutments.

c. Appurtenant Structures. The visible portions of the concrete water control structure above the water level surface is in good condition. The top of the structure is enclosed with a perimeter chain link fence. There are aluminum grate covers over each of the three interior chambers. Two valve stems without operator handles were observed on the top of this structure (see Photo No. 10).

The inlet which transmits water to the water control structure is located offshore from the dam at the bottom of the reservoir and was therefore not visible for inspection.

The water control structure functions as the spillway and the outlet works. At the time of the visual inspection, the outlet gates at the base of this structure were closed and water was discharging over the stoplog spillway within the structure.

All water which passes through the water control structure is conveyed through the dam in a 36-inch diameter concrete conduit. This conduit extends from the water control structure and outlets at the toe of the dam. The conduit was visually inspected at its outlet located at the base of the downstream face of the dam embankment, and found to be in good condition. The 36" diameter pipe outlets at a concrete endwall with concrete wingwalls. All concrete was in good condition, with no evidence of spalling, erosion or efflorescence. A metal bar rack bolted to the endwall prevents access to the outlet conduit (see Photo No. 11).

d. Reservoir Area. The reservoir has well vegetated banks at slight to moderate slopes. In addition, there are scattered residential homes located along the perimeter of the lake (see Photo No. 13).

There was no evidence of slides or sloughing along the banks of the lake. No sediment deposits were observed above the water level of the lake. Sediment inputs to the lake would be a result from natural runoff and urbanization.

e. Downstream Channel. The outlet flows into a natural stream which begins at the base of the dam. The channel width varies from 5 to 10 feet with bed materials consisting of sand and gravel, with scattered cobbles and boulders. The bed appears stable but the banks experienced severe erosion when the original dam failed in 1961. These banks have since stabilized due to natural soil sloughing and revegetation. Approximately 100 feet downstream of the endwall outlet, there is a low valley without a well defined channel. The floodplain area and stream are heavily vegetated with brush and young saplings and is covered with forest litter and debris. The channel downstream of the outlet endwall is filled with fallen trees, brush, vegetation and trash as indicated in Photo No. 12.

### 3.2 EVALUATION:

Based on the visual inspection, Crystal Lake Dam is in fair condition.

The contract drawings indicate the existence of a relief well system beneath the downstream slope of the dam. The presence of this relief well system could not be confirmed during the site visit.

Trees growing on the downstream slope may blow over and pull out their roots causing a displacement of the rockfill. Brush and trees growing along the downstream toe make it difficult to inspect the dam and downstream toe area adequately.

The footpath which is bare of vegetation on the crest of the dam has low erosion resistance if the dam should be overtopped.

## SECTION 4 - OPERATIONAL AND MAINTENANCE PROCEDURES

### 4.1 OPERATIONAL PROCEDURES:

a. General. The water level in the pond can be controlled by two 24 inch x 24 inch sluice gates at the base of the water control structure. The pond level is maintained at El. 175.0 which is the top elevation of the stop planks in the water control structure. There appears to be no formal operating procedures.

b. Description of Any Warning System In Effect. There is no formal warning system in effect in the event of a failure or partial failure of the structure.

### 4.2 MAINTENANCE PROCEDURES:

a. General. It does not appear that any formal maintenance procedures are practiced at the dam. Numerous trees and brush have overgrown both the upstream and downstream slopes.

b. Operating Facilities. There are no formal maintenance procedures followed for the operating facilities.

### 4.3 EVALUATION:

Regular operation maintenance procedures for this dam and its appurtenances have not been developed or implemented.

An emergency action plan should be prepared to prevent or minimize the impact of failure. This plan should list the expedient action to be taken and authorities to be contacted.



## SECTION 5 - EVALUATION OF HYDRAULIC/HYDROLOGIC FEATURES

### 5.1 GENERAL:

The Crystal Lake Dam is an earth embankment dam with a concrete water control structure which functions as a spillway and outlet works.

The water control structure receives water from a submerged concrete intake structure located at the bottom of the located reservoir about 100 feet from the upstream face of the dam. Water is transmitted from the intake structure to the water control structure via a 36 inch diameter concrete pipe.

The water control structure which is about 30 feet in depth contains three vertical rectangular chambers. Two 24 inch x 24 inch sluice gates are located at the bottom of this structure and comprise the outlet works. These gates are operated manually by metal stems which extend above the top of the structure. During normal lake operations, these sluice gates are closed. With the sluice gates closed, the first two chambers are filled with water to elevation 175. The wall between the second and third chamber consists of stop logs which function as a spillway for heads of up to 2 feet. For water levels in the reservoir greater than elevation 177, this opening discharges as orifice flow. In addition, when the water surface level rises above elevation 177.67, water enters through the grate over the third chamber, which operates as a drop inlet. Flow from the outlet structure is carried through the dam in a 36-inch concrete pipe that discharges at the base of the downstream slope.

The watershed area is 0.26 square miles which consists of the moderately sloping hillsides surrounding the lake. The watershed is wooded with scattered open areas. The land use is limited to the scattered residential developments which surround the lake. There are no upstream impoundments or other significant storage areas.

### 5.2 DESIGN DATA:

The existing dam was constructed during 1966. The only hydraulic/hydrology calculations available are contained on the construction plans. The data presented as follows:

#### Design Data

Drainage Area .....	200 acres
Lake Area .....	33 acres
Dam Elevation .....	180.5 ft.

### Design Data

Spillway Elevation ..... 175.0 ft.  
Stop Log Control To Elevation ..... 165.0 ft.  
Maximum Drawdown Elevation ..... 155.0 ft.  
Design Storm Rainfall ..... 4 in./hr.  
Lake Storage (100% Runoff) at Elevation 177.0' ..... 4 in. rainfall  
Time of Concentration ..... 54 min.  
Design Runoff Coefficient ..... 0.33  
Spillway Width ..... 6 ft.  
Discharge at 2' Head ..... 55 cfs  
Discharge with Gates Opened at 25' Head ..... 100 cfs

The design calculations show that for a 4-inch rainfall with 100 percent runoff, total storage would be provided at elevation 177 assuming no outflow. The discharge given for 2 feet of head over the spillway is 55 cfs. The discharge with the sluice gates opened for 25 feet of head is given as 100 cfs.

#### 5.3 EXPERIENCE DATA:

No information is available on past flood experience or flood stages at the dam.

#### 5.4 TEST FLOOD ANALYSIS:

Under established criteria (OCE guidelines), the recommended test flood for the size (intermediate) and hazard potential (high) classification is the probable maximum flood (PMF).

The PMF is the flood that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible for the area.

The magnitude of the PMF was developed using the Soils Conservation Service method for determining flow rates as described in "Design of Small Dams" by the Bureau of Reclamation (see Appendix D). Due to the small watershed area of the dam, three PMF's were developed

based on probable maximum precipitations for storm durations of 1, 6 and 24 hours. Peak flows (PMF) for these three duration storms were calculated as 1595 cfs, 679 cfs, and 209 cfs respectfully. Triangular hydrographs were developed based on these PMF's, with the time durations set so that the hydrograph would contain the same volume of water as the estimated storm runoff.

For stage elevations from 175 to 177 feet discharges were computed as spillway flow with a weir coefficient of 3.3 (sharp crested weir). At water elevations greater than 177.67 discharges was computed by the summation of orifice flow over the spillway and the flow that enters the grate over the third chamber of the water control structure. At elevations greater than 179.4 the discharge capacity of the water control structure is limited by the capacity of the 36-inch diameter outlet. The maximum capacity of the water control structure at a stage of 5.5 feet corresponding to a top of dam elevation of 180.5, is 196 cfs. (The stage-discharge curve is contained in Appendix D.)

The three developed hydrographs were routed through the reservoir using a computer program based on stage-storage and stage-discharge data to determine the critical storm duration. The reservoir was assumed to be full to the spillway crest (elevation 175) prior to the storm event. The most critical storm for this dam is the 6-hour duration probable maximum precipitation. This storm results in a maximum water surface level of 179.7 feet, with 0.8 feet of remaining freeboard. Therefore, the capacity of the spillway is adequate to pass the PMF test flood outflow of 184 cfs without overtopping the dam (compare 196 cfs to 184 cfs).

#### 5.5 DAM FAILURE ANALYSIS:

The downstream impact of a dam failure was analyzed using the COE "Rule of Thumb Guidance for Estimating Downstream Failure Hydrographs" dated April 1978.

Based upon an assumed breach width equal to 40% of the dam's width at mid-height, the peak flow leaving the dam would be 16,630 cfs, with an initial depth of 12.9 feet downstream of the dam. The flood wave routing analysis extended 9,800 feet downstream of the dam, to the approximate center of Middletown, Connecticut.

Flood wave levels within this reach vary from El. 90+ to El. 80+ with related depths of flow ranging from 10 to 5 feet at site of residential homes. Calculated flows are about 15,000± cfs, 1,000 feet downstream of the dam, and 5,300± cfs at 9,800 feet below the dam.

The areas of probable impact include scattered residential homes along Millbrook Road and East Main Street. In addition, State Highway Route 155 is located 3,500+ feet downstream of the dam. The number of dwellings in the probable impact area is approximately 20. It should be noted that the failure of the dam at this site in 1961 caused significant economic loss but no loss of life. Approximately 15 houses are in area where flooding depths of 1 to 3 feet (above first floor levels) are estimated. About 3 houses would have flooding of 3 to 5 feet. About two houses would have flooding of 5 to 10 feet.

## SECTION 6 - EVALUATION OF STRUCTURAL STABILITY

### 6.1 VISUAL OBSERVATIONS:

No evidence was observed indicating structural instability of the embankment dam.

### 6.2 DESIGN AND CONSTRUCTION DATA:

Sufficient data is not available on the soil properties and design and construction of the earth embankment to permit a formal evaluation of stability. The design data reviewed, however, does not point to any sources or areas of structural instability.

### 6.3 POST-CONSTRUCTION CHANGES:

A comparison of the visual appearance of the dam and the record drawings indicate that no major modifications have been made to the dam.

### 6.4 SEISMIC STABILITY:

This dam is in Seismic Zone 1, and in accordance with the recommended guidelines of the Corps of Engineers does not warrant seismic analysis.

## SECTION 7 - ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES

### 7.1 DAM ASSESSMENT:

a. Condition. A visual inspection and a review of available design information indicate that Crystal Lake Dam is in generally fair condition and functioning adequately. No immediate actions to remedy any serious problems are required.

The total capacity of the water control structure is adequate to pass the PMF test flood outflow of 184 cfs without overtopping the dam (compare 196 cfs to 184 cfs).

b. Adequacy of Information. The evaluation of the dam is mainly based on the results of the visual inspection assisted by the general physical dimensions provided in the available contract drawings.

c. Urgency. The owner should implement the recommendations in 7.2 and 7.3 within one year after receipt of this Phase I report.

### 7.2 RECOMMENDATIONS:

The following items should be performed under the direction of a Qualified Registered Engineer:

a. Develop methods to monitor and ensure proper operation of the pressure relief wells.

b. Develop methods of determining potential for seepage through the dam.

c. Maintain clear of trees and brush the dam embankment, an area within 25 feet of the downstream toe, and the outlet channel for a distance of 100 feet downstream from the dam.

### 7.3 REMEDIAL MEASURES:

a. Operating and Maintenance Procedures. The owner should:

1) Engage a Qualified Registered Engineer to make a comprehensive technical inspection once every year.

2) Establish a surveillance program for use during and immediately after heavy rainfall and also a warning program to follow in case of emergency conditions.

3) Remove grate or provisions for quick release at outlet end of 36 in. diameter pipe.

#### 7.4 ALTERNATIVES:

There are no practical alternatives to the recommendations presented in 7.2 and 7.3 above.

APPENDIX A

INSPECTION CHECK LIST

## PARTY ORGANIZATION

W.S. ELEV. \_\_\_\_\_ U.S. \_\_\_\_\_ DN.S. \_\_\_\_\_

**5.**

10.



**PERIODIC INSPECTION CHECK LIST**  
**NATIONAL DAM INSPECTION PROGRAM**

**DAM:** Crystal Lake Dam, CT

**DATE:** Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<u><b>DAM EMBANKMENT</b></u>	
Crest Elevation	
Current Pool Elevation	
Maximum Impoundment to Date	Unknown.
Surface Cracks	None.
Pavement Condition	Grassy surface, path 15" wide, 3" rut across dam.
Movement or Settlement of Crest	None.
Lateral Movement	None observed.
Vertical Alignment	Good.
Horizontal Alignment	Good.
Condition at Abutment and at Concrete Structures	Some minor erosion along dam adjacent to left abutment.
Indications of Movement of Structural Items on Slopes	None.
Trespassing on Slopes	Rockfill downstream face, riprap paving upstream.
Sloughing or Erosion of Slopes or Abutments	
Rock Slope Protection - Riprap Failures	None observed
Unusual Movement or Cracking at or near Toes	None.
Unusual Embankment or Downstream Seepage	None.
Piping or Boils	None.
Foundation Drainage Features	Drawing indicates downstream drainage blanket.
Toe Drains	Downstream drainage blanket.
Instrumentation System	Possible piezometer.
Vegetation	Grass along crest.

**PERIODIC INSPECTION CHECK LIST**  
**NATIONAL DAM INSPECTION PROGRAM**

**DAM:** Crystal Lake Dam

**DATE:** Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<p><u>DIKE EMBANKMENT</u></p> <p>Crest Elevation</p> <p>Current Pool Elevation</p> <p>Maximum Impoundment to Date</p> <p>Surface Cracks</p> <p>Pavement Condition</p> <p>Movement or Settlement of Crest</p> <p>Lateral Movement</p> <p>Vertical Alignment</p> <p>Horizontal Alignment</p> <p>Condition at Abutment and at Concrete Structures</p> <p>Indications of Movement of Structural Items on Slopes</p> <p>Trespassing on Slopes</p> <p>Sloughing or Erosion of Slopes or Abutments</p> <p>Rock Slope Protection - Riprap Failures</p> <p>Unusual Movement or Cracking at or near Toes</p> <p>Unusual Embankment or Downstream Seepage</p> <p>Piping or Boils</p> <p>Foundation Drainage Features</p> <p>Toe Drains</p> <p>Instrumentation System</p> <p>Vegetation</p>	<p>Not applicable.</p>

# PERIODIC INSPECTION CHECK LIST

## NATIONAL DAM INSPECTION PROGRAM

**DAM:** Crystal Lake Dam

DATE: Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<u>OUTLET WORKS - INTAKE</u> <u>CHANNEL AND INTAKE</u> <u>STRUCTURE</u>	Underwater
a. Approach Channel <ul style="list-style-type: none"> <li>Slope Conditions</li> <li>Bottom Conditions</li> <li>Rock Slides or Falls</li> <li>Log Boom</li> <li>Debris</li> <li>Condition of Concrete Lining</li> <li>Drains or Weep Holes</li> </ul>	
b. Intake Structure <ul style="list-style-type: none"> <li>Condition of Concrete</li> <li>Stop Logs and Slots</li> </ul>	Concrete above water in good condition, valve stems appear in good condition. No valve operators. Underwater.

**PERIODIC INSPECTION CHECK LIST**  
**NATIONAL DAM INSPECTION PROGRAM**

**DAM:** Crystal Lake Dam, CT.

**DATE:** Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<p><b>OUTLET WORKS - CONTROL TOWER</b></p> <p><b>a. Concrete and Structural</b></p> <p>General Condition</p> <p>Condition of Joints</p> <p>Spalling</p> <p>Visible Reinforcing</p> <p>Rusting or Staining of Concrete</p> <p>Any Seepage or Efflorescence</p> <p>Joint Alignment</p> <p>Unusual Seepage or Leaks in Gate Chamber</p> <p>Cracks</p> <p>Rusting or Corrosion of Steel</p> <p><b>b. Mechanical and Electrical</b></p> <p>Air Vents</p> <p>Float Wells</p> <p>Crane Hoist</p> <p>Elevator</p> <p>Hydraulic System</p> <p>Service Gates</p> <p>Emergency Gates</p> <p>Lightning Protection System</p> <p>Emergency Power System</p> <p>Wiring and Lighting System in Gate Chamber</p>	<p>Not applicable.</p>

**PERIODIC INSPECTION CHECK LIST**  
**NATIONAL DAM INSPECTION PROGRAM**

**DAM:** Crystal Lake Dam

**DATE:** Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<p data-bbox="79 352 541 415"><u>OUTLET WORKS - TRANSITION</u> <u>AND CONDUIT</u></p> <p data-bbox="112 443 485 506">General Condition of Concrete</p> <p data-bbox="112 533 469 596">Rust or Staining on Concrete</p> <p data-bbox="112 623 270 665">Spalling</p> <p data-bbox="112 686 502 718">Erosion or Cavitation</p> <p data-bbox="112 749 270 781">Cracking</p> <p data-bbox="112 812 518 844">Alignment of Monoliths</p> <p data-bbox="112 875 469 907">Alignment of Joints</p> <p data-bbox="112 938 518 970">Numbering of Monoliths</p>	<p data-bbox="662 373 931 405">Not applicable.</p>

**PERIODIC INSPECTION CHECK LIST**  
**NATIONAL DAM INSPECTION PROGRAM**

DAM: Crystal Lake Dam

DATE: Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<p><u>OUTLET WORKS - OUTLET STRUCTURE AND OUTLET CHANNEL</u></p> <p>General Condition of Concrete</p> <p>Rust or Staining</p> <p>Spalling</p> <p>Erosion or Cavitation</p> <p>Visible Reinforcing</p> <p>Any Seepage or Efflorescence</p> <p>Condition at Joints</p> <p>Drain Holes</p> <p>Channel</p> <p>Loose Rock or Trees Overhanging Channel</p> <p>Condition of Discharge Channel</p>	<p>Excellent condition, no evidence of deterioration.</p> <p>None.</p> <p>None.</p> <p>None.</p> <p>None.</p> <p>None.</p> <p>None observed.</p> <p>Natural soil and gravel bottom.</p> <p>Trees and rocks overhanging channel on both banks.</p> <p>Considerable trees, brush and trash located in channel downstream of outlet works.</p>

**PERIODIC INSPECTION CHECK LIST**  
**NATIONAL DAM INSPECTION PROGRAM**

**DAM:** Crystal Lake Dam

**DATE:** Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<u>OUTLET WORKS - SPILLWAY WEIR,</u> <u>APPROACH AND DISCHARGE</u> <u>CHANNELS</u>	
<b>a. Approach Channel</b>	
General Condition	Upstream face of the dam underwater.
Loose Rock Overhanging Channel	
Trees Overhanging Channel	
Floor of Approach Channel	
<b>b. Weir and Training Walls</b>	
General Condition of Concrete	
Rust or Staining	
Spalling	
Any Visible Reinforcing	
Any Seepage or Efflorescence	
Drain Holes	None.
<b>c. Discharge Channel</b>	
General Condition	Same as outlet channel.
Loose Rock Overhanging Channel	
Trees Overhanging Channel	
Floor of Channel	
Other Obstructions	

PERIODIC INSPECTION CHECK LIST  
NATIONAL DAM INSPECTION PROGRAM

DAM: Crystal Lake Dam, CT.

DATE: Oct. 1, 1979

AREA EVALUATED	CONDITIONS
<u>OUTLET WORKS - SERVICE BRIDGE</u>	None.
a. Superstructure	
Bearings	
Anchor Bolts	
Bridge Seat	
Longitudinal Members	
Under Side of Deck	
Secondary Bracing	
Deck	
Drainage System	
Railings	
Expansion Joints	
Paint	
b. Abutment & Piers	
General Condition of Concrete	
Alignment of Abutment	
Approach to Bridge	
Condition of Seat and Backwall	



APPENDIX B

ENGINEERING DATA

CHECK LIST  
ENGINEERING DATA  
DESIGN, CONSTRUCTION, OPERATION  
PHASE I

NAME OF DAM CRYSTAL LAKE DAM

I.D. NO. CT-00138


ITEM	REMARKS
AS-BUILT DRAWINGS	CONSTRUCTION PLANS - DEP FILES
REGIONAL VICINITY MAP	AVAILABLE FROM U.S.G.S.
CONSTRUCTION HISTORY	LIMITED DATA - DEP FILES
TYPICAL SECTIONS OF DAM	FROM PLANS
OUTLETS - Plan	FROM PLANS
- Details	FROM PLANS
- Constraints	UNKNOWN
- Discharge Ratings	DESIGN DATA SHOWN ON PLANS
RAINFALL/RESERVOIR RECORDS	UNAVAILABLE
DESIGN REPORTS	LIMITED DATA - DEP FILES
GEOLOGY REPORTS	NONE
DESIGN COMPUTATIONS	DESIGN DATA SHOWN ON PLANS
HYDROLOGY & HYDRAULICS	LIMITED DATA - DEP FILES
DAM STABILITY	LIMITED DATA - DEP FILES
SEEPAGE STUDIES	
MATERIALS INVESTIGATIONS	SHOWN ON PLANS
BORINGS RECORDS	NONE
LABORATORY	NONE
FIELD	

CHECK LIST  
ENGINEERING DATA  
DESIGN, CONSTRUCTION, OPERATION  
PHASE I


NAME OF DAM CRYSTAL LAKE DAM  
I.D. NO. CT-00138

ITEM	REMARKS
POST-CONSTRUCTION SURVEYS OF DAM	NONE AVAILABLE
BORROW SOURCES	UNKNOWN
MONITORING SYSTEMS	UNKNOWN
MODIFICATIONS	UNKNOWN
HIGH POOL RECORDS.	NONE
POST-CONSTRUCTION ENGINEERING STUDIES AND REPORTS	LIMITED DATA - DEP FILES
PRIOR ACCIDENTS OR FAILURE OF DAM DESCRIPTION REPORTS	DAM AT THIS SITE FAILED - APRIL 27, 1961 NEWSPAPER REPORTS - DEP FILES
MAINTENANCE OPERATION RECORDS	NONE
SPILLWAY PLAN	
SECTIONS	FROM PLANS
DETAILS	FROM PLANS
OPERATING EQUIPMENT PLANS & DETAILS	FROM PLANS

DC

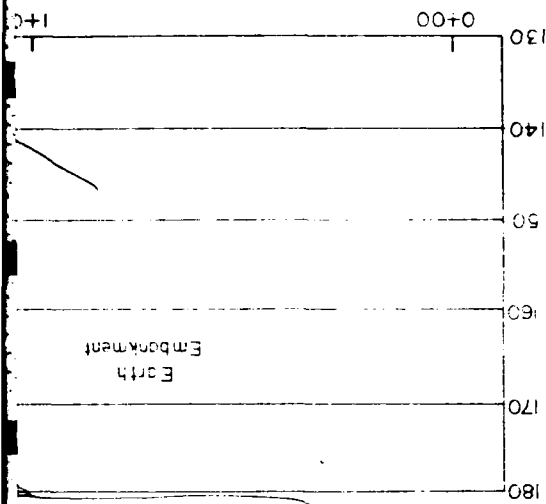


PLA

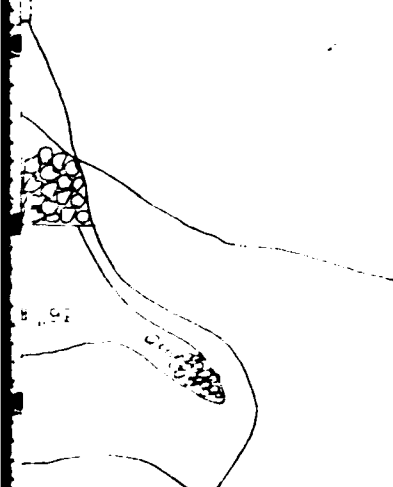


N

# DOWNSTREAM ELEVATION OF DAM

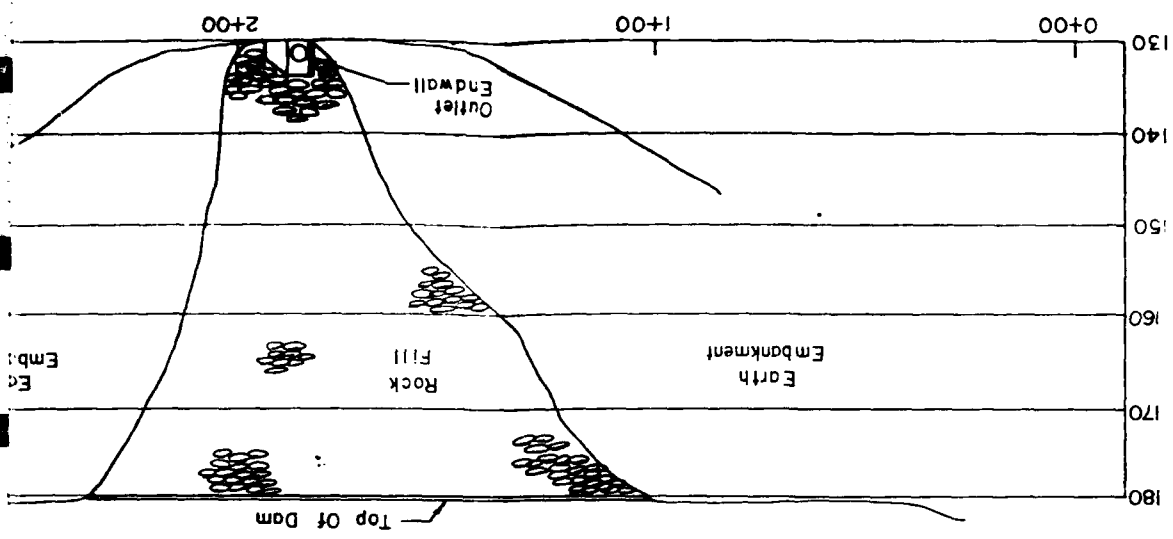



## PLAN

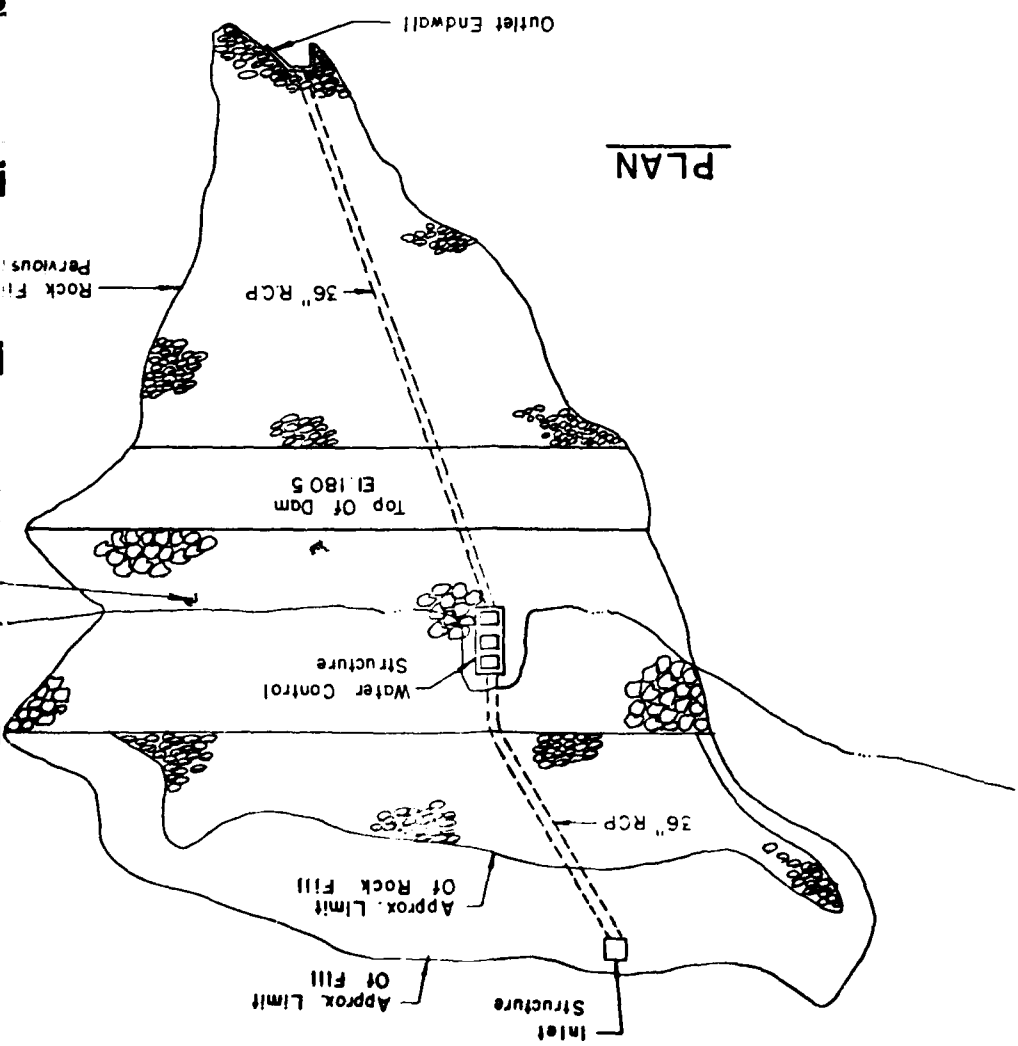

N



# CRYSTAL LAKE DAM

## STREAM ELEVATION OF DAM

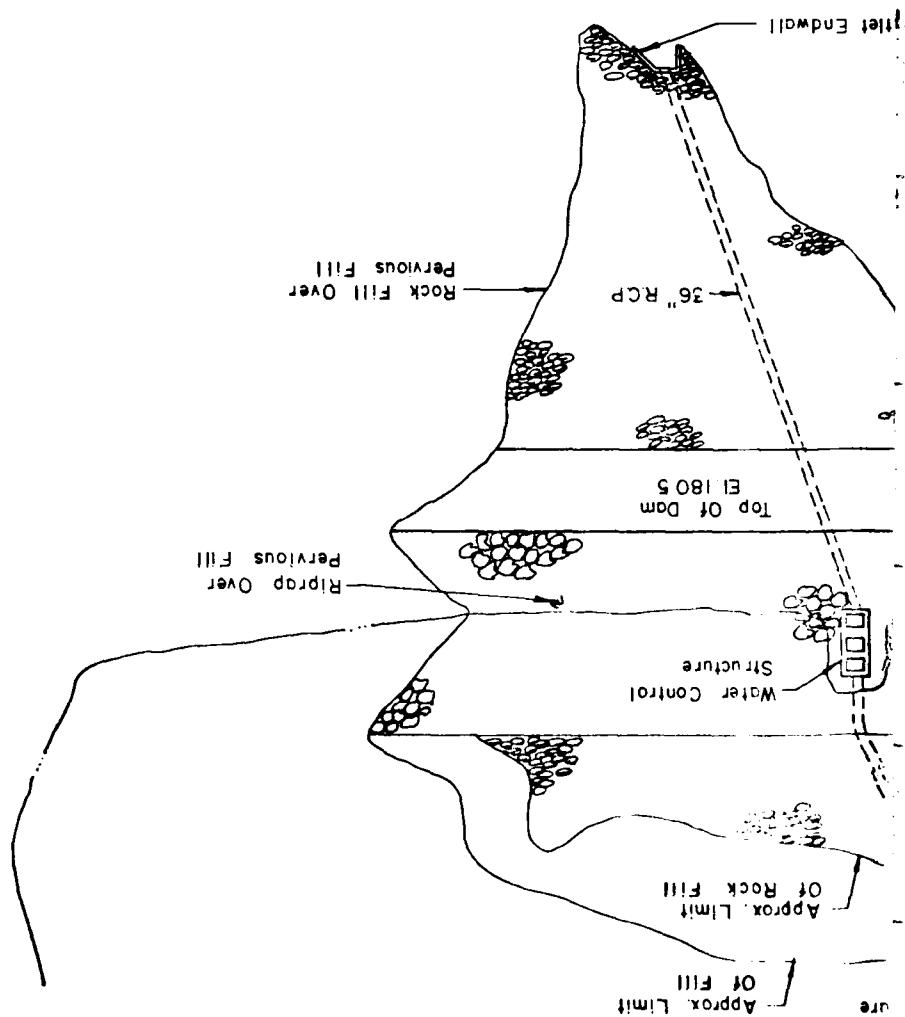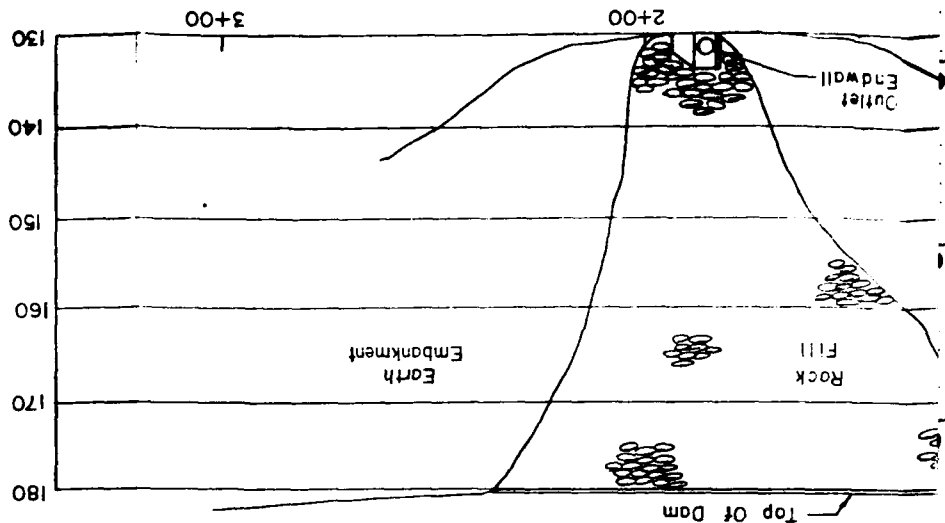

# DESIGN DATA

DRAINAGE AREA ----- 200 ACRES  
 LAKE AREA ----- 33 ACRES  
 DAM ELEVATION ----- 180.8 FT  
 SPILLWAY ELEVATION ----- 175.0 FT  
 STOP LOG CONTROL TO ELEVATION ----- 185.0 FT  
 MAXIMUM DRAWDOWN ELEVATION ----- 155.0 FT  
 24 HR STOP RAINFALL ----- 4 IN/HR  
 LAKE STORAGE (100% RUNOFF) AT ELEVATION 177.0' ----- 4 IN RAINFALL  
 TIME OF CONCENTRATION ----- 54 MIN  
 DESIGN RUNOFF COEFFICIENT ----- 0.33  
 SPILLWAY WIDTH ----- 6 FT  
 DISCHARGE AT 2' HEAD ----- 55 CFS  
 DISCHARGE WITH GATES OPENED AT 25' HEAD ----- 100 CFS

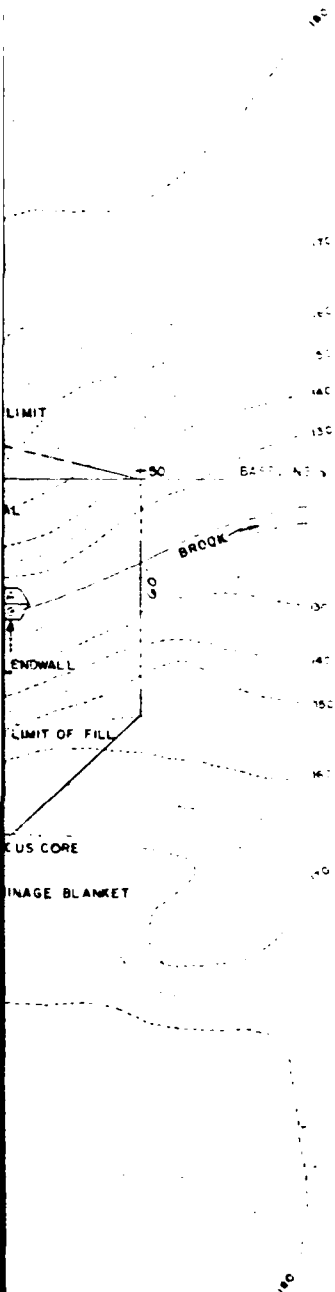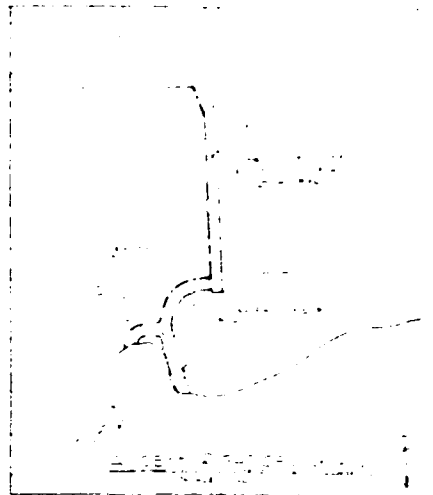

## NOTE

PLANS BASED ON MAP NO. 81-82-53, DATED DECEMBER 1953, PREPARED BY CHAMBERLAIN AND PALMER ENGINEERS, NORWICH, CONN. FOR THE STATE OF CONNECTICUT.

REDUCED NOT TO SCALE

## SITE PLAN

STATE OF CONNECTICUT  
 PUBLIC WORKS DEPARTMENT  
 T. J. MURPHY, JR., COMMISSIONER

CONSTRUCTION OF DAM  
 CRYSTAL LAKE

MIDDLETOWN CONNECTICUT

PLANS PREPARED BY  
 ONDERDONK AND LATHROP  
 CONSULTING ENGINEERS  
 GLASTONBURY CONNECTICUT


DATE: MAY 1954  
 AS NOTED

REVISIONS		
NO.	DESCRIPTION	DATE



# DESIGN DATA

DRAINAGE AREA	200 ACRES
LAKE AREA	33 ACRES
DAM ELEVATION	180.5 FT
SPILLWAY ELEVATION	175.2 FT
STOP LOG CONTROL TO ELEVATION	165.0 FT
MAXIMUM DRAWDOWN ELEV. AT O/S	155.0 FT
DESIGN STORM RAINFALL	4 IN/HR
LAKE STORAGE (100% RUNOFF) AT ELEVATION 1770	4 IN RAINFALL
TIME OF CONCENTRATION	54 MIN
DESIGN RUNOFF COEFFICIENT	0.33
SPILLWAY WIDTH	6 FT
DISCHARGE AT 2' HEAD	55 CFS
DISCHARGE WITH GATES OPENED AT 25' HEAD	100 CFS

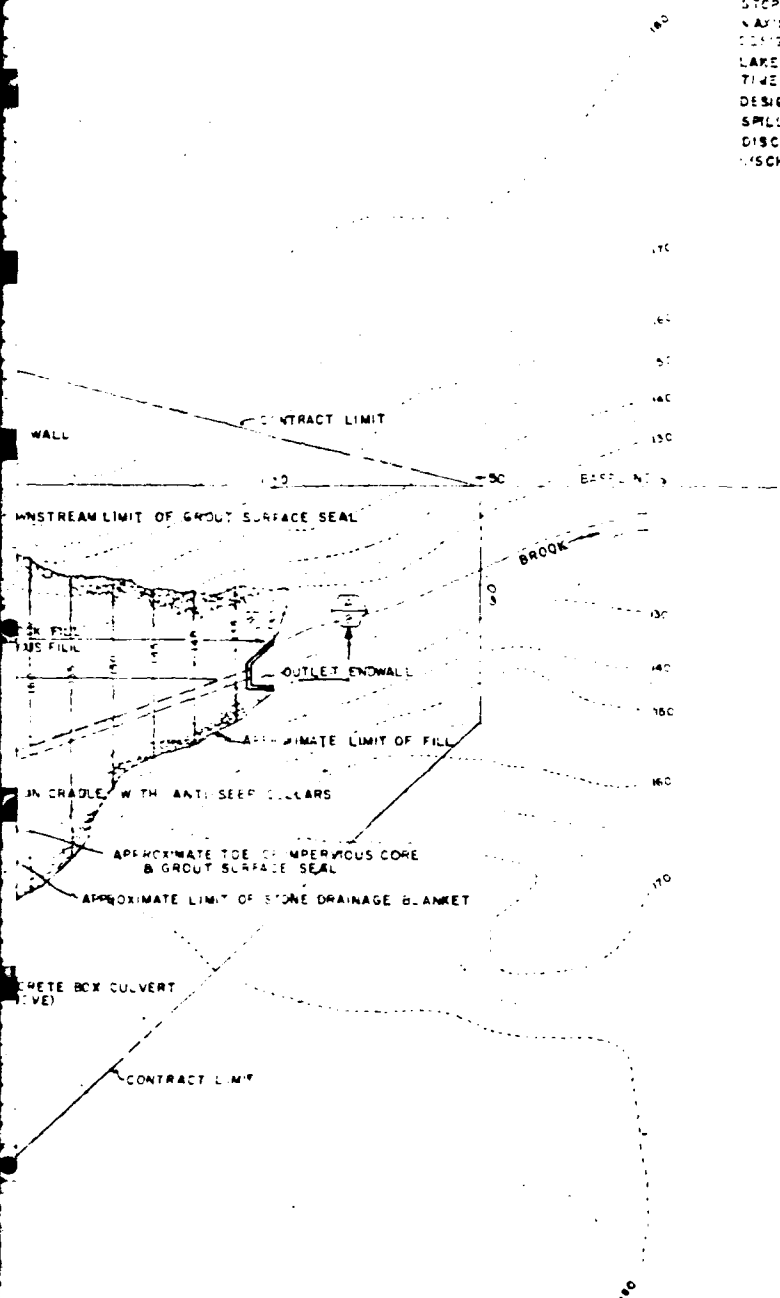

## NOTE

BASED UPON DESIGN FOR LIFE "LIMITED" PLAN OF SECTION OF CRISTAL LAKE  
 PART NO. 01-BB-53, DATED DECEMBER 1962, PREPARED BY  
 PALMER ENGINEERING, PROVIDENCE, R.I. FOR THE STATE OF RHODE ISLAND

REDUCED NOT TO

SITE PLAN

STATE OF CONNECTICUT  
 PUBLIC WORKS  
 T. J. MURPHY JR.

CONSTRUCTION  
 CRYSTAL

MIDDLETOWN


PLAN  
 UNDERDRAIN  
 CONSULTING  
 GLASTONBURY

DATE  
 AT NEW BED

REVISIONS	
DESCRIPTION	DATE





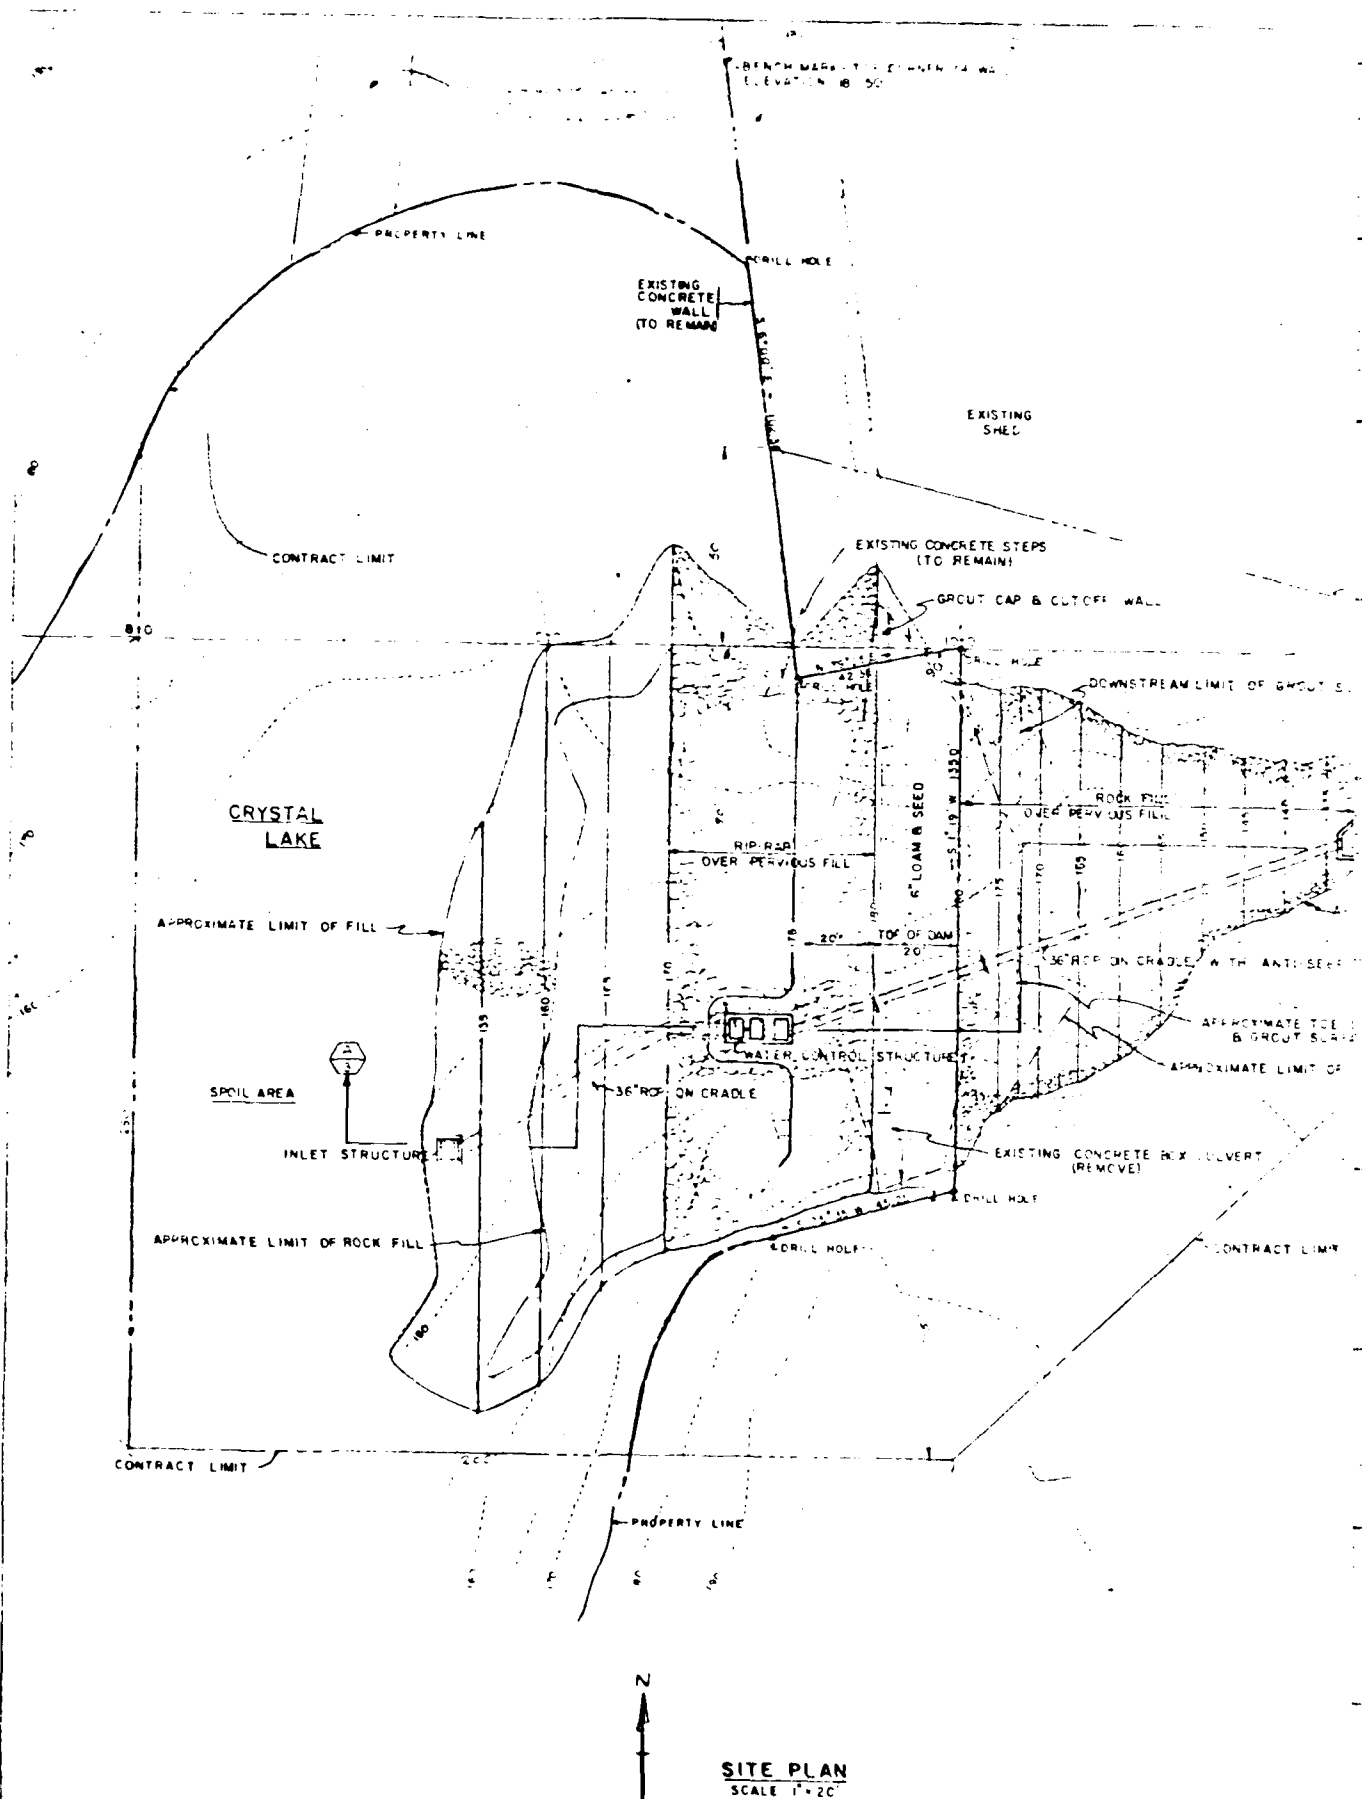

# BOHRING - 5

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE 15  
WATER AT 15  
BOHRING BE DONE  
TO OBTAIN DEPT  
SPOON SAMPLES  
OF TOP MATERIAL

# BOHRING - 2


1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE 15  
WATER AT 15  
BOHRING BE DONE  
TO OBTAIN DEPT  
SPOON SAMPLES  
OF TOP MATERIAL

# BOHRING - 10

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE 15  
WATER AT 15  
BOHRING BE DONE  
TO OBTAIN DEPT  
SPOON SAMPLES  
OF TOP MATERIAL

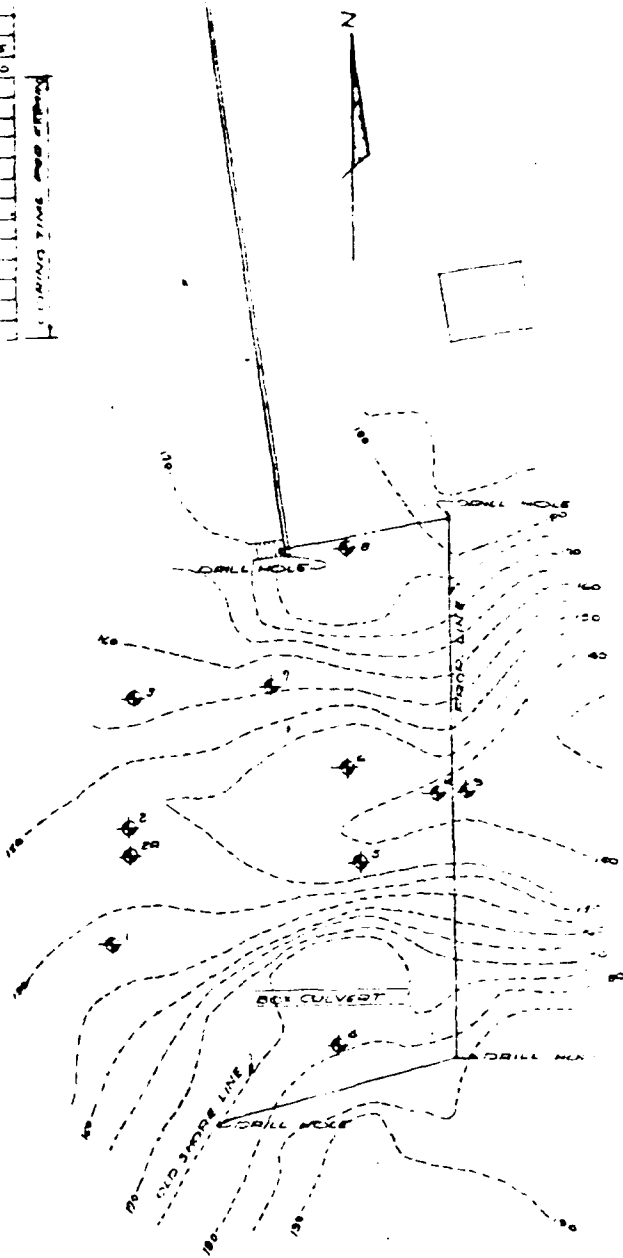

# LOCATION PLAN

SCALE 1" = 50'

# NOTE

1. ALL BORING LOGS WITH SERIES "M"
2. BORING LOGS WITH SERIES "M"
3. BORING LOGS WITH SERIES "M"
4. BORING LOGS WITH SERIES "M"
5. BORING LOGS WITH SERIES "M"
6. BORING LOGS WITH SERIES "M"
7. BORING LOGS WITH SERIES "M"
8. BORING LOGS WITH SERIES "M"
9. BORING LOGS WITH SERIES "M"
10. BORING LOGS WITH SERIES "M"
11. BORING LOGS WITH SERIES "M"
12. BORING LOGS WITH SERIES "M"
13. BORING LOGS WITH SERIES "M"
14. BORING LOGS WITH SERIES "M"
15. BORING LOGS WITH SERIES "M"
16. BORING LOGS WITH SERIES "M"
17. BORING LOGS WITH SERIES "M"
18. BORING LOGS WITH SERIES "M"
19. BORING LOGS WITH SERIES "M"
20. BORING LOGS WITH SERIES "M"
21. BORING LOGS WITH SERIES "M"
22. BORING LOGS WITH SERIES "M"
23. BORING LOGS WITH SERIES "M"
24. BORING LOGS WITH SERIES "M"
25. BORING LOGS WITH SERIES "M"
26. BORING LOGS WITH SERIES "M"
27. BORING LOGS WITH SERIES "M"
28. BORING LOGS WITH SERIES "M"
29. BORING LOGS WITH SERIES "M"
30. BORING LOGS WITH SERIES "M"

# BORINGS

STATE OF CONNECTICUT  
PUBLIC WORKS DEPARTMENT  
T. J. MURPHY, JR., COMMISSIONER

CONSTRUCTION OF DAM P. 59 53  
CRYSTAL LAKE  
MIDDLETOWN CONNECTICUT

DESIGNED BY  
J. E. R.  
CHECKED BY  
E. E. L.  
APPROVED BY  
C. B. P.



PLANS PREPARED BY  
ONDERDONK AND LATHROP  
CONSULTING ENGINEERS  
GLASTONBURY CONNECTICUT  
DATE  
AS NOTED




REVISIONS	DESCRIPTION	DATE
1		
2		
3		
4		
5		
6		
7		
8		
9		
10		
11		
12		
13		
14		
15		
16		
17		
18		
19		
20		
21		
22		
23		
24		
25		
26		
27		
28		
29		
30		

REDUCED NOT TO SCALE

FL 132

2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100



CORING TIME PER FT (MIN)

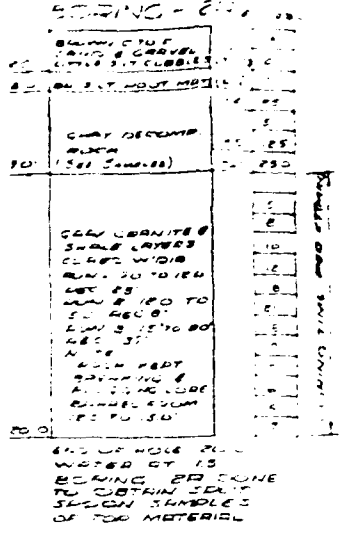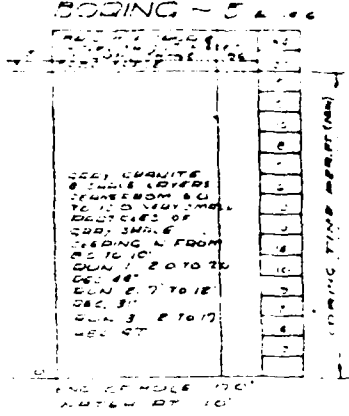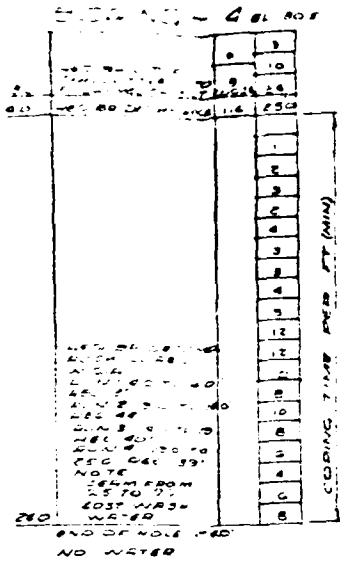

FL 132

23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100

CORING TIME PER FT (MIN)

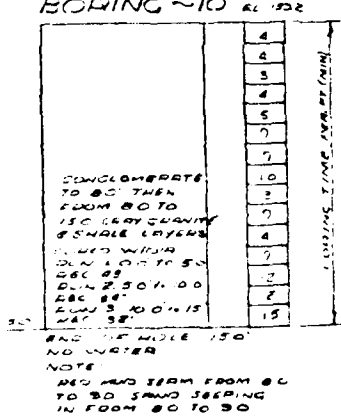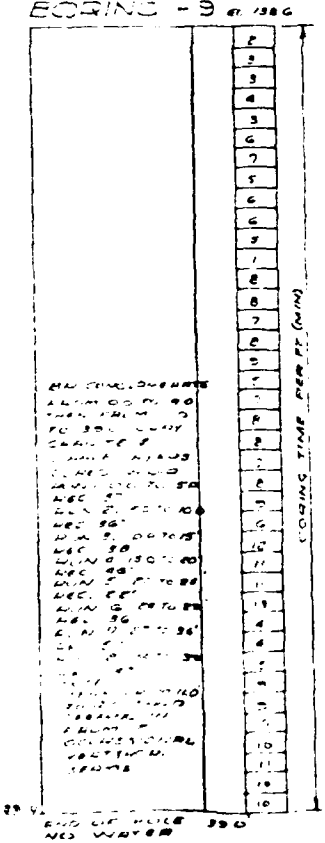

- NOTE
- 1 ALL BORING LOGS WITH SERIAL NO.
  - 2 DOUBLE CHECKED FOR ERRORS.
  - 3 INDICATES IN CASE OF DISCREPANCY BETWEEN LOGS.
  - 4 INDICATES IN CASE OF DISCREPANCY BETWEEN LOGS.
  - 5 INDICATES IN CASE OF DISCREPANCY BETWEEN LOGS.


REVISIONS

NO.	DESCRIPTION	DATE

STATE OF  
PUBLIC WORKS  
CONSTRUCTION  
MURPHY

ON  
PAGE 1

REDUCED NOT TO SCALE

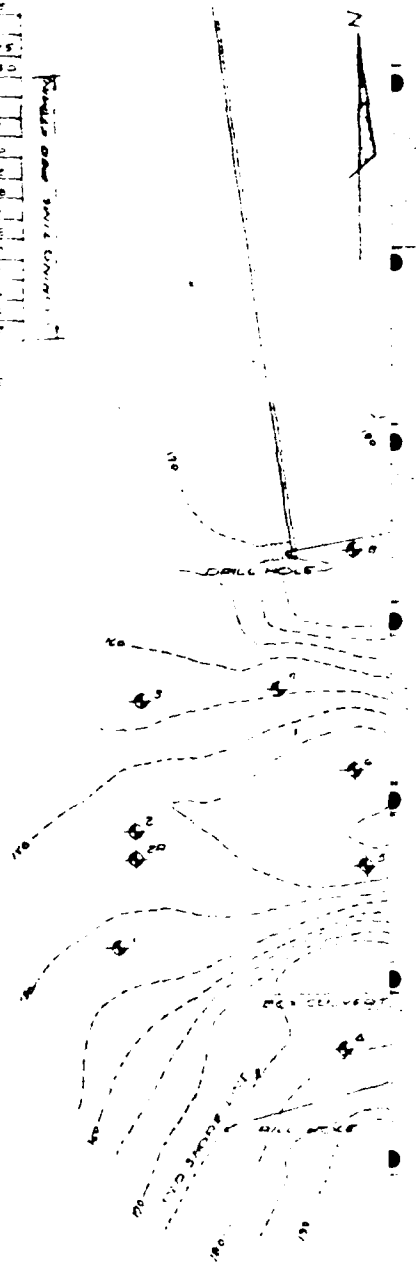

**BORING - 1**

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE 130  
NO WATER

**BORING - 2**

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE  
WATER AT 15

**BORING - 3**

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE 130  
NO WATER

**BORING - 6**

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30

END OF HOLE 130  
WATER AT 20

**BORING - 7**

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30


END OF HOLE 130  
NO WATER

**BORING - 8**

1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
10	10
11	11
12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30


END OF HOLE 130  
NO WATER

**BORING - 10**

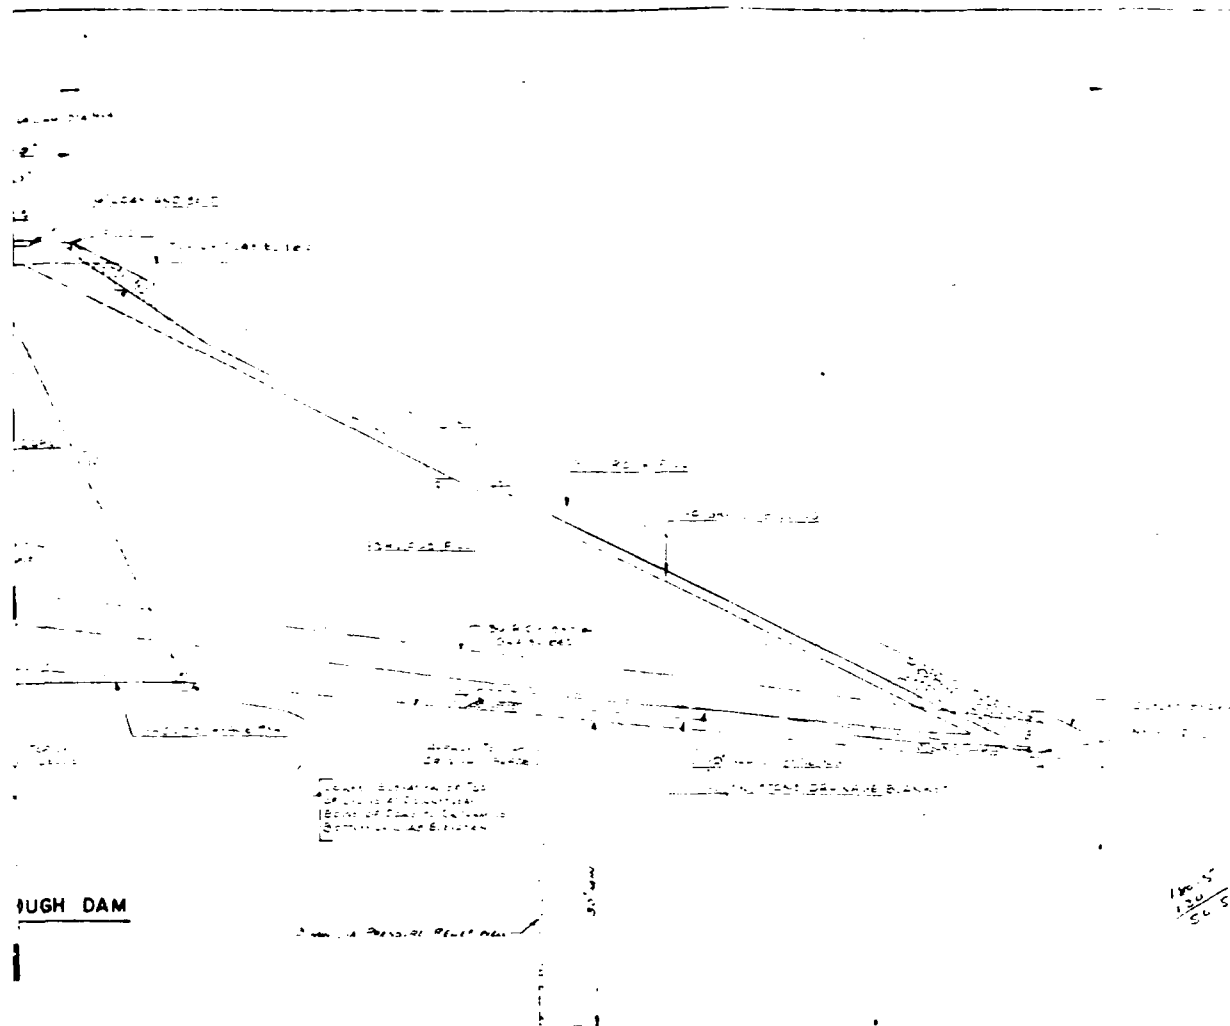

## ROUGH DAM

000  
M 100. 100

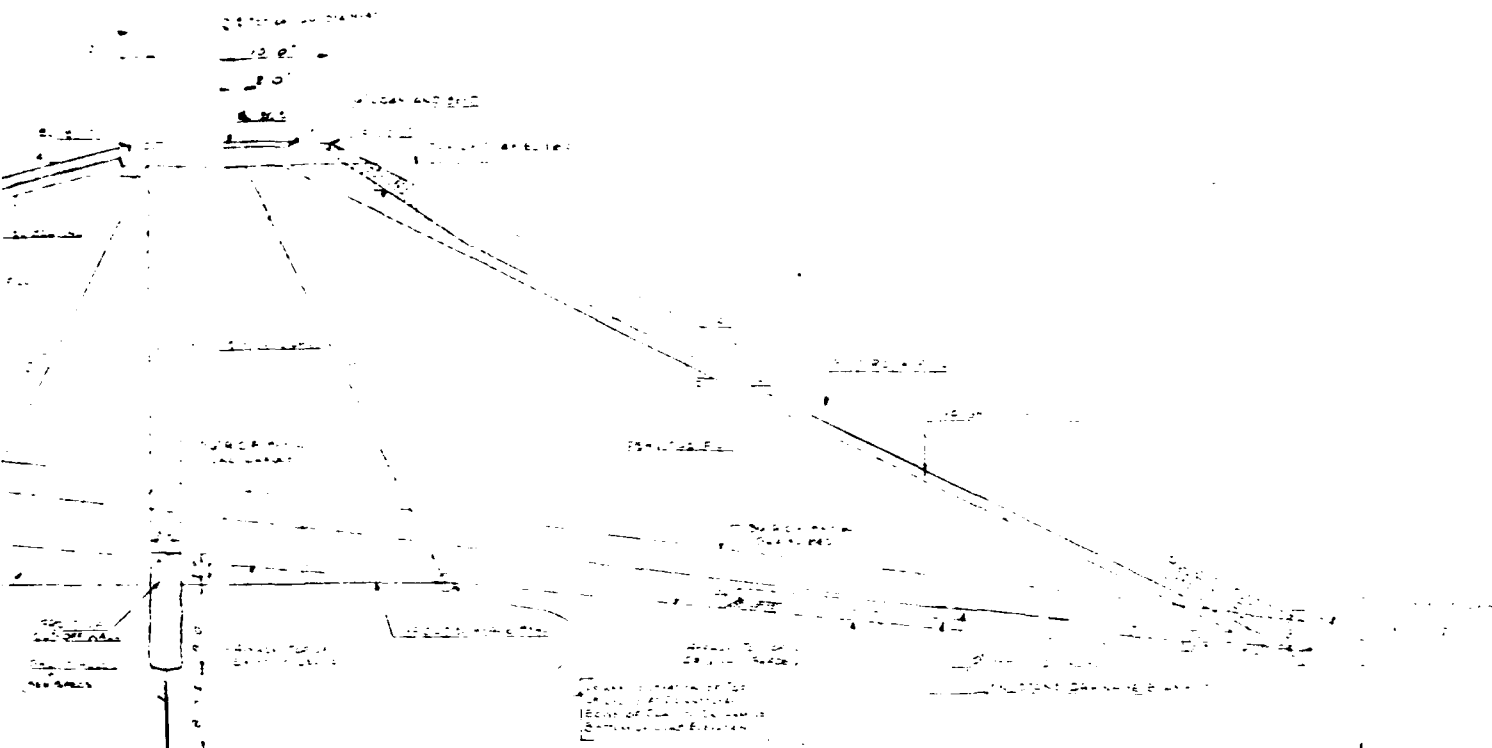

180 5  
130 5  
50 5

REDUCED Not To


DAM SECTION I


STATE OF CONN  
PUBLIC WORKS  
T J MURPHY JR

CONSTRUCTION  
CRYSTAL  
MILLETOWN

PLANS  
ONDERHOUD  
CONSULT  
CLASSTONBY  
4.0  
AS NOTED




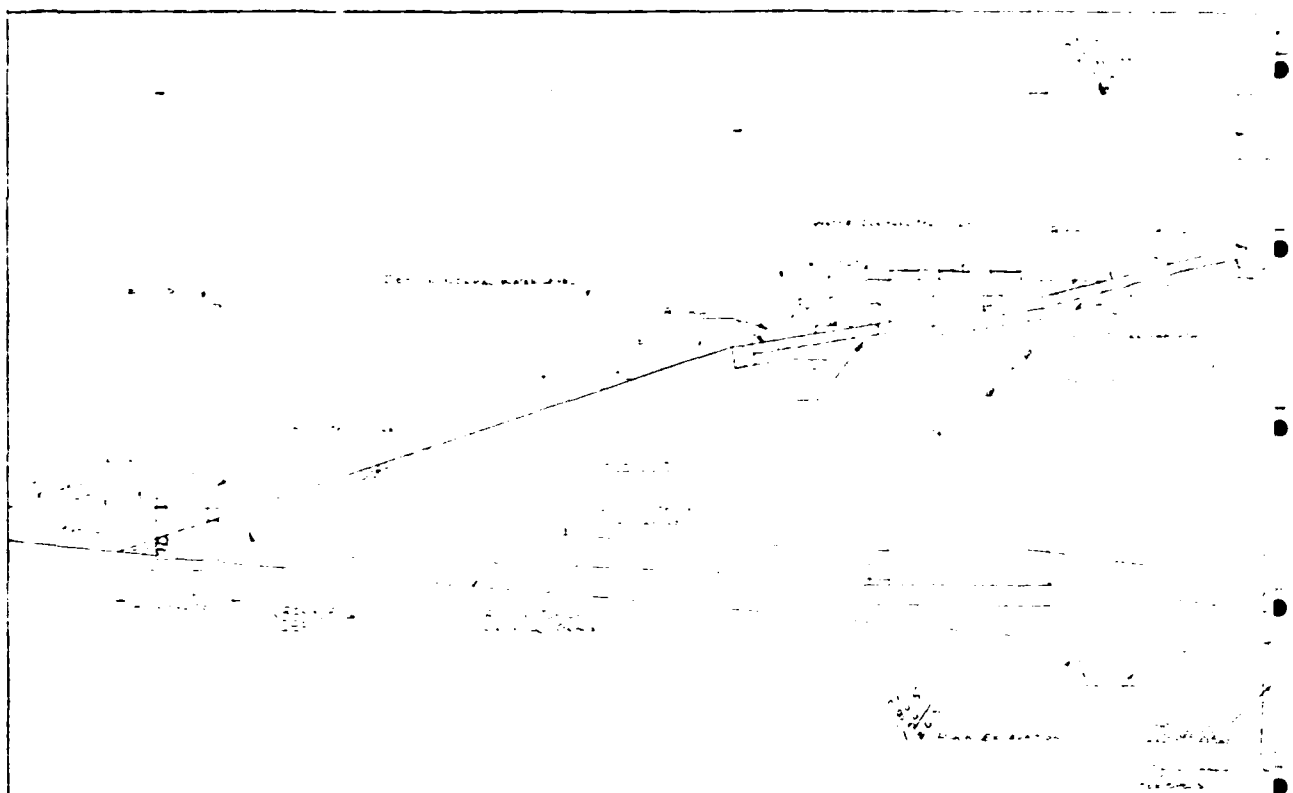


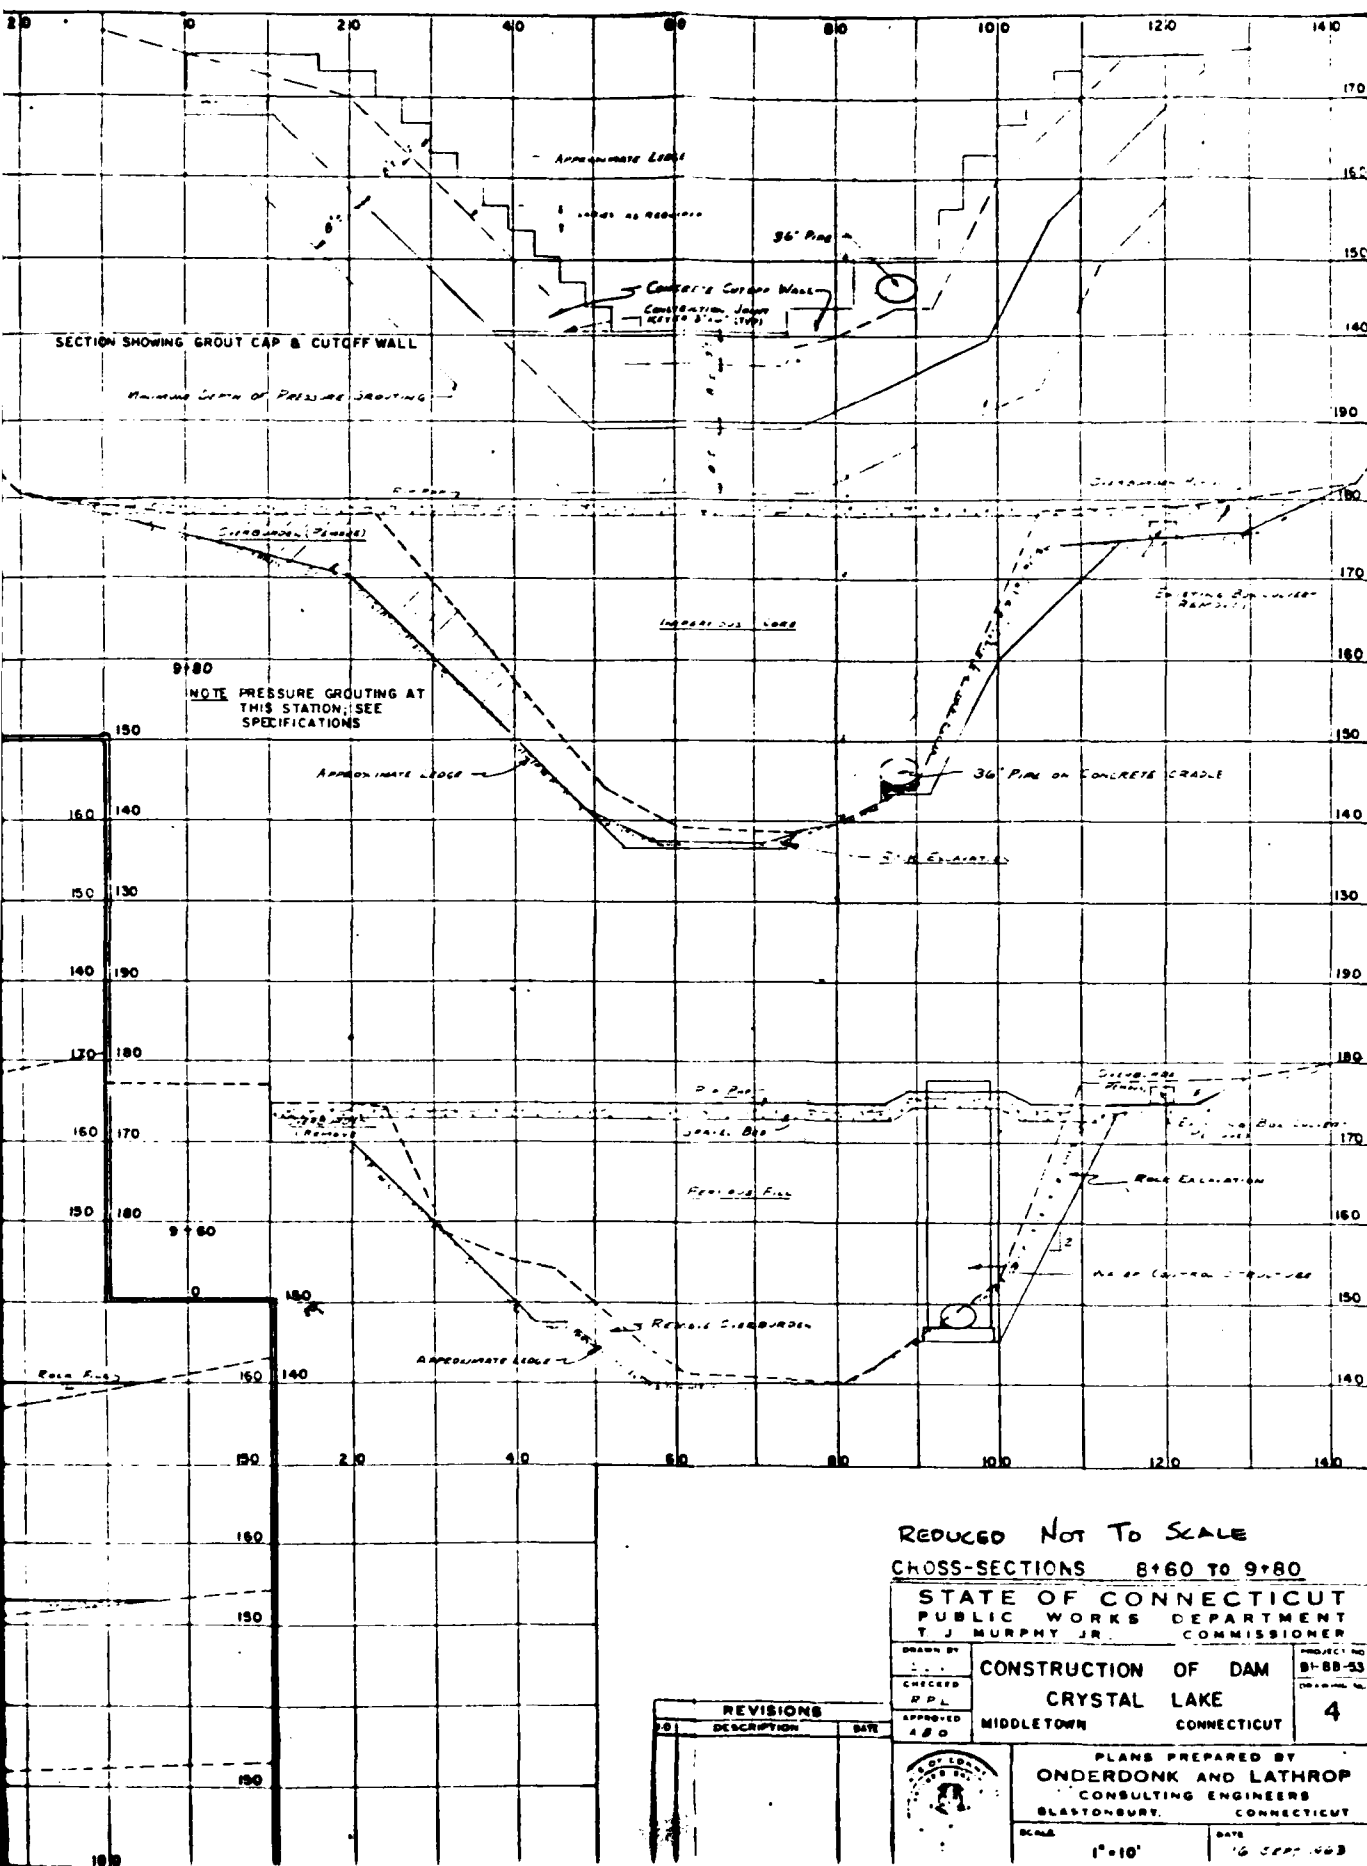






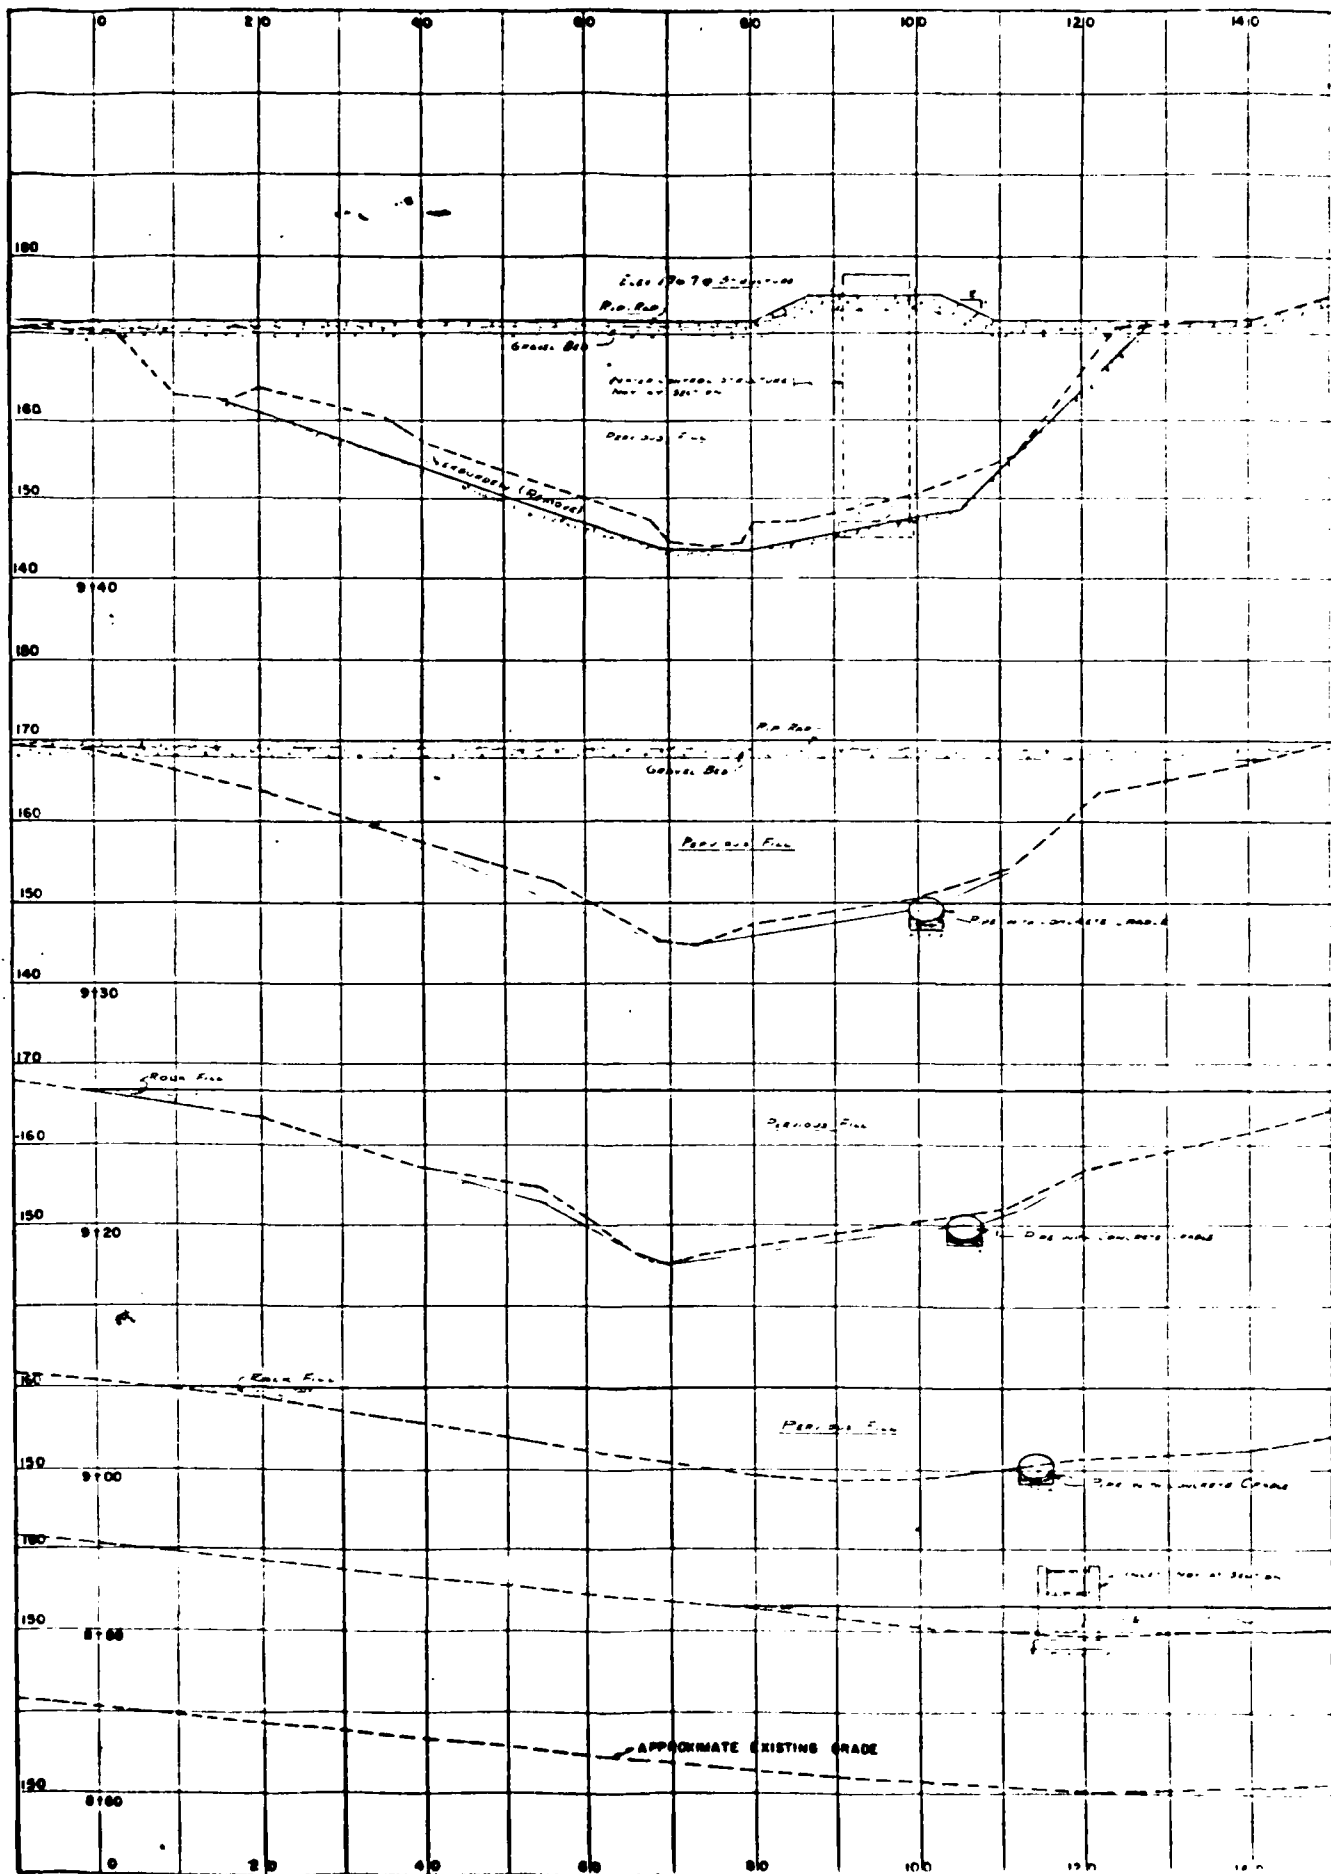

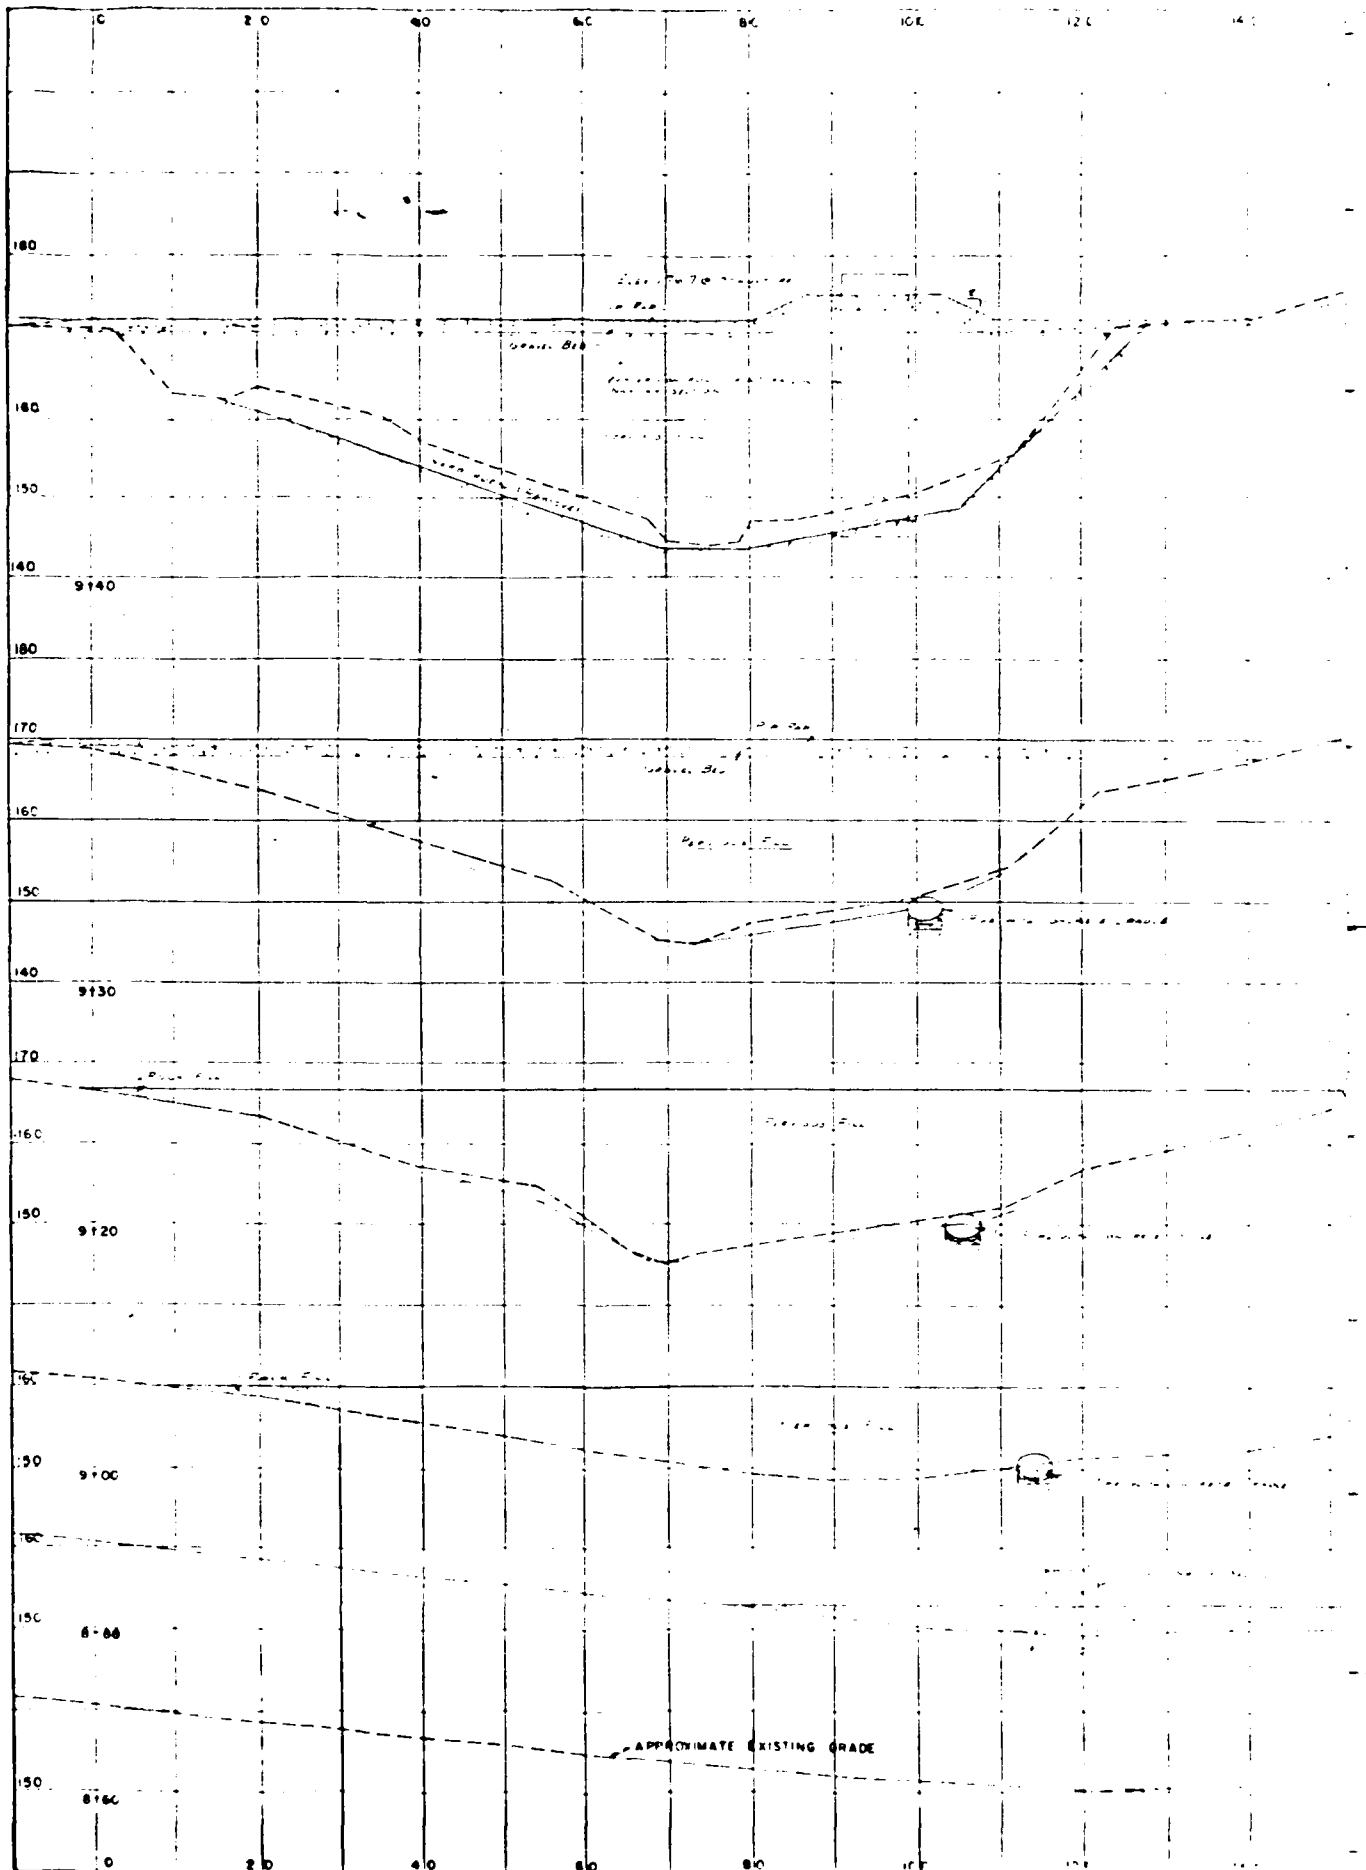

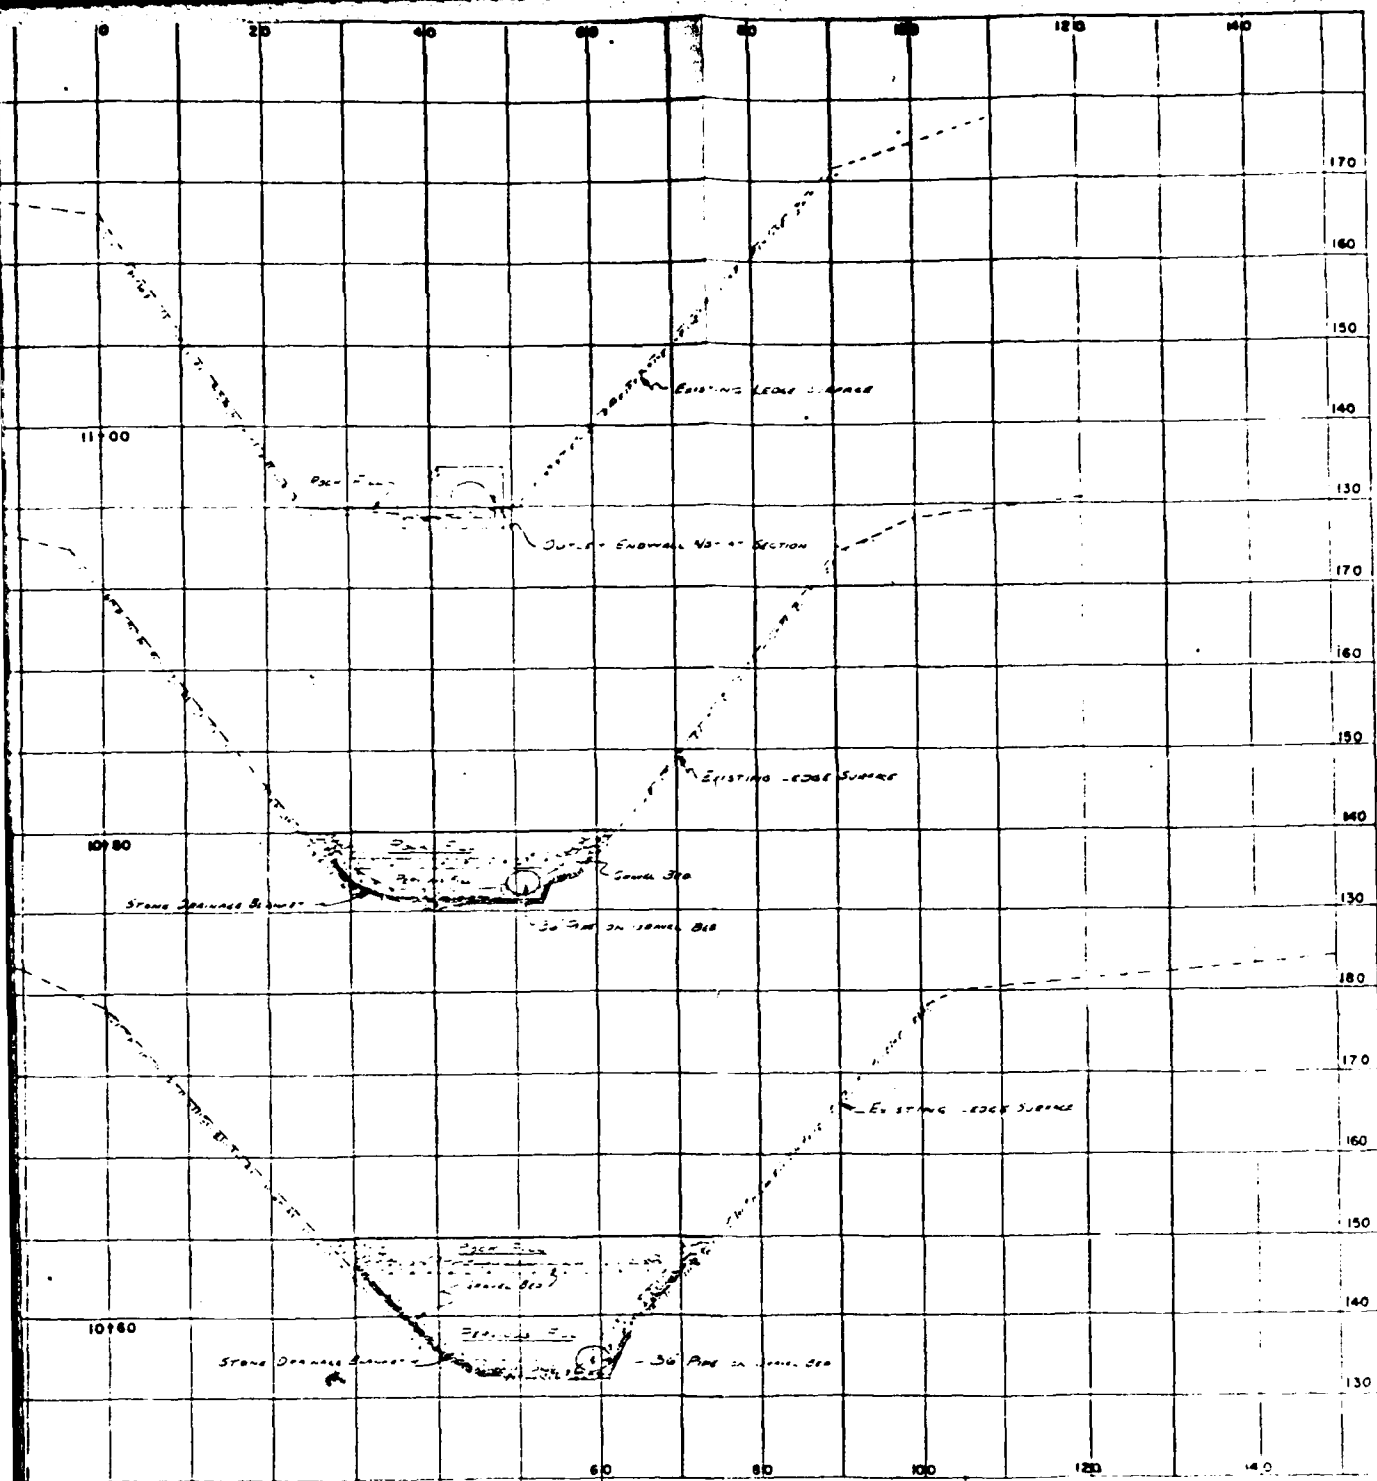

REDUCED NOT TO SCALE  
CROSS-SECTIONS 10780 TO 11700


STATE OF CONNECTICUT  
PUBLIC WORKS DEPARTMENT  
T. J. MURPHY JR. COMMISSIONER

DESIGNED BY  
J. M. H.  
CHECKED  
D. L.  
APPROVED  
A. B.  
CONSTRUCTION OF DAM 81-88-53  
CRYSTAL LAKE  
MIDDLETOWN CONNECTICUT 5

REVISIONS		
NO.	DESCRIPTION	DATE

PLANS PREPARED BY  
ONDERDONK AND LATHROP  
CONSULTING ENGINEERS  
GLASTONBURY CONNECTICUT  
1" = 10'



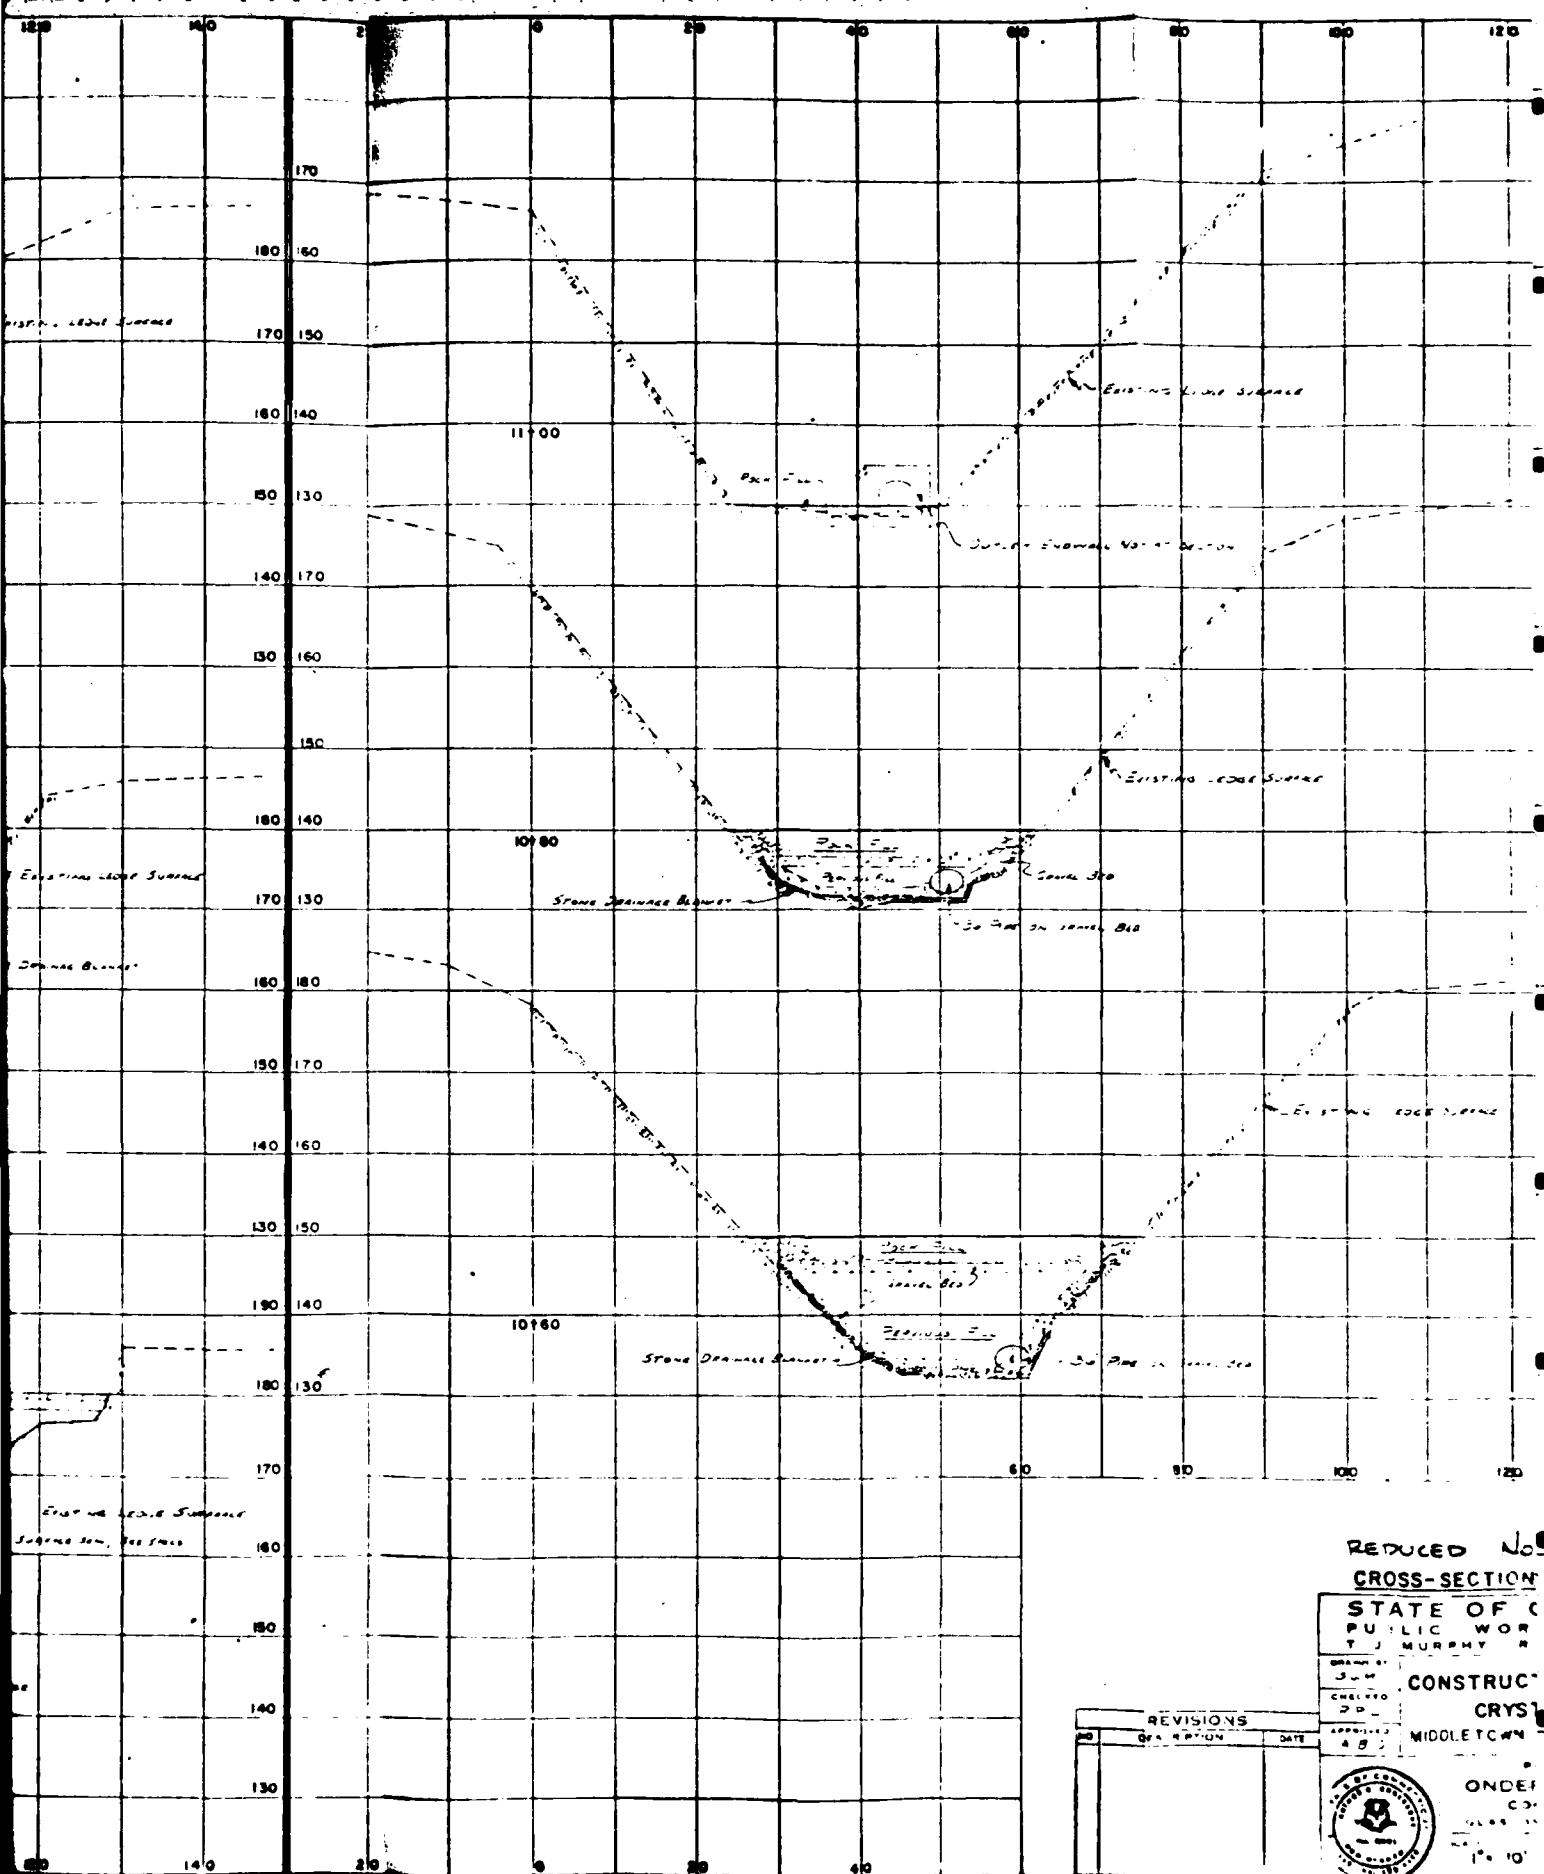


REDUCED No.  
CROSS-SECTION


STATE OF  
PUBLIC WORKS  
T J MURPHY R

CONSTRUC-  
CRYST  
MIDDLE TOWN

ONDE  
CO  
100  
100




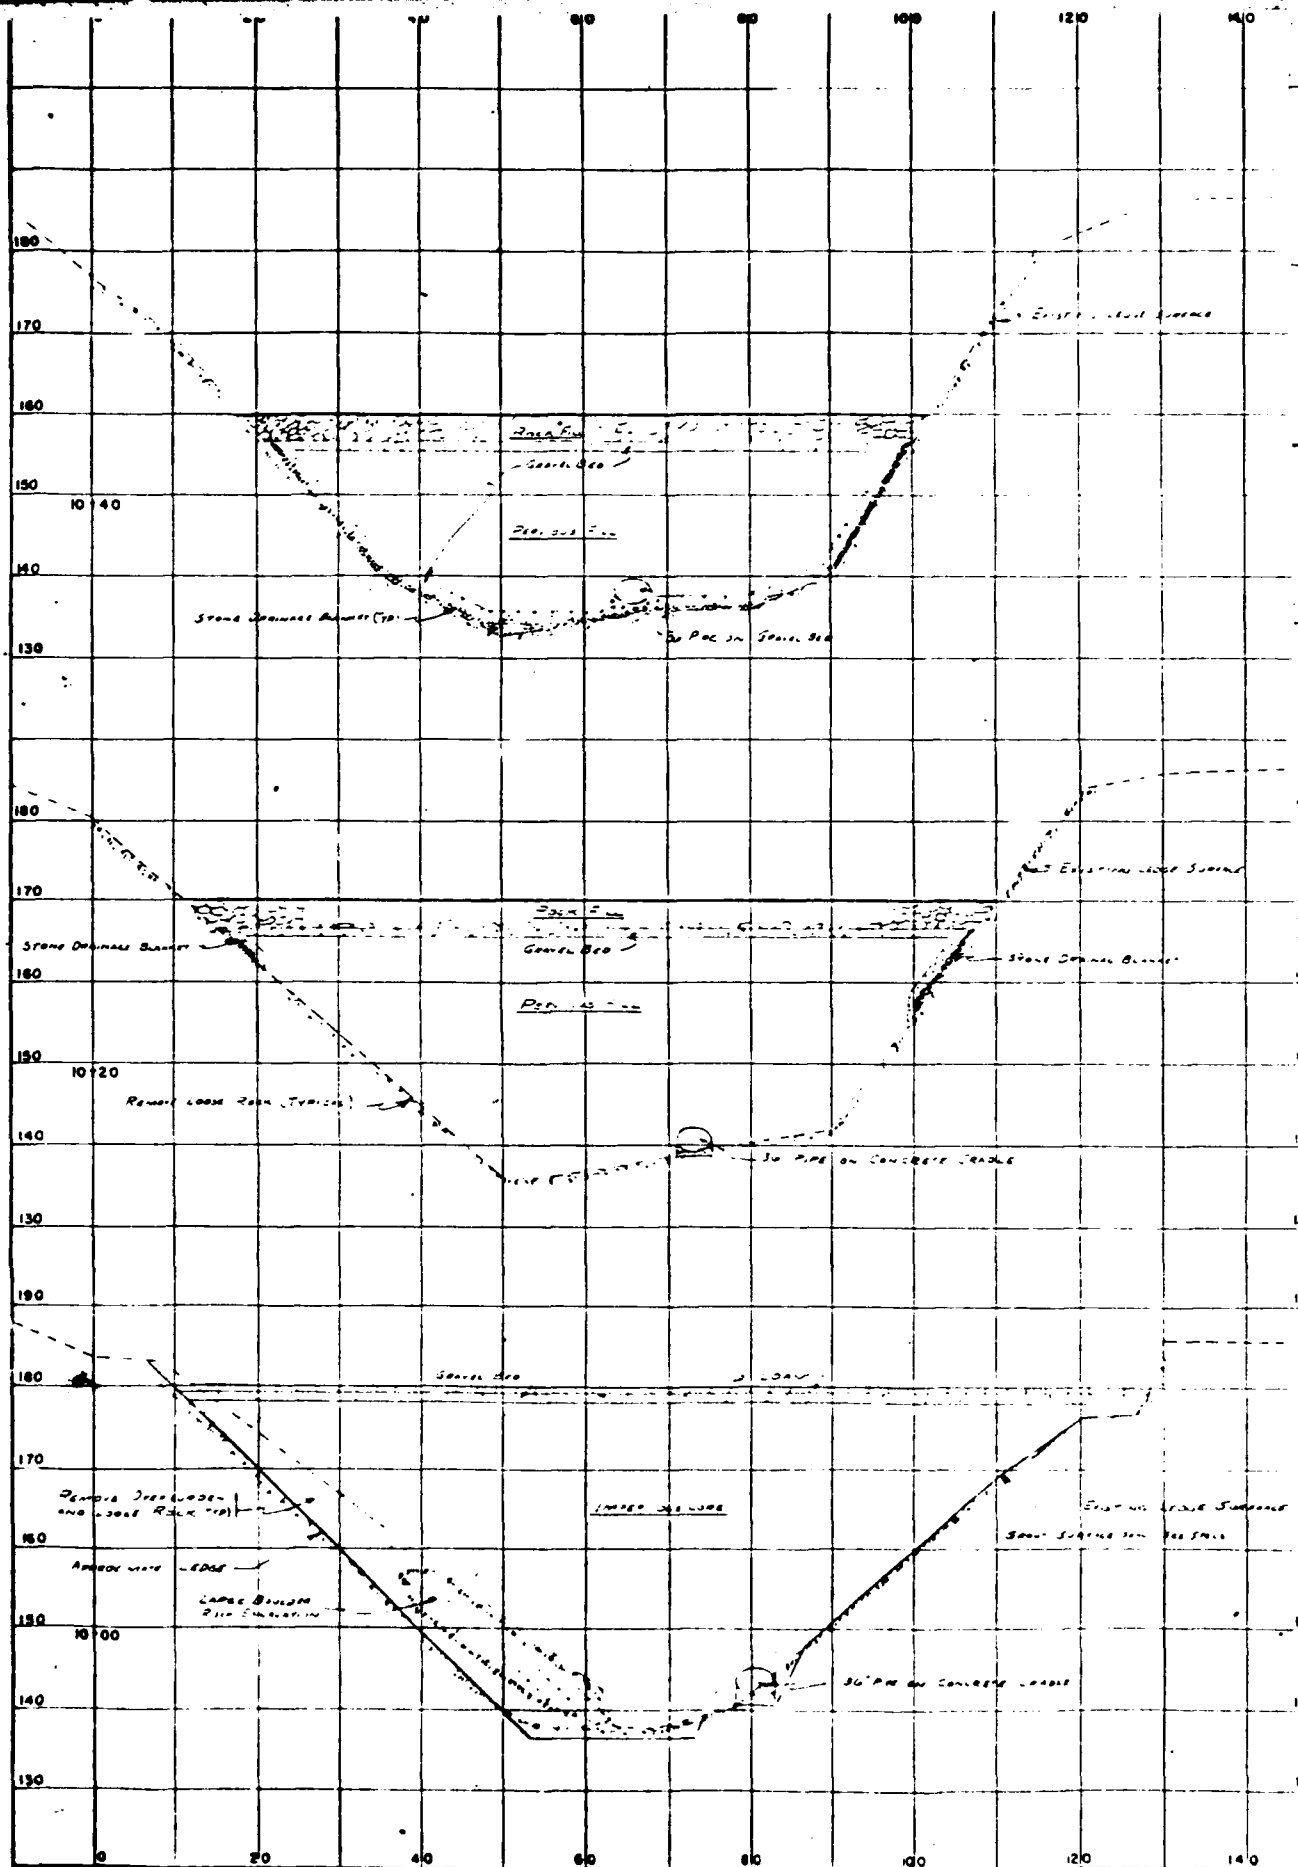

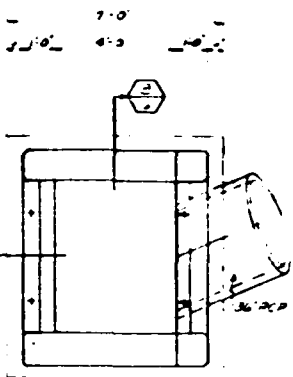


PLAN  
SCALE: 3/8"=1'-0"


# **INLET STRUCTURE**

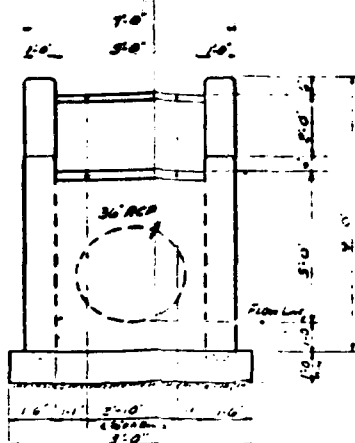


NOTE: BAR RACK NOT SHOWN  
WEST ELEVATION  
SCALE: 3/8"=1'-0"

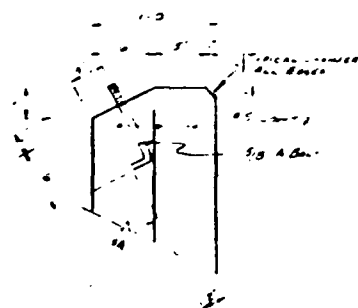


DETAIL  
SCALE: 1/2"=1'-0"

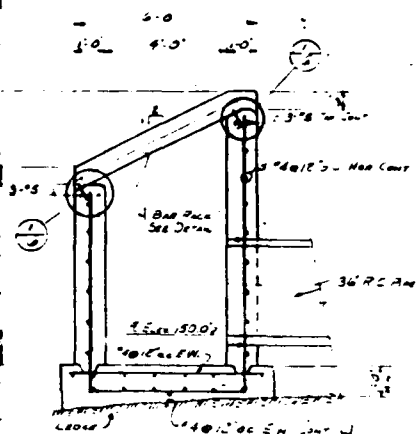


SECTION  
SCALE: 3/8"=1'-0"

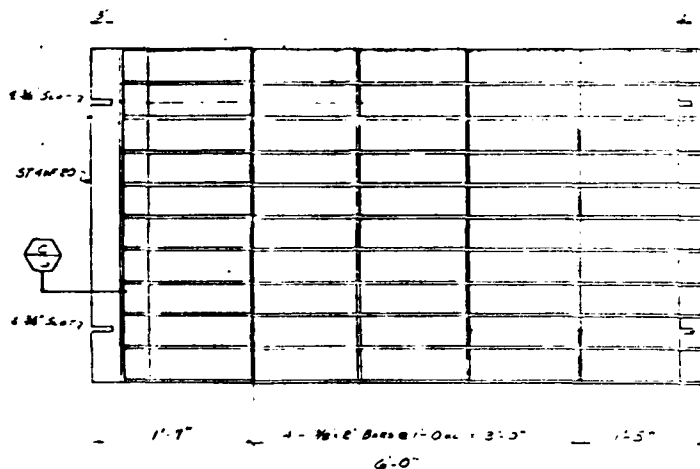

PLAN OF BAR RACK  
NOT TO SCALE




SECTION  
NOT TO SCALE

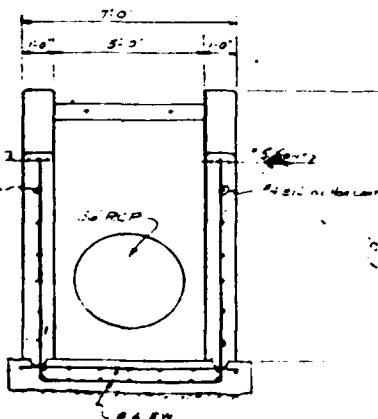

SECTION  
SCALE: 3/8"=1'-0"

## REDUCED NOT TO SCALE SECTIONS PARALLEL TO BASELINE B DRAWDOWN INLET


STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY, JR., COMMISSIONER		PROJECT NO. 81-88-53
DRAWN BY J. J. M.	CONSTRUCTION OF DAM	DATE 10-1-53
CHECKED RPL	CRYSTAL LAKE	
APPROVED A. B. O.	MOOLETOWN CONNECTICUT	6
PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS GLASTONBURY CONNECTICUT		
SCALE AS NOTED		

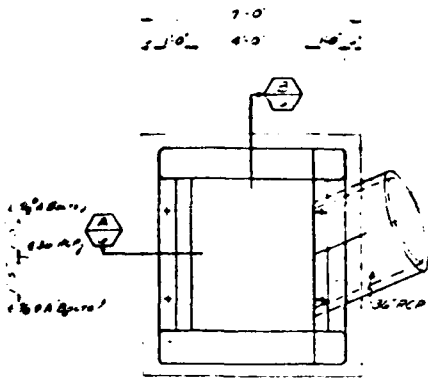

NOTE: BAR RACK NOT SHOWN

PLAN  
SCALE: 3/8"=1'-0"


**INLET STRUCTURE**

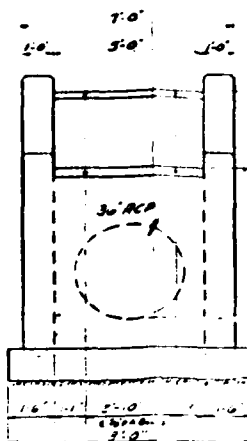


NOTE: BAR RACK NOT SHOWN

WEST ELEVATION  
SCALE: 3/8"=1'-0"


DETAIL  
SCALE: 1/2"=1'-0"

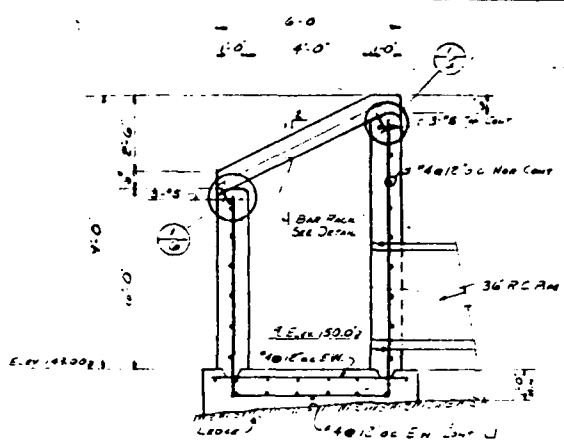


SECTION  
SCALE: 3/8"=1'-0"

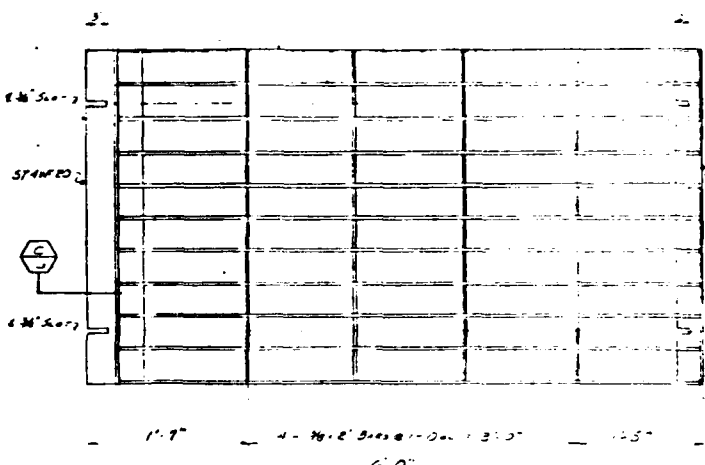

PLAN OF BAR RACK  
NOT TO SCALE



SECTION  
NOT TO SCALE

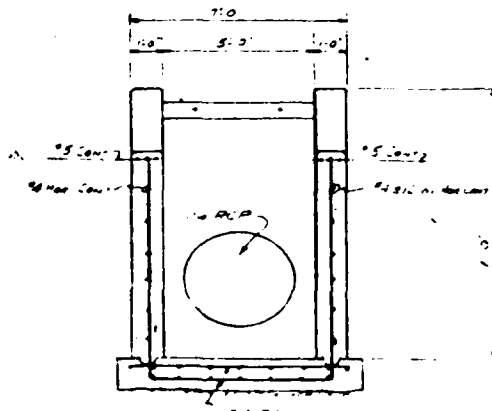

SECTION  
SCALE: 3/8"=1'-0"


REDUCED NOT  
SECTIONS PARALLEL TO  
DRAWDOWN

STATE OF CONN. PUBLIC WORKS T. J. MURPHY JR.	
DRAWN BY J. J. MURPHY JR.	CONSTRUCTION CRYSTAL MIDDLETOWN
CHECKED J. J. MURPHY JR.	PLANS ONDERDON CONS. CRYSTAL MIDDLETOWN
APPROVED J. J. MURPHY JR.	AS NOTED





# SECTIONS PARALLEL TO BASELINE

SCALE 1"=20'

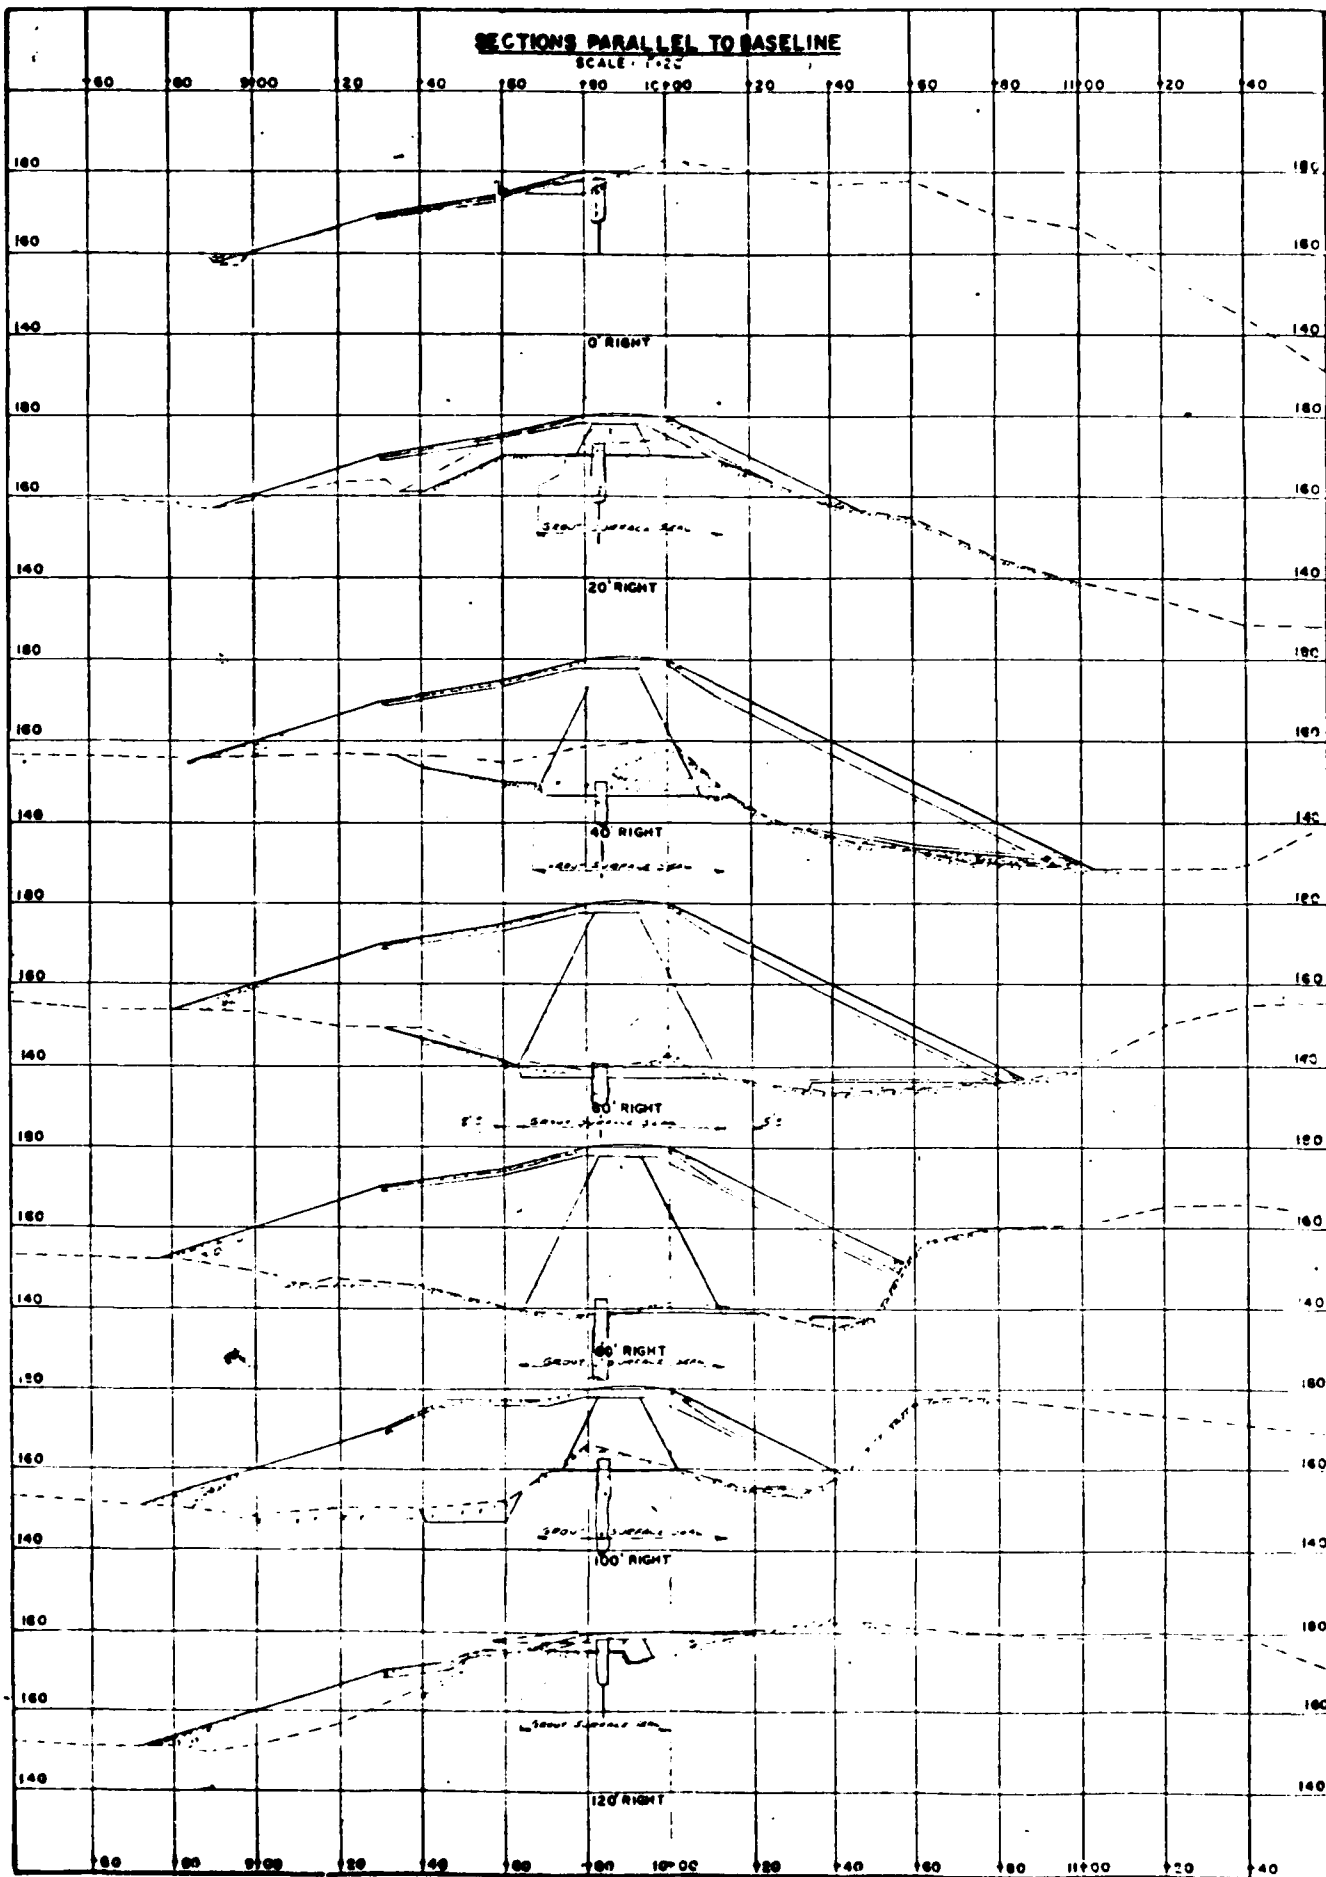


ELEV. 44.000

1 Foot No. 100, 1000, 10000  
 1/4" = 1' 0"

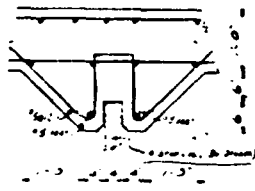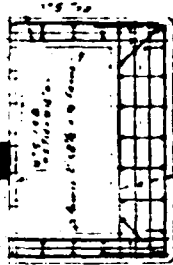


**DETAIL**   
 SCALE 3/4" = 1'-0"

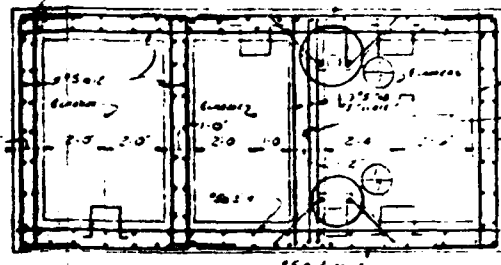


**NOTE**  
 SEE REINFORCEMENT PLAN FOR REINFORCEMENT

**SECTION**   
 SCALE 3/8" = 1'-0"

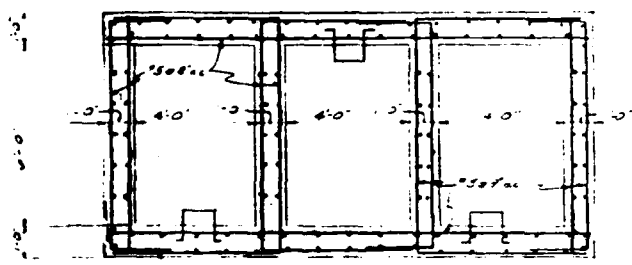



**NOTE**  
 SEE REINFORCEMENT PLAN FOR REINFORCEMENT

**SECTION**   
 SCALE 3/8" = 1'-0"

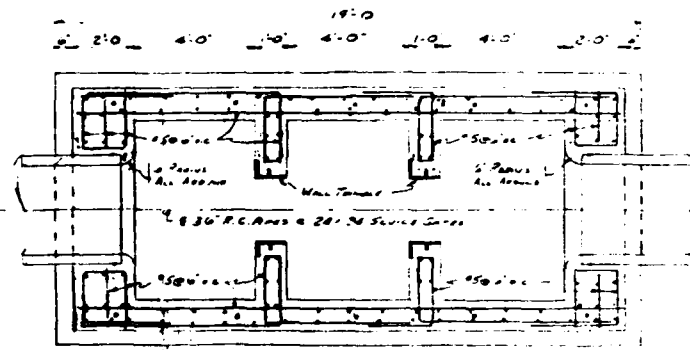

**NOTE**  
 SEE REINFORCEMENT PLAN FOR REINFORCEMENT

**SECTION**   
 SCALE 3/8" = 1'-0"

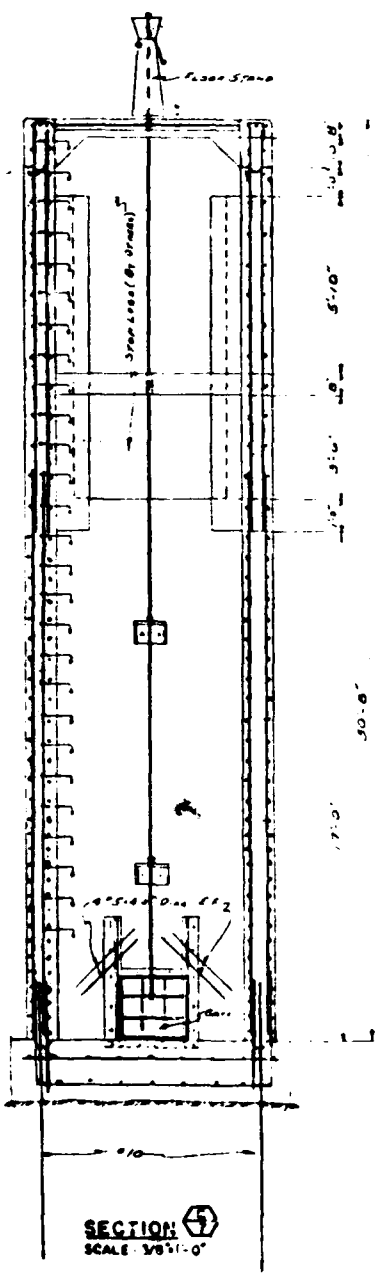


**SECTION**   
 SCALE 3/8" = 1'-0"

REDUCED NOT TO SCALE  
 WATER CONTROL STRUCTURE


STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY JR. COMMISSIONER	
DRAWN BY SUM CHECKED RPL APPROVED ASJ	CONSTRUCTION OF DAM CRYSTAL LAKE MIDDLETON CONNECTICUT 3-8-53 7
PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS 2 ASTOR BURY NEW HAVEN, CT.	
AS NOTED	

REVISIONS	
DESCRIPTION	DATE




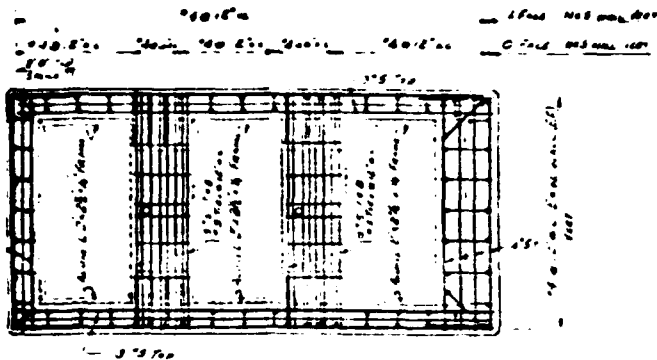

**SECTION 4**  
SCALE: 3/8"=1'-0"

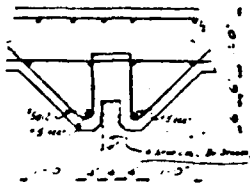


**DETAIL 1**  
SCALE: 3/4"=1'-0"

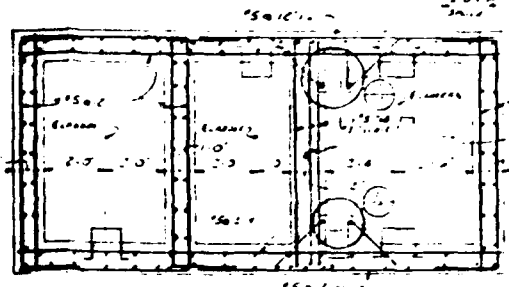


**NOTE**  
SEE REINFORCEMENT SCHEDULE FOR SECTION 5


**SECTION 5**  
SCALE: 3/8"=1'-0"

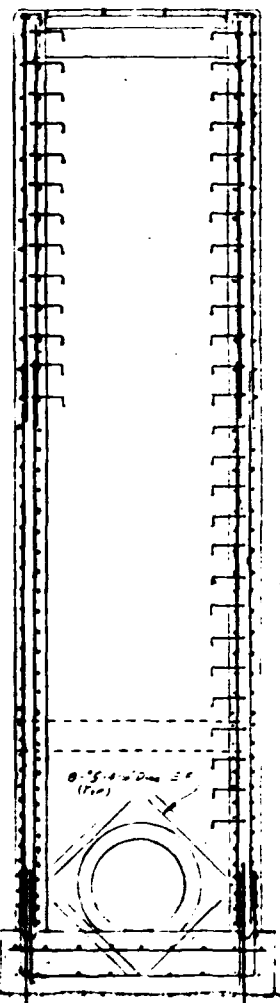

**SECTION 6**  
SCALE: 3/8"=1'-0"

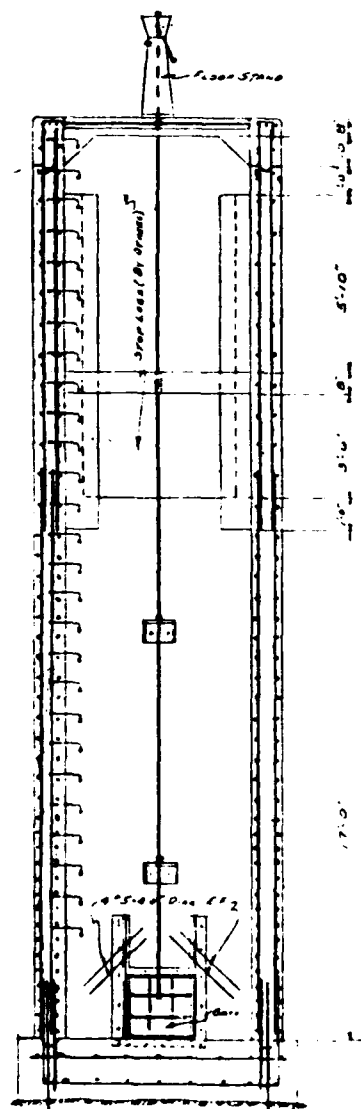


**SECTION 7**  
SCALE: 3/8"=1'-0"

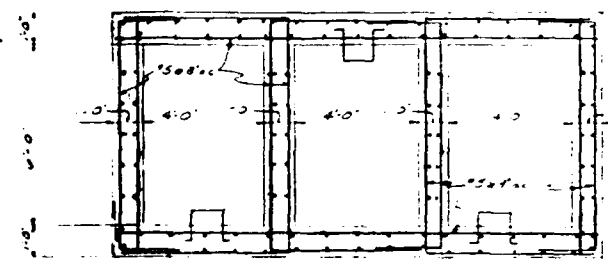

**NOTE**  
SEE REINFORCEMENT SCHEDULE FOR SECTION 8

**SECTION 8**  
SCALE: 3/8"=1'-0"

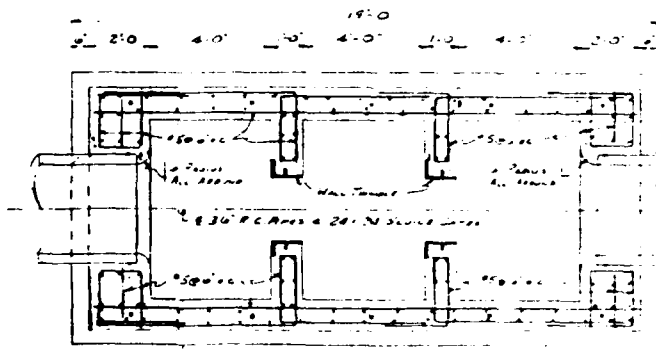

**NOTE**  
SEE REINFORCEMENT SCHEDULE FOR SECTION 9

**SECTION 9**  
SCALE: 3/8"=1'-0"

**REDUCED NOT TO**  
**WATER CONTROL STRUCT**  
**STATE OF CON**  
**PUBLIC WORKS**  
**T. J. MURPHY, JR.**

**CONSTRUCTION**  
**CRYSTAL**  
**MIDDLETON**





**PLANS**  
**ONDERDON**  
**CONSULT**  
**AS NOTED**



**REVISIONS**

NO.	DESCRIPTION	DATE
1		

**DESIGNED BY**  
S. J. M.  
**CHECKED BY**  
R. P. L.  
**APPROVED BY**  
A. S. J.

**STATE OF CONNECTICUT**  
**DEPARTMENT OF PUBLIC WORKS**  
**CRISTAL MIDDLETON**

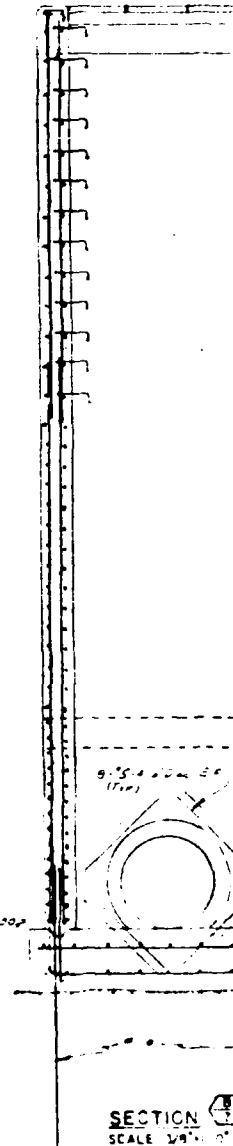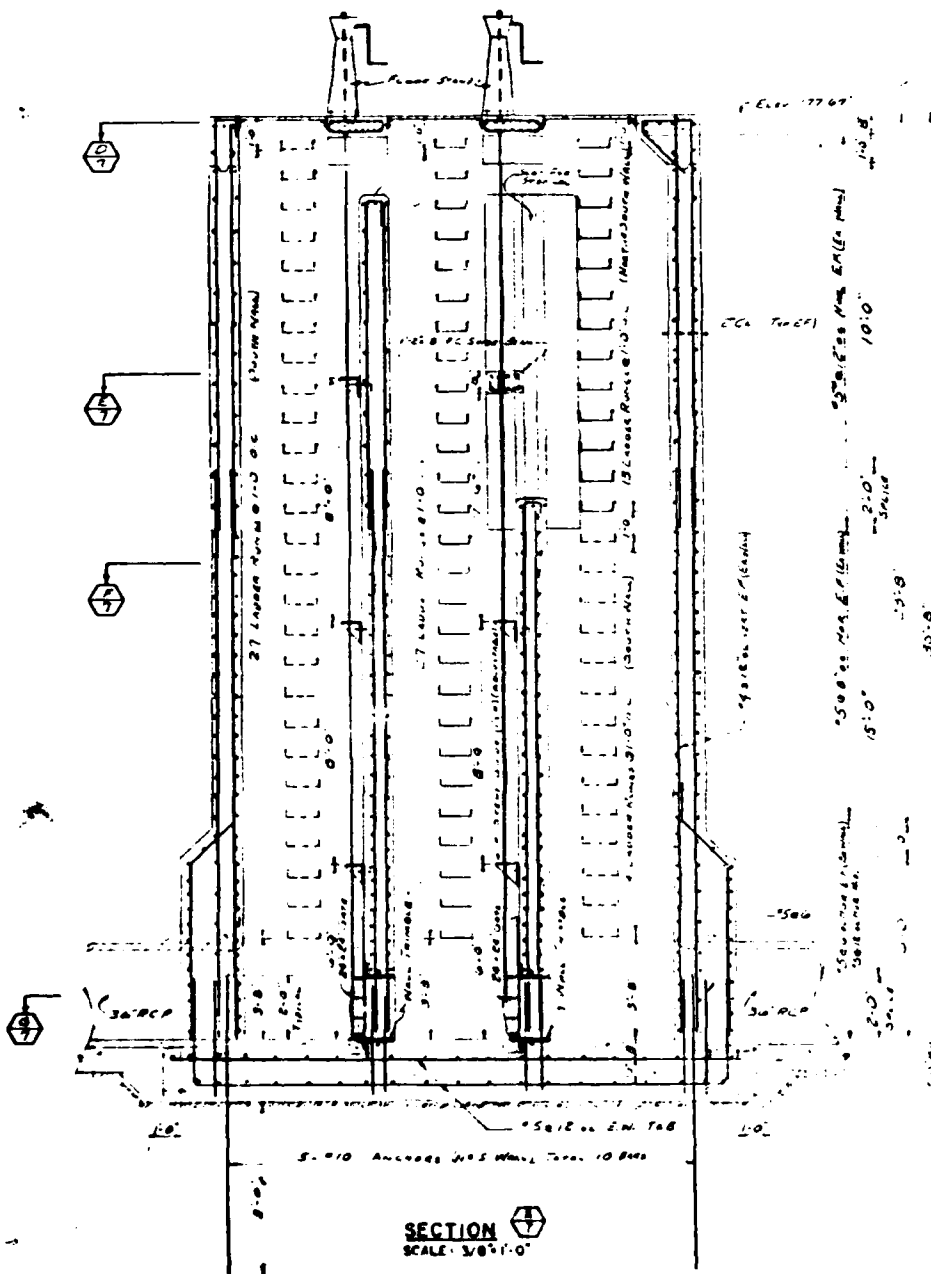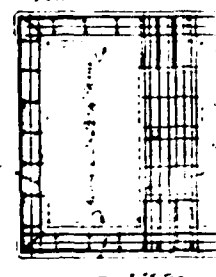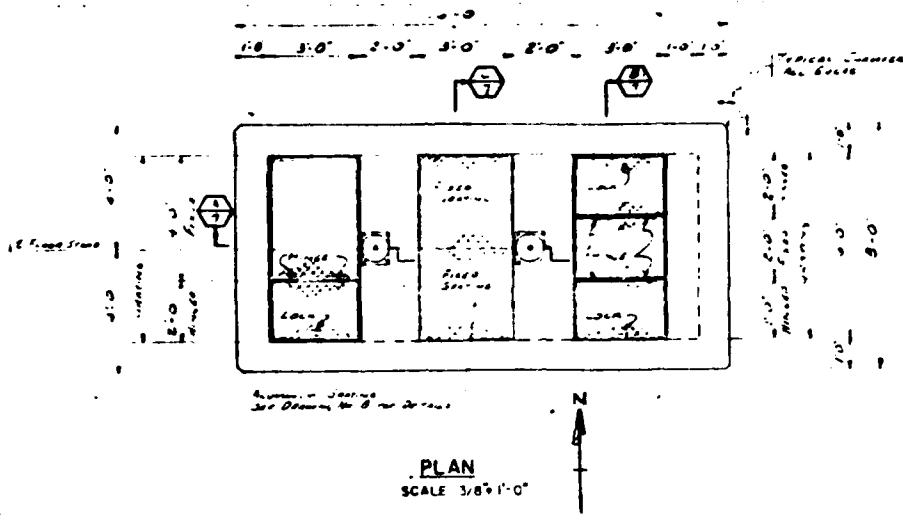

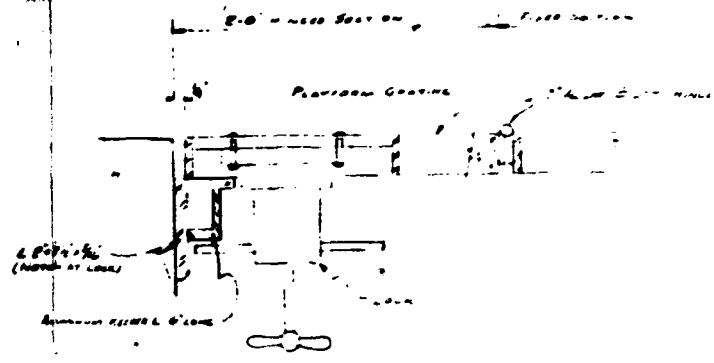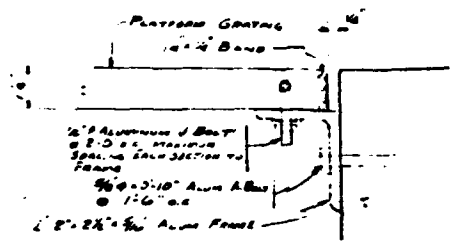


NOTE  
OUTLET BASE ALL UNITS TO BE 1/4\"/>


FIXED SECTION

HINGED SECTION


**PLATFORM GRATING DETAILS**  
NOT TO SCALE

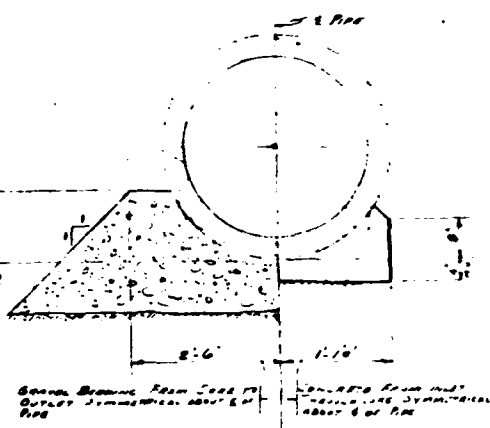

**PIPE CRADLE DETAIL**  
SCALE: 3/4\"/>

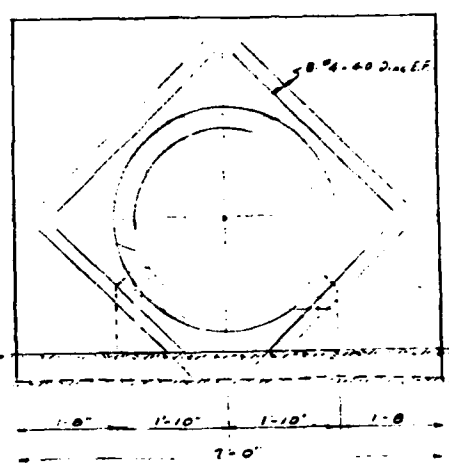

ELEVATION

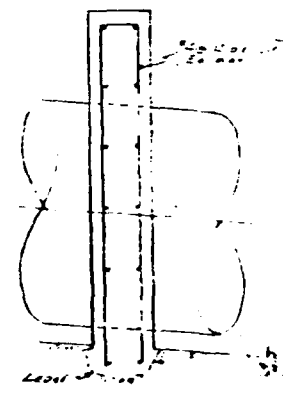


SECTION

**ANTI-SEEP COLLAR DETAILS**  
SCALE: 3/4\"/>

**REDUCED NOT TO SCALE**  
**OUTLET ENDWALL & MISC. DETAILS**

STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY, JR., COMMISSIONER		PROJECT NO. BR-68-53
CONSTRUCTION OF DAM CRYSTAL LAKE MIDDLETOWN CONNECTICUT		DRAWING NO. 8
PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS GLASTONBURY, CONNECTICUT		
SCALE AS NOTED		DATE JUL 1968


REVISIONS	
NO.	DESCRIPTION

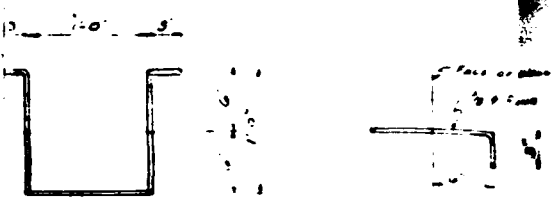


PLAN

SECTION


**LADDER RUNG DETAIL**  
SCALE: 1/2" = 1'-0"

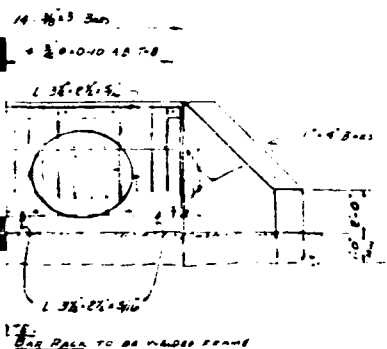

EAST ELEVATION

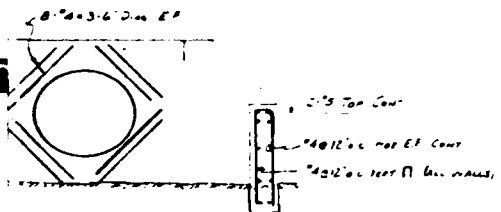


SECTION  $\frac{1}{2}$

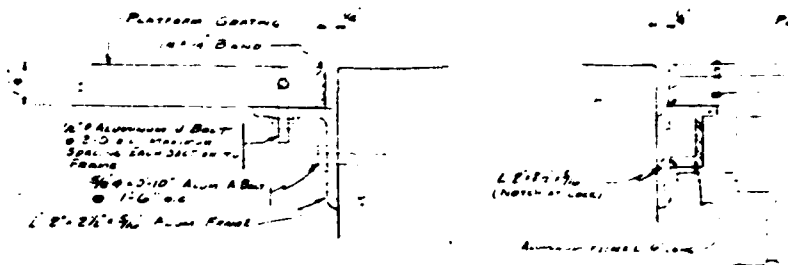


FIXED SECTION

**PLATFORM GRATING DETAILS**  
NOT TO SCALE

HINGE

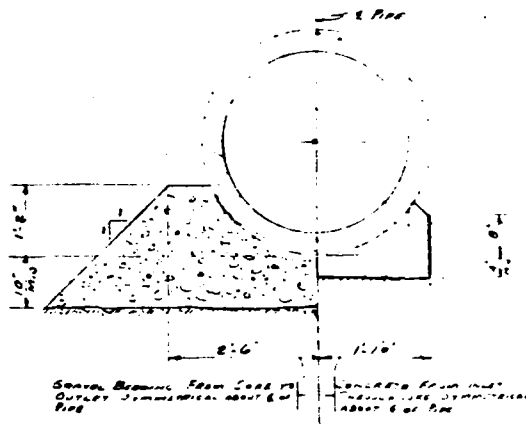

**PIPE CRADLE DETAIL**  
SCALE: 3/4" = 1'-0"

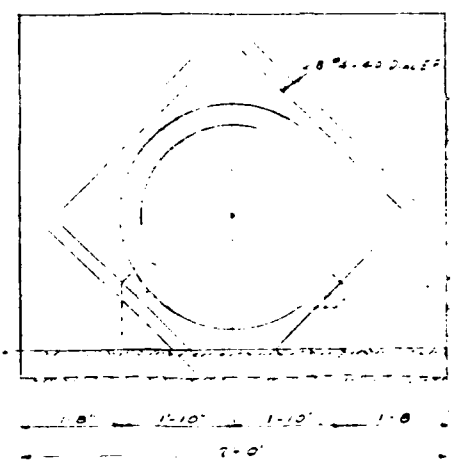

ELEVATION

**ANTI-SEEP COLLAR**  
SCALE: 3/4" = 1'-0"


REVISIONS			CHECKED	DATE
NO.	DESCRIPTION	DATE		

202  
OUTI  
S  
P  
T




## SECTION

SCALE: 1/2" = 1'-0"



EAST ELEVATION



SCALE: 3/8" = 1'-0"

# Crystal Lake Leaves Sea of Mud in Wake

By DENNIS RILEY  
Times Staff Writer

Middletown — The Crystal Lake Dam burst here before dawn today, sending millions of gallons of water pouring into lowlands over an area of several square miles.

Three persons were slightly injured and 11 homes were damaged.

About 50 persons in 15 families were evacuated from the flooded section after the dam gave way at 2:45 a. m.

Samuel G. Cannon, superintendent of Public Works, estimated damage to houses alone at \$100,000.

John C. O'Brien, deputy superintendent of Public Works, set \$50,000 as a preliminary estimate of highway damage. Personal property, utility services and farms also were hit.

A bridge over a small brook was washed out.

Mayor Harry T. Clew, later this morning, called on the Federal Housing and Home Finance Agency to declare a flood section here a disaster area. He requested a field representative to come Friday to inspect the damage.

**THE SCENE** was described as a "nightmare" in the Millbrook Rd. and Prout Hill Rd. sections.

Some persons were "washed out of their homes" and then hung onto fences until they were rescued, police said.

Police were notified in a phone call from Mrs. Mary V. Gilbert, a resident affected.

Policemen, firemen, Public Works personnel, Red Cross units and utilities employees helped in the rescue.

Chief Michael Milardo of the South Fire District company, said the flood peak came at 3:15 and lasted briefly. By 3:30, he said, water started to recede.

**THE LAKE WAS** about a mile long, up to 60 feet deep and 500 feet across at its greatest width.

All that remains are puddles. The lake had been used for swimming and fishing activities in a Falcon Park recreation program.

The dam itself, about 60 feet high and 40 feet wide, was a brownstone arch structure. Skindivers had checked it in recent days.

Spokesmen at the Russell Manufacturing Co. said previous findings were that Winter frost had damaged the dam wall. Russell has water rights to the pond.

Superintendent Cannon said no official finding has been made on the cause of the break.

**TREATED** at Middlesex Memorial Hospital for shock, scratches and abrasions were

Mrs. Connie Geremia, in her 40s; her daughter Cheryl, 14 and Miss Carol Imme, 40, identified as Mrs. Geremia's sister.

Reported flooded were the houses of Lou Petruzello.

George Clegg, Lewis Angi, Albert Geremia, Joseph Ciaburri, Louis Russo, Loy Hoyle, Edward Landell, Thomas Eastwood and Charles Gilbert.

The home of Michael Champey was less seriously damaged. Chief Milardo reported. About six autos were washed away.

The lake, on a hill, was fed from foothills south of Prout Hill Rd., Mr. Cannon said.

When the dam broke the water rushed down and first hit the Landell Poultry Farm. It next struck the Gilbert home, the the others, rushed past the Russell Manufacturing Co. and on into the Connecticut River.

A brook carried the waters harmlessly past a low section of the Russell plant.

**CLEANUP CREWS** and newsmen poured in as flood waters subsided.

"Don't bother to wipe your feet," one stoic resident said as a newspaperman entered his home. He found a half-inch of mud covering the entire downstairs, his cellar completely flooded, and six inches of water left in the bottom drawers of furniture and appliances as the water level went down.

At Crystal Lake this morning, dozens of youngsters scoured the mud flats, once the lake bottom, looking for fish and souvenirs.

Boats left tied last night to shortline docks were hanging, suspended by their mooring lines, over a gaping chasm of mud.

"They knew for years this would happen," one old-timer said. "When my father built his house there in the valley, years ago, they tried to stop him."

Cleanup crews were plagued by bogged trucks and snarls of tree limbs and rubbish. Police had difficulty routing traffic and curious spectators around the disaster area.





**STATE OF CONNECTICUT**  
**WATER RESOURCES COMMISSION**  
**STATE OFFICE BUILDING - HARTFORD, CONNECTICUT 06115**

**Crystal Lake Dam, Middletown**

**Summary of File**

- October 17, 1946** - Letter from T. M. Russell, Russell Mfg. Co., stating that Crystal Lake Dam had been leaking during summer and repairs contemplated. Inquiry as to procedure.
- November 5, 1946** - Received preliminary application form for proposed repairs. No plans.
- November 22, 1946** - Memo from J. Curry to Richard Martin, Chairman, W. R. C., describing leak and potential of damage downstream.
- November 26, 1946** - Letter from B. H. Palmer, Member State Board of Supervisor of Dams to Russell Mfg. Co., outlining a procedure for determining repairs to be made.
- January 30, 1947** - Letter from B. H. Palmer to Richard Martin, S. B. of S. of Dams, describing repairs almost completed, and opining that certificate of approval would not be necessary since work did not involve structural changes.
- February 10, 1949** - Letter from B. H. Palmer to Russell Mfg. Co., advising them of "substantial leak in the dam" and suggesting that pond be lowered to facilitate repair. "The dam is in no danger of failing."
- August 2, 1955** - Letter from B. H. Palmer to Russell Mfg. Co., attention of Mr. Wilson, stating that on this date the writer observed a substantial leak in the dam. Estimated that leak had been running for two or three months but not longer than that. Recommends excavation to determine location of leak.
- November 12, 1957** - Letter of report from B. H. Palmer to W. R. C., suggesting certain repairs to dam.
- April 27, 1961** - Dam failed.
- April 27, 1961** - Report of damage to Highway Route 155 by Robert A. Norton. Copy attached to and filed with memo to M. Wayne dated January 16, 1962.

- May 12, 1961 - Report of dam failure from J. Curry to W. Wise.
- May 16, 1961 - Letter from W. S. Wise to Russell Mfg. Co., advising them that as a result of W.R.C. meeting on May 15 ... "you as the reported owner of this dam to take immediate steps to correct the hazardous conditions at the site." - i.e., embankments.
- May 18, 1961 - Letter from Russell Mfg. Co. to W. Wise - question of their ownership, etc.
- June 5, 1961 - Memo to Walter T. Schuler from Edward F. Harris regarding property search and defining Russell Mfg. as owners of dam.
- November 27, 1961 - Memo J. Curry to Commissioner J. Gill "concerning the Interest of the W.R.C. and its Predecessor Agencies in the Crystal Lake Dam."
- January 15, 1962 - Copy of entire folder sent to:  
  
Mr. Robert P. Volpe  
Attorney at Law  
75 Pearl St.  
Hartford, Conn.
- March 15, 1962 - Copy of entire folder sent to:  
  
Mr. Louis Johnson  
Attorney at Law  
Main St.  
Middletown, Conn.
- May 2, 1963 - Memo from H. G. Hunt, Chief, Design and Review of Public Works Dept. to W. S. Wise - "Enclosed are final plans" (for dam).
- May 20, 1963 - Report from A. J. Macchi, Engineers, acting as consultant to W.R.C., commenting on design by Onderdonk and Lathrop.
- May 29, 1963 - Reply by Onderdonk and Lathrop to design comments.
- June 6, 1963 - Letter from A. J. Macchi to W.R.C., summarizing meeting with design engineers.
- June 25, 1963 - Letter from Onderdonk and Lathrop to W.R.C., replying to A. J. Macchi's comments.

- July 10, 1963 - Letter from A. J. Macchi, answering comments of Onderdonk and Lathrop.
- September 5, 1963 - Letter from Onderdonk and Lathrop mentioning changes in design as proposed by Clarence Welti, Soil Engineer.
- September 26, 1963 - Memo from H. G. Hunt to W. S. Wise - "Enclosed is a final submission on the above project."
- October 17, 1963 - Letter from A. J. Macchi, commenting on revised plans.
- November 6, 1963 - Memo from M. R. Case, Assistant Chief Engineering, Public Works Dept., to J. Curry - enclosing letter (comments) by both Onderdonk and Lathrop and Clarence W. Welti.
- November 27, 1963 - Letter from A. J. Macchi with comments on letter from Clarence Welti.
- December 10, 1963 - Letter from Onderdonk and Lathrop to T. J. Murphy, Commissioner, P. W. Dept., commenting on A. J. Macchi's reviews.
- January 28, 1964 - Memo from J. Curry to Timothy J. Murphy, Jr., suggesting ways of completing negotiations.
- February 26, 1964 - Letter from T. J. Murphy, Jr., to Onderdonk and Lathrop asking them to revise plans.
- March 6, 1964 - Application for Construction Permit with Revised plans.
- March 11, 1964 - Letter to W.R.C. from A. J. Macchi recommending approval.
- March 24, 1964 - Construction Permit issued for dam.
- April 11, 1966 - Letter to W.R.C. from A. J. Macchi recommending that a Certificate of Approval be issued.
- April 27, 1966 - Certificate of Approval issued on this dam.

STATE WATER RESOURCES  
COMMISSION  
RECEIVED  
MAY 31 1963

ANSWERED.....  
REFERRED.....  
FILED.....

May 29, 1963

A. John Macchi, P. E.  
44 Gillett Street  
Hartford, Connecticut

Re: Construction of Dam  
Crystal Lake  
Middletown, Connecticut

Dear Mr. Macchi:

Your recommendations of May 20, 1963, based upon review of the plans and specifications for this project are appreciated. Our comments are as follows:

Item 1. An analysis of the design made by our Soils Engineer, Professor Karl Hendrickson (University of Massachusetts), indicates a safety factor of 2.7 against sliding compared to a usual safety factor of 1.5 to 1.7 in earth work of this nature.

Item 2. Professor Hendrickson is of the opinion that the placing of the grout cap two feet into the rock may not be necessary, but it is conservative and will make the concrete seal somewhat more effective.

This office will include this item in the plans if funds permit. The extra cost, involving the removal of approximately 35 cu. yds. of rock and replacing with concrete, would amount to about \$1,600.00.

Item 3. Riprap was not provided around the outlet end wall of the 36" R.C.P. as the end wall will be in rock and the adjacent slopes are covered with rock fill.

Item 4. It is the opinion of our engineers that elimination of the top ladder rungs and replacing with a short hinged ladder, is not necessary for the following reasons:

- (a) The area provided for flow at the top of the chamber is much greater than required. Icing up of the rungs would be a negligible factor for flow.
- (b) Maintenance would be increased by having a hinged ladder.
- (c) Extra cost involved.

General. We are enclosing for your information three reports by Professor Hendrickson:

- (a) Report dated April 26, 1963, based upon review of the basic plans and specifications. His suggestions were incorporated in the final plans and specifications.
- (b) Report dated May 15, 1963, based upon review of the final plans and specifications. His suggestions will be incorporated in the contract documents.

A. John Macchi, P. E.

- 2 -

(c) Report and Sliding Analysis dated May 24, 1963, based upon A. J. Macchi's review comments of May 20, 1963.

If there are any further comments, please call this office.

Yours very truly,

*A. B. Onderdonk*

A. Bruce Onderdonk, P. E.

ABO/c  
encs.

cc. w/enc.  
Public Works Department  
Water Resources Commission

Crystal Lake Dam  
Middletown, Connecticut

April 26, 1963

Foundation Comments:

1. Rock: Weathered sandstone and shale with frequent seams of weathered siltstone which is poorly consolidated.
2. This site is unsuitable for masonry dams.
3. The rock and earth dam shown best suits the site.

Seepage:

1. The site will always have minor seepage along the bedding seams of the rock. The loss of water, in itself, is not of concern since previous reservoir history indicates that the leaks are not greater than the inflow.
2. Since the dip of the bedding directs water flow deeply, danger of uplift exists only in the area directly below the centerline of the proposed dam.
3. As a basic design principle, good watertightness about the core and upstream when coupled with free and complete drainage of all portions of the downstream embankment foundation will assure stability with respect to both leakage and uplift.
4. Seepage along the conduit within the core is adequately cared for in the design. Founding the conduit on a concrete bed resting on rock, and installing the seep fins as shown is satisfactory.

Core:

1. The cross-section of the core is satisfactory for the material proposed. Seepage loss through the core will be in the order of 10 to 20 cubic feet per day. ?
2. Rock treatment at the core section by grouting will improve the watertightness. A grout curtain made up of holes 5' on center, 15' deep on the floor of the site and 10' deep normal to the walls will materially reduce foundation and abutment leakage.
3. A 3' wide plain concrete cut-off stepped in such a way that no part of the top is less than 2' from the foundation, and each piece is keyed to its neighbor will reduce the piping liability along the rock contact.
4. All parts of the exposed rock in contact with the core must have dental treatment to fill seams and cracks where the core might erode.

Core (Continued)

5. The top of the core should be covered with processed gravel to break capillarity on its crest.

Upstream Shell Embankment

1. Suggest adding a rock toe and filter along edge of embankment.
2. Suggest a processed gravel blanket across the slope.
3. All other details are conservative.

Downstream Shell Embankment

1. Provide drainage blanket between rock foundation and pervious fill.
2. Consider using clean-up rock and rock excavation as the downstream embankment to its abutment limits.

Karl N. Hendrickson  
Foundation Engineer

NOTED

CRISTAL LAKE DAM  
FOUNDATION  
ENGINEER

Karl M. Hendrickson  
Foundation Engineer  
56 Berkshire Terrace  
Amherst, Massachusetts

May 15, 1963

Onderdonk and Lathrop, Consulting Engineers  
2512 Main Street  
Glastonbury, Connecticut

Re: Crystal Lake Dam in Middletown

Dear Bruce,

I have reviewed the subject plans and specifications and have the following comments:

1. Specs. Div 6, Sect 2 and 3. Use additional words to show that opt. density is related to Standard Proctor, ASTM D698-57T, or AASHTO Standard.
2. It may be necessary to drop from 95% to 90% in the impervious section because of the limited working space.
3. Hand tamping with pneumatic or gas tools may be needed around the conduit and at uneven spots on the ledge.
4. The first grouting holes on the west abutment may reveal that grouting the west abutment is unnecessary. (See Bore Holes 678 and 9.)
5. If a situation exists where the intake could be plugged, the overflow structure empty, and the reservoir full, uplift on the bottom of the structure becomes critical and will require a couple of rock anchors.

All other features appear satisfactory and safe.

I leave for Colorado on June 1, and hope that you and Bob have a summer as interesting and enjoyable as mine promises to be.

Best wishes,

Karl Hendrickson  
Foundation Engineer

RECEIVED

ONDERDONK & LATHROP  
CONSULTING ENGINEERS  
GLASTONBURY, CONN



Karl N. Hendrickson  
Civil Engineer  
56 Berkshire Terrace  
Amherst, Massachusetts

May 24, 1963

Orderdon & Lathrop, Consulting Engineers  
2512 Main Street  
Clantonbury, Connecticut

RE: Crystal Lake Dam - Sliding Analysis

Dear Bruce:

I have just completed the sliding analysis of the Crystal Lake Dam suggested by comments in the report by Macchi, and find a safety factor of 1.7 which indicates that additional "locking or keying" is necessary.

My assumptions are that a section at 60' is critical and that the strength is derived from the soil with the constraints. The uplift diagram is based on seepage, infiltration, or grouting, and cracks which interconnect the strata of the dam and its foundation. That these cracks are in the north direction makes my assumption of scale to be greater than conservative one.

The placing of the group cap 2' into the rock may not be necessary, but it is conservative and will make the concrete wall stronger and stiffer. I have ignored the extra strength furnished by this feature.

A usual safety factor of 1.5 to 1.7 in earth work of this nature is the lowest acceptable.

Best wishes,

Karl N. Hendrickson


# SLIDING ANALYSIS

CRYSTAL LAKE DAM.

MIDDLETOWN, CONN

MAY 24, 1962

Karl H. Hershman  
Carl E. Hymen  
Amherst, Mass.

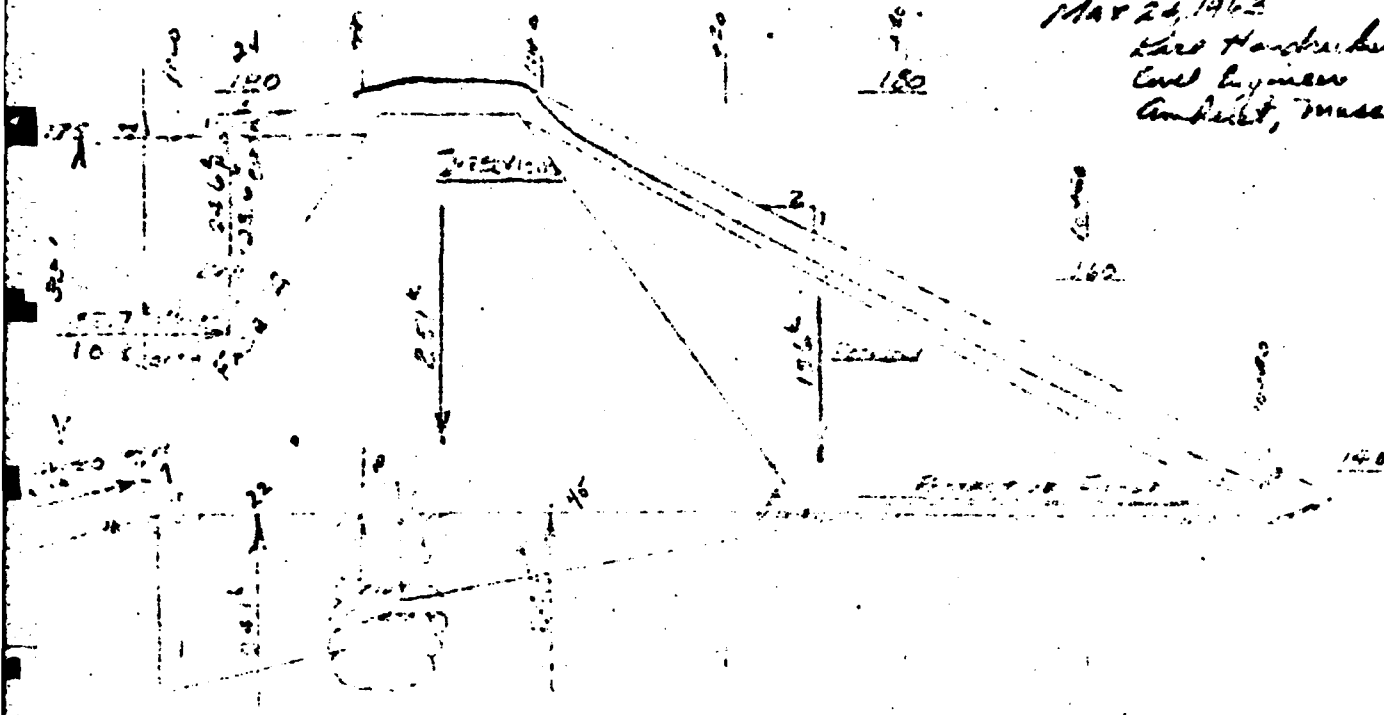

Section C-C at  
CRISTAL LAKE

Assumptions:

1. Uniformly distributed load
2. No seepage

Flow direction:  $\theta = 37.2^\circ$  (from soil)

Friction available:

Assuming

1. Soil structure interface  $\theta = 37.2^\circ$  (from soil)

$$F = N \tan \phi = 372.6 \times .75 = 279.45$$

$$\text{SAFETY FACTOR} = \frac{120}{279.45} = 2.71$$

2. Soil remains competent  $\phi = 39^\circ$  (for sand)

$$F = N \tan \phi = 372.6 \times .78 = 290.72$$

$$\text{SAFETY FACTOR} = \frac{120}{290.72} = 5.2$$

CONCLUSION: SAFE WITH RESPECT TO SLIDING

STABILITY ANALYSIS  
CRYSTAL LAKE DAM  
MIDDLEBURY CONN

FORCES FOR SLIDING BLOCK CALCULATIONS May 24, 1963

a. Uplift due to neutral pressure (See free body on p. 2) K.N.W.

Point	Elements	Pressure	Force
A	33' x $\gamma_w$	2050 psf	$7' \times \frac{190}{1755} = 13.7^k$ $22 \times \frac{1650}{1550} = 34.1^k \uparrow$
B	33' x $\frac{13}{14} \gamma_w$	1910	
C	33' x $\frac{9.5}{14} \gamma_w$	1390	
D	33' x $\frac{6.5}{14} \gamma_w$	950	$45 \times \frac{545}{575} = 24.5^k \uparrow$
E	33' x $\frac{1}{14} \gamma_w$	140	

b. Neutral Pressure on Face A

Horizontal:  $\frac{1}{2} \times 33' \times \gamma_w = 33.7^k \rightarrow$

Vertical:  $\frac{1}{2} \times 33' \times 20 \gamma_w = 24.6^k \downarrow$

c. Earth Pressure on Face A

Horizontal:  $\frac{1}{2} \times 33' \times 10 \gamma_p = 10.8^k$  (Assume  $\phi = 30^\circ$ )

Vertical:  $\frac{1}{2} \times 33' \times 24 \gamma_p = 23.6^k \downarrow$

d. Weight of upstream section Assume  $\gamma_s = 130$  pcf

(1)  $2 \times 45 \times \frac{1}{2} \times 130 = 70^k$

(2)  $16 \times 45 \times 130 = 73^k$

(3)  $20 \times 45 \times \frac{1}{2} \times 130 = 58^k$

251^k

$251^k \downarrow$

e. Weight of downstream embankment

$55 \times 45 \times \frac{1}{2} \times 110 = 136^k \downarrow$  Assume  $\gamma_s = 110$  pcf

SUMMATION

HORIZONTAL

11

33.7

10.8

55.5^k  $\rightarrow$

VERTICAL

1

3

24.6

34.1

23.6

24.5

251.0

136.0

434.2^k  $\downarrow$

NET 372.6^k  $\downarrow$

P. O. Box 473  
Idaho Springs, Colorado

June 19, 1963

Onderdonk and Lathrop, Engineers  
Glastonbury, Connecticut

Re: Crystal Lake Dam - Middletown

Dear Bruce,

Sorry my report on the items listed was not complete enough to answer the questions raised at the conference.

Referring to the June 6, 1963, letter which had the June 5 minutes listed, I will attempt explanations of those points questioned:

1. "This site is unsuitable for a masonry dam"

The borings indicate that the rock on the west side of the site is firm and less weathered. It is a fairly hard and competent conglomerate resting on hard basement. Site inspection also makes the difference noticeable. The west side of the ravine is steeper and more sound. The rock on the east is shale and sandstone with seams which are weathered and soft. Disregarding, for the moment, the strike and dip of the shale and sandstone, this means that a masonry dam, a rigid structure which has relatively high foundation pressures, would be bearing on rock part of which has a lower modulus than the rest. Fluctuations of the reservoir level causes up and down stress values. The resulting strains are not as reversible elastically and there would be progressive damage on the east side. The only design remedy for such a situation is a combination of upstream blanket, extensive grouting, and relief wells. The earth dam has much greater contact area, and is somewhat flexible, and therefore, more adaptable to sites with poor foundations.

This is the main basis for my quoted statement.

2. "Are the assumptions in the sliding analysis completely justified?"

My critical assumptions are listed below with the current reasoning.

- a.  $\phi$ , angle of friction, of disintegrated shale and sandstone =  $22^\circ$ . This is not the result of a test, but is an estimate based on tests I have performed on similar material. This is possibly my weakest assumption.
- b. A seepage net could be separately for the core and for the foundation beneath it if the permeability of the foundation material is different.

If the permeability of the foundation is greater than that of the core of the dam, and this is the only critical foundation

problem, then the uplift pressure of the water on the dam may be estimated graphically. The figures on the free body at 60° R are based on a flow net, assumed unit weights of the moist compacted soil, thrust due to static water pressure, and active earth pressure on the upstream face.

The  $\phi$  for the intact rock in contact with soil is assumed, due to the specified foundation treatment, to be that of the soil, 38° is an average value in this area.

Sluicing. This item of concern to Mr. Macchi is a very real one, and in an earth dam is called piping (sometimes backward erosion). The same danger is present in a masonry dam where the contact between the masonry and the foundation may be destroyed. This mechanism is called "roofing". When seepage water is permitted to escape at a gradient which will remove soil, backward erosion starts. Earth dams are made self-healing in this respect by protective filters which permit the water to escape but retain the soil. As long as no soil is lost, no threat to stability exists.

Location: Between the core and the base, the dental work, grouting, and the key wall which is made up of the grout cap plus the seepage wall has this as one of its main functions: to prevent loss of soil due to a minor crack or path in the foundation which might not be detected during construction.

Between the east bank and the downstream pervious embankment the seepage in the east bank will follow the dip in the rock. The material called for in the embankment has a grading which will allow the water to pass safely but will not allow soil grains to be washed through.

Between the east bank and the rock toe a layer of gravel bedding of the grading specified performs the same function.

In conclusion: (To the sluicing item) With normal care in the inspection of the grouting, placing of the various types of fill, it is believed by me that in the area of the dam, the danger due to piping is low.

Very truly yours,

/s/ Karl N. Hendrickson  
Foundation Engineer

STATE WATER RESOURCES COMMISSION RECEIVED JUN 25 1963 ANSWERED..... REFERRED..... FILED.....
--

September 5, 1963

STATE WATER RESOURCES  
COMMISSION  
RECEIVED  
SEP 6 1963  
ANSWERED \_\_\_\_\_  
REFERRED \_\_\_\_\_  
FILED \_\_\_\_\_

T. J. Murphy, Jr., Commissioner  
Public Works Department  
State Office Building  
Hartford, Connecticut

Re: Construction of Dam  
Crystal Lake  
Middletown, Connecticut  
Project BI-BB-53

Attention: S. W. Allen, Chief Engineer

Dear Mr. Allen:

1. In view of the many discussions concerning the design of this project and due to the absence of Professor Hendrickson who is still in Colorado investigating dam sites for Stone and Webster, we have now retained Clarence Welti, F. E., Soils Engineer, to make an additional review of the plans and specifications for the proposed dam at Crystal Lake. Mr. Welti has just returned from Switzerland where he has spent a year studying the latest methods of dam design.
2. Mr. Welti has re-checked the design of the dam for stability and for "piping". His report makes several suggestions for tighter construction controls and for additional safety features which we would like to incorporate into the final plans and specifications. The more important items are as follows:
  - a. Reduce core size to 10 foot width at top with side slopes of 1/2:1.
  - b. Place core material under piezometric controls.
  - c. Construct concrete core wall 8 feet below rock surface and 3 feet into core. Pressure grout to 8 feet below core wall.
  - d. Install relief-wells of 3" minimum diameter to depth of 30 feet. The relief-wells should be spaced 8 feet on center and located under the middle of the drainage blanket.
3. We trust that with these additional safety features, the dam design will meet the approval of the Water Resources Commission so that the final contract documents can be completed. We shall be glad to discuss any further questions concerning this dam at your convenience.

Very truly yours,

*A. B. Onderdonk*  
A. B. Onderdonk, P. E.

cc. Water Resources  
A. J. Macchi, P. E.  
File

4

September 5, 1963

**STATE WATER RESOURCES  
COMMISSION  
RECEIVED**

SEP 6 1963

ANSWERED \_\_\_\_\_  
REFERRED \_\_\_\_\_  
FILED \_\_\_\_\_

**T. J. Murphy, Jr., Commissioner**  
Public Works Department  
State Office Building  
Hartford, Connecticut

**Re: Construction of Dam  
Crystal Lake  
Middletown, Connecticut  
Project BI-BB-53**

**Attention: S. W. Allen, Chief Engineer**

**Dear Mr. Allen:**


1. In view of the many discussions concerning the design of this project and due to the absence of Professor Hendrickson who is still in Colorado investigating dam sites for Stone and Webster, we have now retained Clarence Welti, P. E., Soils Engineer, to make an additional review of the plans and specifications for the proposed dam at Crystal Lake. Mr. Welti has just returned from Switzerland where he has spent a year studying the latest methods of dam design.
2. Mr. Welti has re-checked the design of the dam for stability and for "piping". His report makes several suggestions for tighter construction controls and for additional safety features which we would like to incorporate into the final plans and specifications. The more important items are as follows:
  - a. Reduce core size to 10 foot width at top with side slopes of 1/2:1.
  - b. Place core material under piezometric controls.
  - c. Construct concrete core wall 8 feet below rock surface and 3 feet into core. Pressure grout to 8 feet below core wall.
  - d. Install relief-wells of 3" minimum diameter to depth of 30 feet. The relief-wells should be spaced 8 feet on center and located under the middle of the drainage blanket.
3. We trust that with these additional safety features, the dam design will meet the approval of the Water Resources Commission so that the final contract documents can be completed. We shall be glad to discuss any further questions concerning this dam at your convenience.

Very truly yours,

*A. B. Onderdonk*  
A. B. Onderdonk, P. E.

cc. Water Resources  
A. J. Macchi, P. E.  
File

4

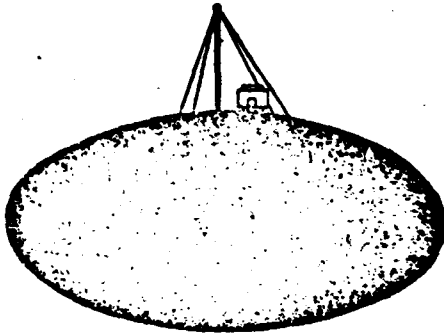

RECEIVED

OCT 30 1963

ONDERDONK & LATHROP  
CONSULTING ENGINEERS  
GLASTONBURY, CONN.

STATE WATER RESOURCES COMMISSION	
RECEIVED	
NOV 8 1963	
ANSWERED.....	
REFERRED.....	
FILED.....	

CLARENCE W. WELTI, P. E.  
C. BRUNO PRIMUS, P. E.

ENGINEERING SERVICES INCORPORATED

GLASTONBURY, CONN.

ME-3-4623

October 29, 1963

Onderdonk & Lathrop, Engineers  
2512 Main Street  
Glastonbury, Conn.

Re: Crystal Lake Dam; Middletown/and Letter A. J. Macchi to  
Water Resources Commission on Subject Dam

Dear Sirs:

ENG. OCT 31 1963

With regard to the above I have reviewed the proposed dam and find the following:

1. As regards gradation of core I recommended a reduction in the lower limit of grain size for the following reasons (a) the lower as originally proposed would permit use of varved clays, which would have extremely low strength characteristics and would carry high pore water pressures for long periods of time and (b) there would be inherent difficulty in compacting the materials with high clay percentages.

The core as proposed represents a compromise common to all properly designed dams, i.e., a balance between strength characteristics (including reduction in pore water pressures) and a reasonable permeability in the core. The latter we are obtaining by requiring the silt-clay in somewhat lesser quantities than originally planned but with material wherein the required degree of compaction is readily obtainable. It might be mentioned here that permeability is an inverse square function of the density of the soil and an exponential function of the 10% size. Thus the criteria as mentioned above appear to be adequate.

2. As concerns providing protection against "sluicing"; action is possibly warranted. However, consideration should be given to the statistical probability of a sluicing action on the downstream portion of the dam. Conditions for a statistical analysis are as follows: (1) the stratification is 20 - 30° to the east (2) the rock exhibits layers in the upper portions, which are somewhat decomposed, but below 10 - 15 feet tends to be fairly tight (3) the usual continuity of blocking or cleaving is perpendicular to the bedding and is never over 3 to 4 feet (4) the depth of the curtain wall and grout is at least 16 feet.



Firstly, the existence of a continuous stratum sloping from the surface toward the bottom of the grout curtain or below the grout curtain (in all cases parallel to prevailing stratification is statistically about 1 in 50 at the highest stratum (bottom of grout curtain) with progressively less chance in the deeper strata of such a pervious stratum.

Assuming that the decomposed stratum or pervious stratum exists immediately at the level of bottom of grout curtain; then in order to seep up into the dam it must find either continuous cleaving (always perpendicular to bedding) or it must find further pervious layers combined with cleavage. The latter seems far more likely. In this consideration the likelihood of pervious strata or voids parallel to bedding plane is perhaps in the magnitude of 1 in 50 to 1 in 10. However, the likelihood of connecting cleaving is certainly far greater, possibly 1 to 100.

Hence the likelihood of any "sluicing" would be  $1/50 \times 1/30 \times 1/100 = \frac{1}{150,000}$ . Admittedly the probability is approximate but it certainly places the chance of "sluicing" in the proper light. Furthermore the chances of "sluicing" into the core are less than the above; since here the closest possible point of "sluicing" would be about 10 feet from the grout curtain and the chances of such be about 1 to infinity with a gradual drop-off to the above odds.

Assuming that such "sluicing" were to take place the question arises wherein could material be removed? The tremendous shell would act as a weighted filter and the excessive water would be recaptured at the downstream stone blanket. This stone blanket should, however, be carried to within 8 feet of the core.

If the agency insists in protection against the "sluicing" I would insist that the scheme used be that in B-a of Mr. Macchi's letter since that B-b would seriously effect the stability and the permeability characteristics of the dam.

Very truly yours,

ENGINEERING SERVICES, INC.

by:   
Clarence W. Welti, P. E.

CWW:n  
cc:file

**A. J. M A C C H I                      E N G I N E E R S**  
**DR. GIULIO PIZZETTI**                      **ASSOCIATE CONSULTANT**

**4 GILLETT STREET  
7 CORSO DUCA ABRUZZI**

**HARTFORD, CONN.  
TORINO, ITALY**

**PHONE 826-8831  
PHONE 519-473**

**A.S.P.E.**

**A.S.C.E.**


**A.C.I.**

**November 27, 1963**

**State of Connecticut  
Water Resources Commission  
State Office Building  
165 Capitol Avenue  
Hartford 15, Connecticut**

**Attention Mr. William P. Sander**

**Re: Crystal Lake Dam  
Middletown, Conn.**

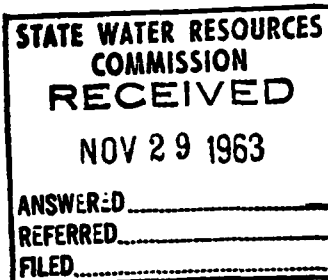

**Dear Mr. Sander:**

**I have reviewed the letter from Clarence W. Welti dated October 29, 1963 regarding the above-referenced dam. Following are my comments:**

**In regard to gradation of the core, there may be a misunderstanding. There should be no disagreement on this point. The gradation chart furnished us shows "lower limit" which establishes the largest sizes that can be used in the core. This chart indicates that a core material with a minimum size close to fine sand (0.065) m.m.) can be used. A material close to this minimum size would have no binder and would be pervious making a poor core. A minimum of 5% clay should be included. This means revising the bottom of "lower limit" curve slightly to include a minimum of approximately 5% clay. I am sure this was the intent in the design of the core.**

**In regard to protection against slaking action, it is my considered opinion that this point should not be analysed using statistical probability so long as there are avenues of design that avoid this uncertainty; especially considering unexplained failure of the previous dam.**


State of Connecticut  
Water Resources Commission  
Hartford 15, Connecticut

November 27, 1963

Retaining the proposed design it appears the simplest solution is to reduce the core eliminating that part downstream of the cut off wall which is vulnerable.

Very truly yours,

A. J. MACCHI, ENGINEERS

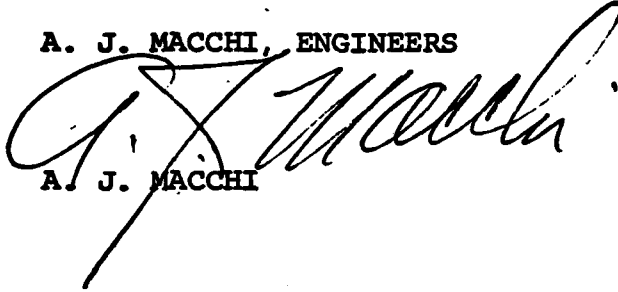A large, stylized handwritten signature in dark ink, appearing to read 'A. J. Macchi', is written over the typed name and extends upwards and to the left.

A. J. MACCHI

cc.

ENG. DEC 11 1963

ONDERDONK & LATHROP  
CONSULTING ENGINEERS  
2512 MAIN STREET  
GLASTONBURY, CONNECTICUT

A. BRUCE ONDERDONK, P.E.  
ROBERT P. LATHROP, P.E.

December 10, 1963

TELEPHONE 633-8409

Mr. T. J. Murphy, Jr., Commissioner  
Public Works Department  
State Office Building  
Hartford 15, Connecticut

Re: Construction of Dam  
Crystal Lake, Middletown  
Project BI-BB-53

Attention: Mr. M. R. Case,  
Assistant Chief Engineer

Dear Mr. Case:

In reply to Mr. Macchi's letter of November 27, 1963, which you forwarded to us on December 5, 1963, we make the following comments:

1. With reference to gradation of the core, we accept this suggestion and will modify the core gradation curve accordingly.
2. In reply to protection against "sluicing action", we have again conferred with Mr. Welti, our soils consultant, who states, "The analysis of the dam was not done by statistical probability; rather the statistical probability was used to place the problem of 'sluicing' in its proper light. As mentioned in my letter of October 20, 1963, in the next to the last paragraph, the 'sluicing' that might occur, could not cause damage of any substance to the dam. Its head could not conceivably be more than a few feet above the hydrostatic head within the dam at the point of entry into the core. Furthermore, the shell is designed as a filter adjacent to the core and would not permit core material to filter through to the stone blanket".

If there are any further questions please contact this office.

Yours very truly,

A. B. Onderdonk

A. Bruce Onderdonk, P. E.

ABO/c



# STATE OF CONNECTICUT

WATER RESOURCES COMMISSION

STATE OFFICE BUILDING • HARTFORD 15, CONNECTICUT

## CERTIFICATE OF APPROVAL

April 27, 1966

State Board of Fisheries & Game  
State Office Building  
Hartford, Connecticut

TOWN: Middletown  
RIVER: Summer Brook  
TRIBUTARY: Prout Brook  
CODE NO.: C27.5 SB2.3 PB0.7

Gentlemen:

NAME AND LOCATION OF STRUCTURE: Crystal Lake Dam on Prout Brook in the  
Town of Middletown.

DESCRIPTION OF STRUCTURE AND WORK PERFORMED: Construction of earth  
dam about 115 feet long and about 35 feet high

CONSTRUCTION PERMIT ISSUED UNDER DATE OF: March 24, 1964

This certifies that the work and construction included in the plans submitted, for the structure described above, has been completed to the satisfaction of this Commission and that this structure is hereby approved in accordance with Section 25-114 of the 1958 Revision of the General Statutes.

The owner is required by law to record this Certificate in the land records of the town or towns in which the structure is located.

WATER RESOURCES COMMISSION


BY:

William S. Wise, Director

WSW:js

**APPENDIX C**

**PHOTOGRAPHS**

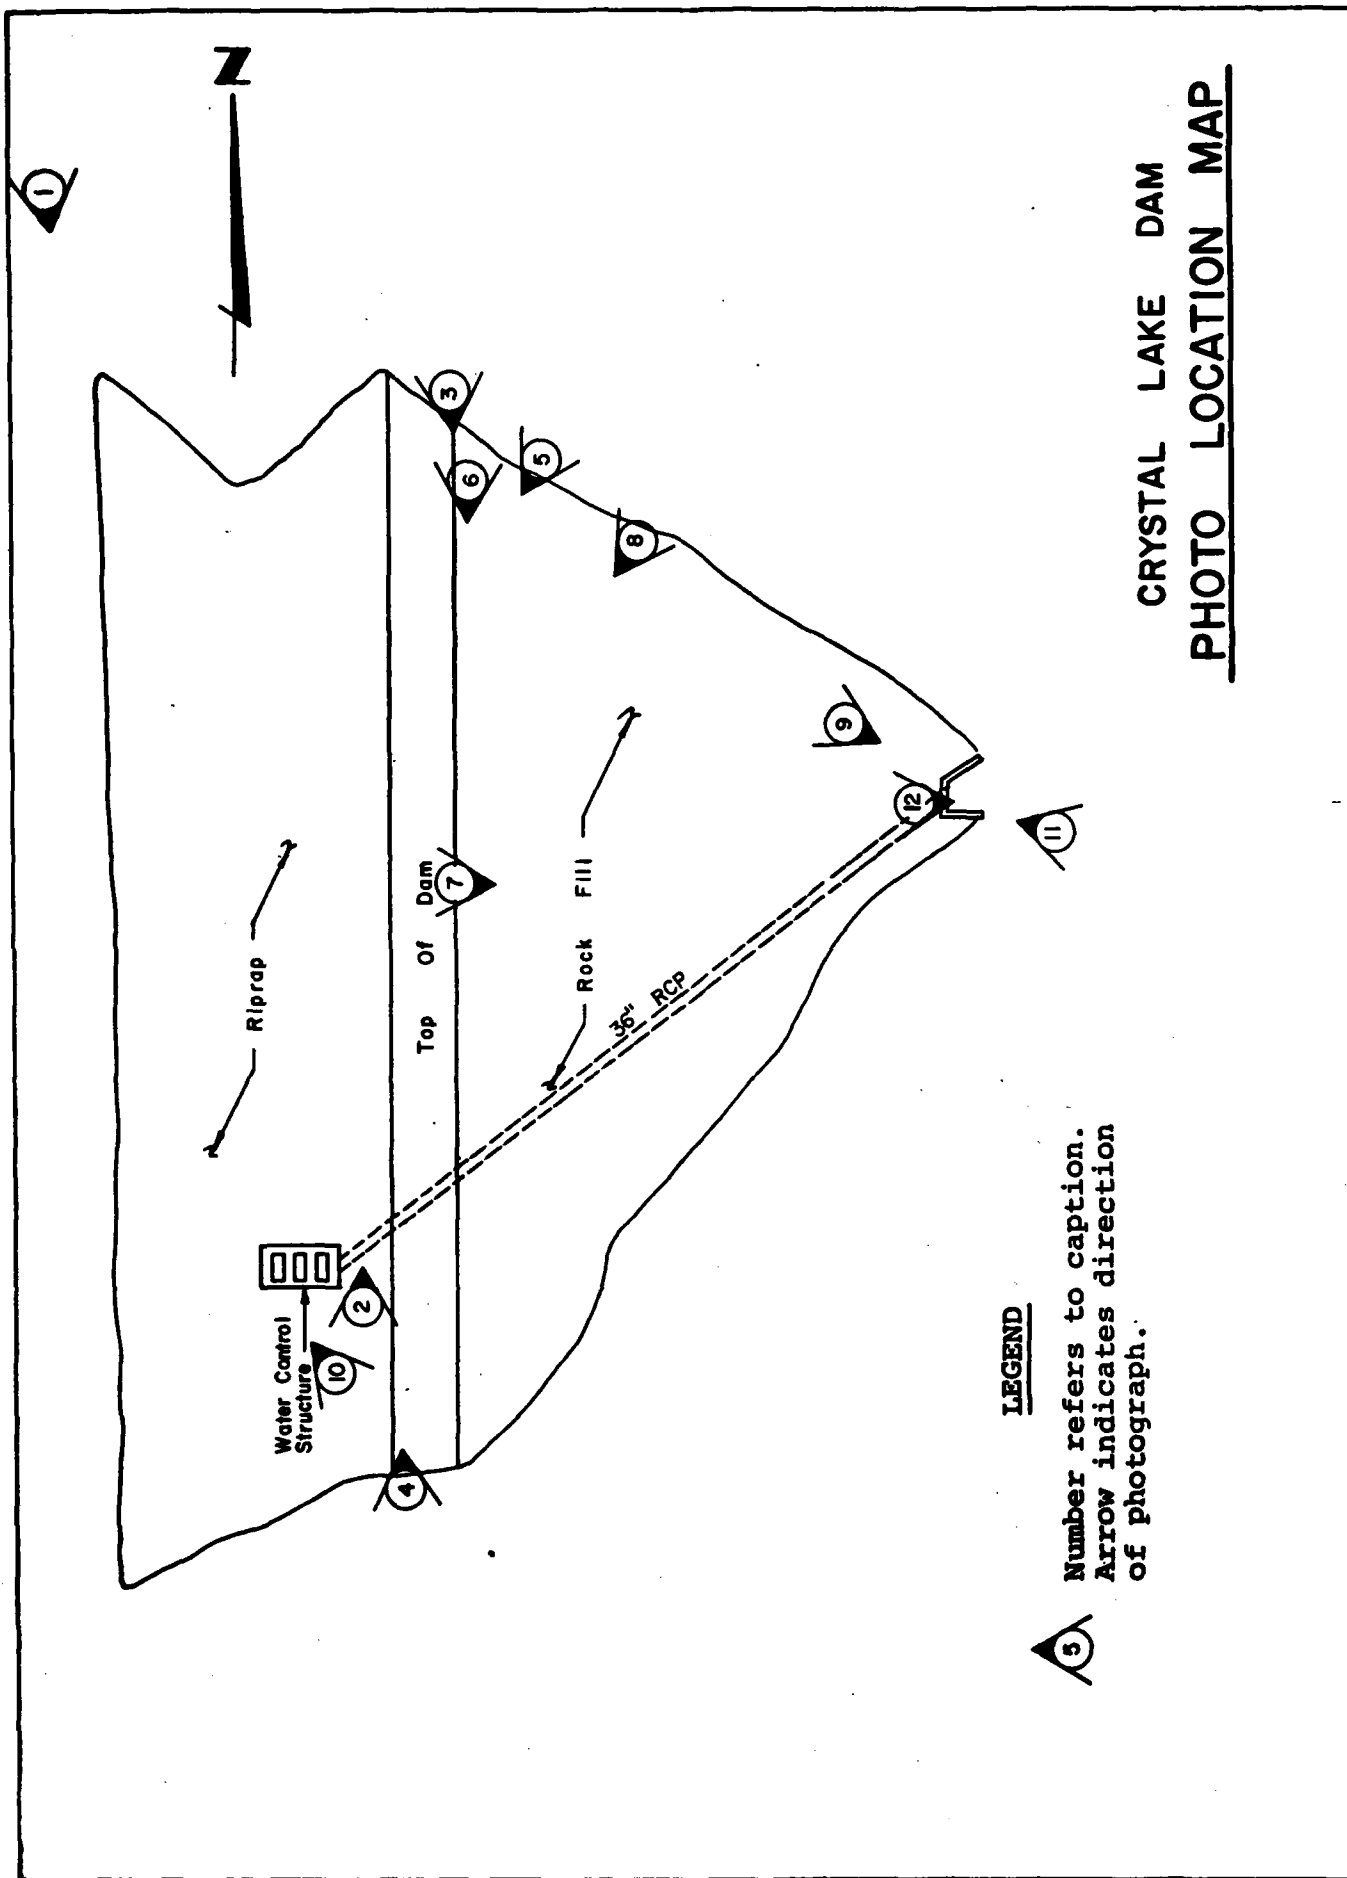

LEGEND

Number refers to caption.  
Arrow indicates direction  
of photograph.

CRYSTAL LAKE DAM  
PHOTO LOCATION MAP



PHOTO #1: Upstream face of dam.

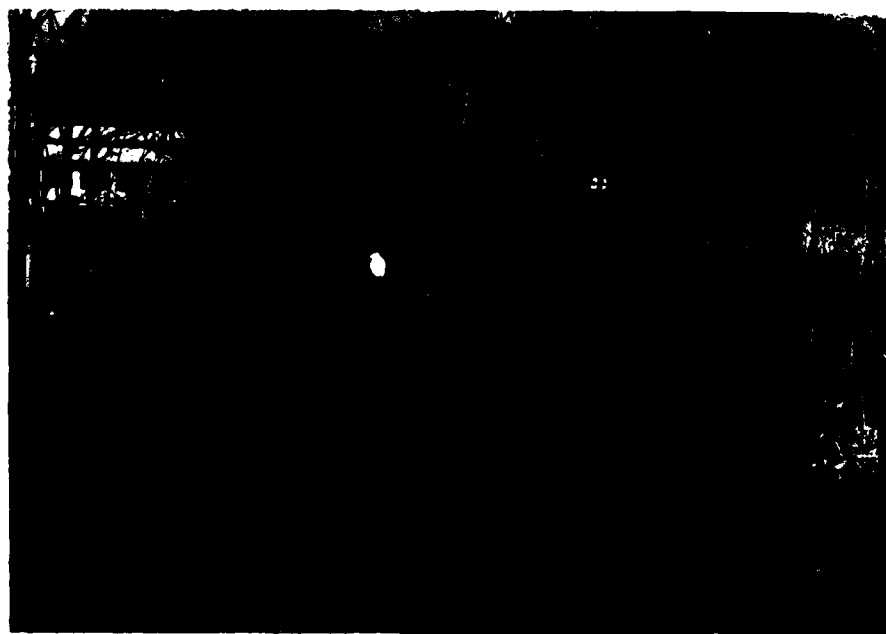


PHOTO #2: Upstream face of dam. Note sappling trees growing through riprap.





PHOTO #3: Crest of dam from left (North) abutment.

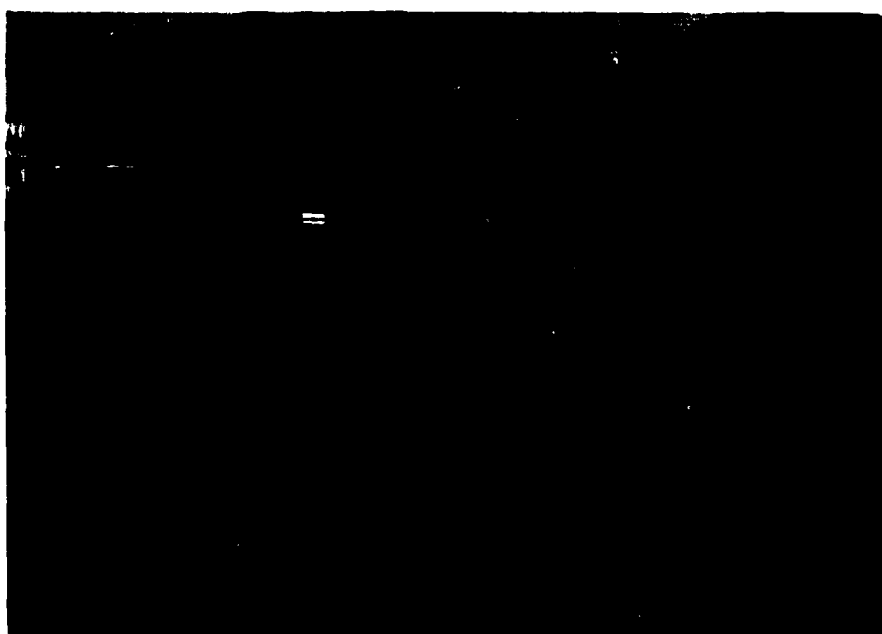


PHOTO #4: Crest of dam from right (South) abutment.

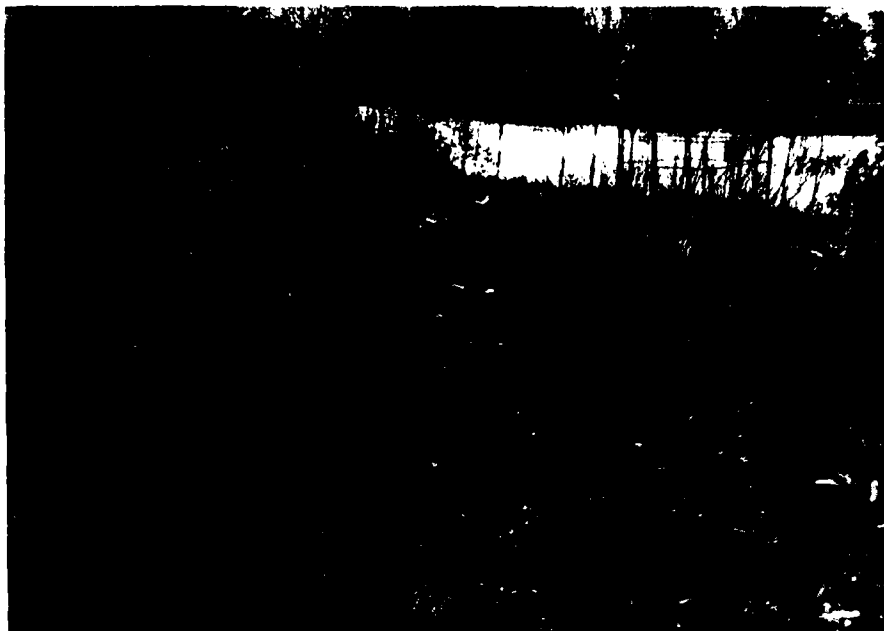


PHOTO #5: Crest of dam and rockfill on downstream slope from left abutment.



PHOTO #6: Rockfill on downstream slope of dam.

AD-A143 300


NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS  
CRYSTAL LAKE DAM CT 0. (U) CORPS OF ENGINEERS WALTHAM  
MA NEW ENGLAND DIV JAN 80


2/2

UNCLASSIFIED

F/G 13/13

NL

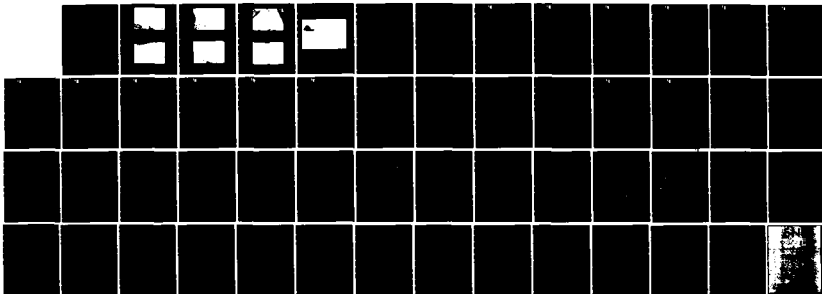

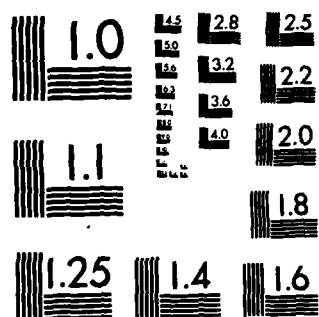

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS-1963-A



PHOTO #7: Looking downstream from crest. Trees growing out of rockfill up to 4 inches in diameter.



PHOTO #8: Downstream face of dam (looking upslope).



PHOTO #9: Looking toward outlet structure near toe of dam. Note tree uprooted on the slope.

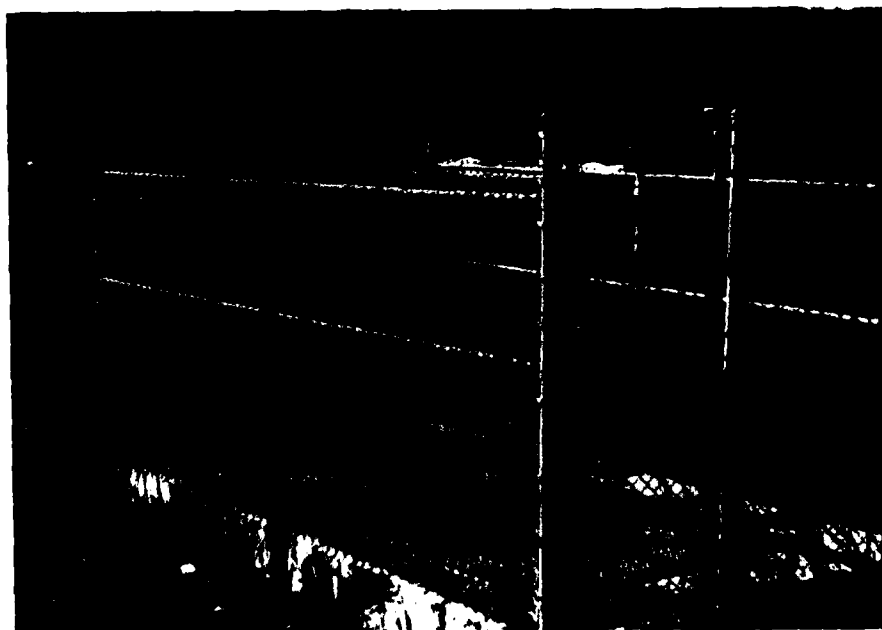


PHOTO #10: Water control structure.



PHOTO #11: 36"-diameter outlet pipe and grated endwall.



PHOTO #12: Looking downstream along outlet channel.  
Note large trees and brush.



PHOTO #13: Reservoir Area. Dam is at lower right of photograph.



APPENDIX D

HYDROLOGIC AND HYDRAULIC  
COMPUTATIONS



DETERMINATION OF SPILLWAY TEST FLOOD\*

A. SIZE CLASSIFICATION

Storage Volume (Ac.-Ft.) 350  
Height of Dam (Ft.) 50  
Size, Classification INTERMEDIATE

B. HAZARD POTENTIAL CLASSIFICATION

<u>Category</u>	<u>Loss of Life</u>	<u>Economic Loss</u>
Low	None expected	Minimal
Significant	Few	Appreciable
High	More than few	Excessive

Hazard Classification HIGH

C. HYDROLOGIC EVALUATION GUIDELINES

<u>Hazard</u>	<u>Size</u>	<u>Spillway Design Flood</u>
Low	Small	50 to 100-Year Frequency
	Intermediate	100-Year Frequency to 1/2 PMF
	Large	1/2 PMF to PMF
Significant	Small	100-Year Frequency to 1/2 PMF
	Intermediate	1/2 PMF to PMF
	Large	PMF
High	<u>Small</u>	<u>1/2 PMF to PMF</u>
	Intermediate	PMF
	Large	PMF

Spillway Test Flood PMF

\*Based upon "Recommended Guidelines for Safety Inspection of Dams" Department of the Army, Office of the Chief of Engineers, November 1976.

ECT  
YSTAL LAKE DAM  
ADULTOWN, CT



FLAHERTY-GIAVARA ASSOCIATES  
ENVIRONMENTAL DESIGN CONSULTANTS  
ONE COLUMBUS PLAZA, NEW HAVEN, CONN. 06510/203/789-1200

SHEET NO. 2 OF 29  
BY PB DATE 12/4/79  
CHK'D BY TAM DATE 12/17/79

## SPILLWAY TEST FLOOD (PMF)

### RAINFALL

PMP = 24 FOR 6 HOUR DURATION (DESIGN OF SMALL DAMS - FIG. 15)

RECOMMENDED REDUCTION FACTOR = 20%

$$PMP_{6HR} = 24 \times .80 = 19.2 \text{ IN.}$$

$$PMP \text{ FOR 1 HOUR DURATION} = .5(19.2) = 9.6 \text{ IN.} \\ (\text{FIG. 18})$$

$$PMP \text{ FOR 24 HOUR DURATION} = 1.20 \times 19.2 = 23.04 \text{ IN.} \\ (\text{FIG. 16})$$

### RUNOFF

WATERSHED IS SPARSELY DEVELOPED & COMPOSED  
OF GLACIAL TILL SOILS. ASSUME SOIL IS  
PARTIALLY SATURATED  
SCS CN VALUE = 80

FROM FIGURE A-4

$$1 \text{ HR RAINFALL} = 9.6 \therefore \text{ RUNOFF } 7.1 \text{ IN}$$

$$6 \text{ HR RAINFALL} = 19.6 \therefore \text{ RUNOFF } 16.5 \text{ IN}$$

$$24 \text{ HR RAINFALL} = 23.04 \therefore \text{ RUNOFF } 20.0 \text{ IN}$$



PROBABLE MAXIMUM FLOOD

$$Q = \frac{484 A R}{T_p}$$

$$A = \text{area (sq. mi)} \therefore 0.26 \text{ mi}^2$$

$$R = \text{runoff}, L = 1800', S = 0.09\%$$

$$T_c = \frac{.00013 L^{.77}}{.0944^{.385}} = 0.1 \text{ HRS}$$

$$T_p = \frac{1}{2} + .6(T_c)$$

Q 1 HOUR

$$T_p = \frac{1}{2} + 0.6(.1) = .56 \text{ HRS}$$

$$Q_{1 \text{ hr}} = \frac{484 \times .26 \times 7.1}{.56} = 1595 \text{ cfs}$$

Q 6 HOUR

$$T_p = \frac{6}{2} + 0.6(.1) = 3.06$$

$$Q_{6 \text{ hr}} = \frac{484 \times .26 \times 16.5}{3.06} = 679 \text{ cfs}$$

Q 24 HOURS

$$T_p = \frac{24}{2} + .6(.1) = 12.06$$

$$Q_{24 \text{ hr}} = \frac{484 \times .26 \times 20.0}{12.06} = 209 \text{ cfs}$$

CRYSTAL LAKE



FLAHERTY-GIAVARA ASSOCIATES  
ENVIRONMENTAL DESIGN CONSULTANTS  
ONE COLUMBUS PLAZA, NEW HAVEN, CONN. 06510/203/799-1200

SHEET NO. 4 OF 29  
BY PR DATE 12/4/79  
CHK'D. BY JGM DATE 12/19/79

VOL. OF RUNOFF 1 HOUR STORM

$$\frac{7.1 \text{ IN}}{12 \text{ IN/FT}} \times .26 \text{ mi}^2 \times 640 \frac{\text{AC}}{\text{mi}^2} = 98 \text{ ACRE-Feet}$$

VOL. OF RUNOFF 6 HOUR STORM

$$\frac{165 \text{ IN}}{12 \text{ IN/FT}} \times .26 \text{ mi}^2 \times 640 \frac{\text{AC}}{\text{mi}^2} = 229 \text{ ACRE-Feet}$$

VOL. OF RUNOFF 24 HOUR STORM


$$\frac{2010 \text{ IN}}{12 \text{ IN/FT}} \times .26 \text{ mi}^2 \times 640 \frac{\text{AC}}{\text{mi}^2} = 277 \text{ ACRE-Feet}$$

### HYDROGRAPHS

A TRIANGULAR HYDROGRAPH IS TO BE USED FOR THE ROUTING OF THE TEST FLOODS THROUGH THE RESERVOIR. A ROUTING WILL BE DONE FOR THE 1 HOUR, 6 HOUR, AND 24 HOUR DURATION PMP TO DETERMINE THE CONTROLLING STORM. THE DURATION OF RUNOFF ( $T_b$ ) WILL BE SET SO THAT THE VOLUME OF THE HYDROGRAPH EQUALS THE PREVIOUSLY DETERMINED VOLUME OF RUNOFF.



# HYDROGRAPH 1 HOUR PMF

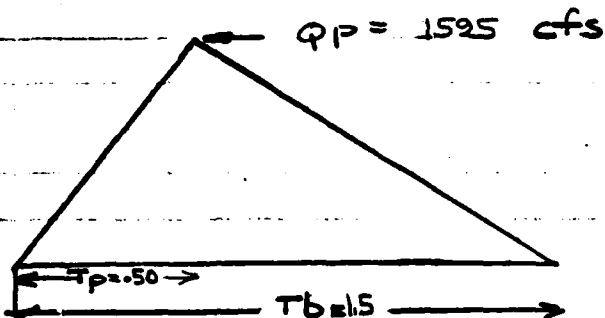

$$VOL = \frac{1}{2} Q_p T_b$$

$$\frac{90 \text{ ACRE FEET}}{.5 \times 1461} = T_b$$

$$.5 \times 1461 = \frac{1}{2} Q_p$$

$$\frac{98 \text{ ACRE-FT} \times 43560 \text{ AC-FT}}{.5 \times 1595 \text{ CF/SEC} \times 3600 \frac{\text{SEC}}{\text{HR}}} = 1.48 \quad \text{SAY } T_b = 1.5 \text{ hours}$$

$$.5 \times 1595 \text{ CF/SEC} \times 3600 \frac{\text{SEC}}{\text{HR}}$$

$$\text{SET } T_p = \frac{1}{3} T_b$$

$$T_p = .50 \text{ HOURS}$$


## TABULAR HYDROGRAPH (PMF)

HOURS	Q (cfs)	HOURS	Q
0.0	0	1.1	638
0.10	312	1.2	478
0.20	638	1.3	319
0.30	957	1.4	159
0.40	1276	1.5	0
0.50	1595		
0.60	1436		
0.70	1276		
0.80	1117		
0.90	957		
1.0	797		

D-5



HYDROGRAPH 6 HOUR PMF

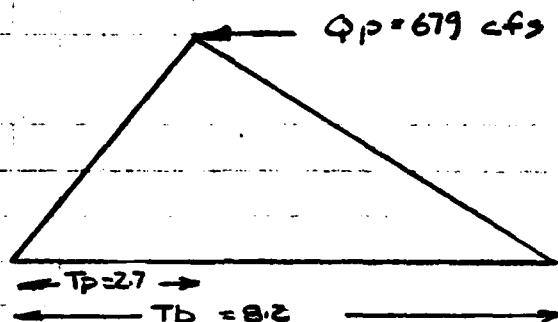

$$VOL = \frac{1}{2} Q_p T_b$$

$$\frac{229 \text{ ACRE-FT}}{0.5 \times 679 \text{ CFS}} = T_b$$

$$\frac{229 \text{ ACRE-FT} \times 43560 \text{ FT}^2/\text{ACRE}}{0.5 \times 679 \text{ CFS} \times 3600 \frac{\text{SEC}}{\text{HR}}} = T_b = 8.2 \text{ hours}$$

$$\text{SET } T_p = \frac{1}{3} T_b$$

$$= 2.7 \text{ hrs}$$

TABULAR HYDROGRAPH

HOURS	PMF Q (cfs)	1/2 PMF Q (cfs)
0.0	0	0
1.0	251	125
2.0	503	252
2.7	679	340
3.0	642	321
4.0	519	260
5.0	395	198
6.0	272	136
7.0	148	74
8.2	0	0

PROJECT

CRYSTAL LAKE



FLAHERTY-GIAVARA ASSOCIATES  
ENVIRONMENTAL DESIGN CONSULTANTS  
ONE COLUMBUS PLAZA, NEW HAVEN, CONN. 06510/203/789-1200

SHEET NO. 7

OF 29


BY PB

DATE 12/4/79

CHK'D BY JGM

DATE 12/19/79

## HYDROGRAPH FOR 24 HOUR PMF

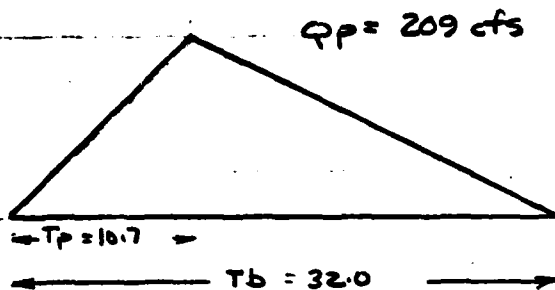

$$VOL = \frac{1}{2} Q_p T_b$$

$$277 \text{ ACRE-FT} = T_b$$

$$.5 \times 209 \text{ CFS}$$

$$277 \text{ ACRE-FT} \times 43560 \frac{\text{FT}^2}{\text{ACRE}} = 32 = T_b$$

$$.5 \times 209 \times 3600 \text{ SEC/HR}$$

$$\text{SET } T_p = \frac{1}{3} T_b = 10.7$$


## TABULAR HYDROGRAPH

HOURS	Q cfs
0	0
3	59
6	117
9	176
10.7	209
12	196
15	167
18	137
21	108
24	78
27	49
30	20
32	0





## STAGE DISCHARGE DATA

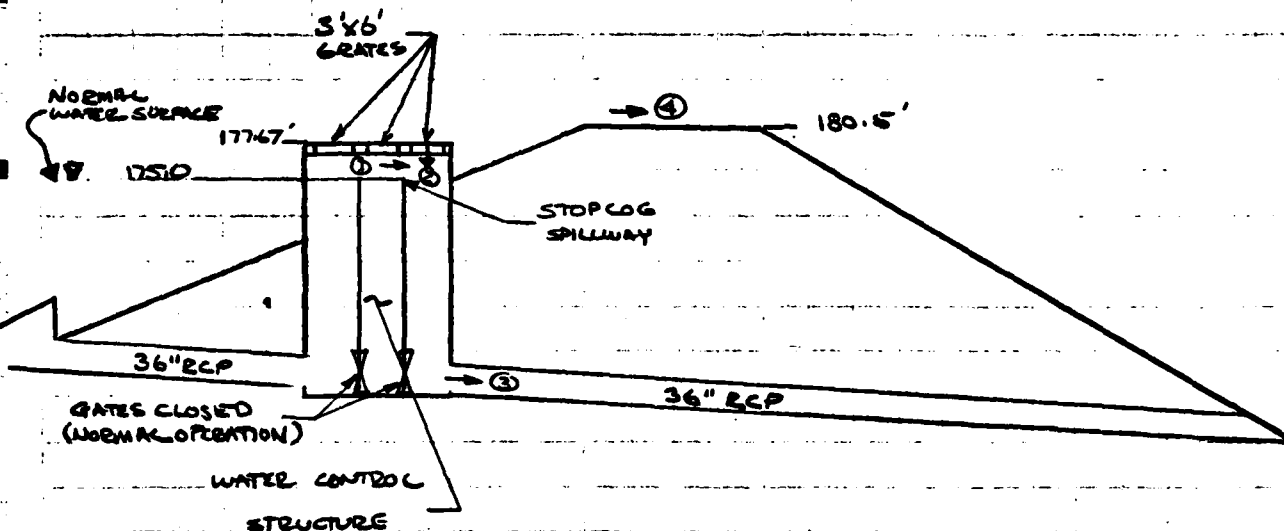

## DISCHARGE ANALYSIS


THERE ARE SEVERAL DIFFERENT MEANS IN WHICH WATER CAN POTENTIALLY DISCHARGE THROUGH OR OVER THE DAM STRUCTURE AS SUMMARIZED BELOW.

1. WATER PASSING OVER THE STOP LOG SPILLWAY AND THROUGH THE OUTLET CONDUIT. THIS DISCHARGE IS A SPILLWAY CONDITION FROM ELEV. 175 TO 176. ABOVE ELEVATION 176 THE DISCHARGE IS AN ORIFACE CONDITION.
2. ABOVE ELEVATION 177.67, WATER ENTERS THROUGH THE RIGHT GATE ONLY, FUNCTIONING AS A DROP INLET.
3. THE ABOVE DESCRIBED FLOW DISCHARGES ARE POTENTIALLY CONTROLLED BY THE 36" RCP. OUTLET CONDUIT, WHICH FUNCTIONS AS AN ORIFACE DUE TO ITS STEEP SLOPE.



4. A RISE IN THE WATER SURFACE LEVEL ABOVE ELEVATION 180.5, CAUSE WATER TO OVERTOP THE DAM, IN ADDITION TO STILL DISCHARGING THROUGH THE CONDUIT

STOPLOG SPILLWAY / ORIFACE

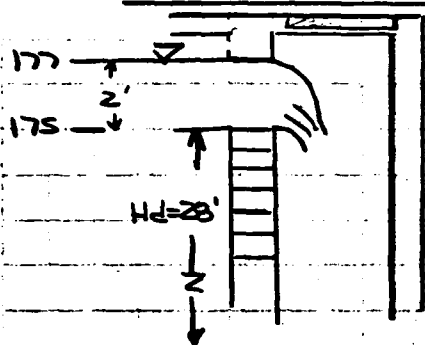

$$Q = CLH^{3/2}$$

SPILLWAY LENGTH = 6'

FROM LINSLEY AND FRANZINI

"WATER RESOURCES ENG."


TABLE 10.3

$$H_d/h = 28/2 = 14 \therefore C = 3.29$$

STAGE (ELEV)	DISCHARGE (Q)	ABOVE ELEV. 177.0', OPENING IS SUBMERGED AND ACTS AS AN ORIFICE
175.0	0	
spillway 176.0	19.7	
177.0	55.8	$Q = C_d A \sqrt{2gh}$
178.0	82	WHERE:
179.0	100	
orifice 180.5	122	$C_d = 0.60$
181.0	129	
182.0	141	$A = 6 \times 2 = 12 \text{ sf.}$
		$h$ IS MEASURED TO CENTER OF ORIFICE (ELEV. 176.0)




DROP INLET

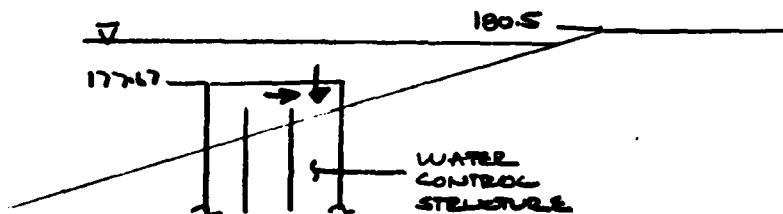

THIS GATE FUNCTIONS AS DROP INLET  
FOR WATER LEVELS GREATER THAN  
177.67. THE OTHER GATES DO NOT  
FUNCTION AS OUTLET DISCHARGES,  
THEY ARE RESTRICTED TO CAPACITY  
OF STOPLOG SPILLWAY ACTING AS  
AN ORIFICE.

GATE DETAIL

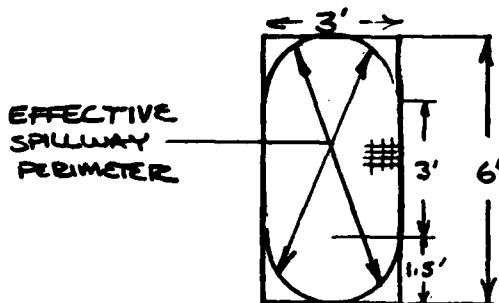

EFFECTIVE  
SPILLWAY  
PERIMETER

$$\begin{aligned} & - 3' + 3' = 6' \\ & - \frac{1}{2} \pi (3)(2) = 9.42' \\ & \text{TOTAL} = 15.42' \end{aligned}$$

EFFECTIVE  
AREA


$$\begin{aligned} & + 3 \times 3 = 9 \text{ SF} \\ & + \frac{\pi (3)^2}{4} = 7.1 \text{ SF} \\ & \text{TOTAL} = 16.1 \text{ SF} \end{aligned}$$

EQUIVALENT RADIUS

$$\begin{aligned} \pi r^2 &= 16.1 \text{ SF} \\ r &= \sqrt{\frac{16.1}{\pi}} \\ r &= 2.26' \end{aligned}$$



USING DROP INLET PROCEDURE  
(DESIGN OF SMALL DAMS)

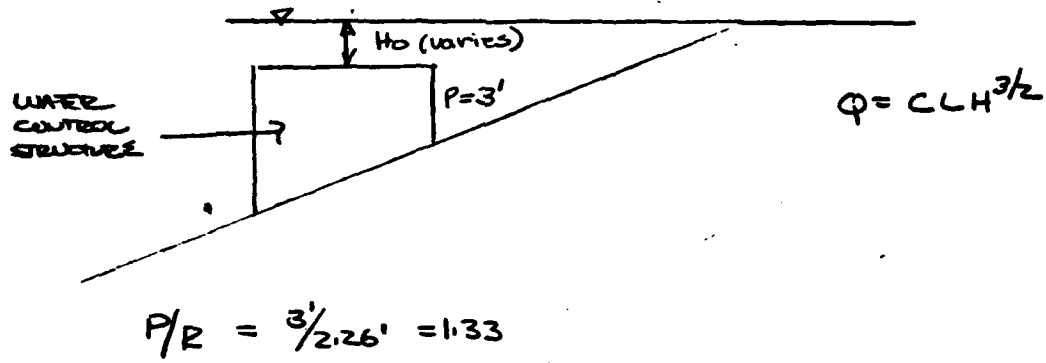

ELEV.	$H_o$	$H_o/R$	C (FIG. 2B3)	CALC.	Q (cfs)
177.67	0				0
178.0	0.33	$0.33/2.26 = .15$	3.8	$3.8 (15.42) (.33)^{3/2}$	11.1
179.0	1.33	$1.33/2.26 = .59$	3.1	$3.1 (15.42) (1.33)^{3/2}$	73.3
180.5	2.83	$2.83/2.26 = 1.25$	1.65	$1.65 (15.42) (2.83)^{3/2}$	121
181.0	3.33	$3.33/2.26 = 1.47$	1.40	$1.40 (15.42) (3.33)^{3/2}$	131
182.0	4.33	$4.33/2.26 = 1.92$	1.08	$1.08 (15.42) (4.33)^{3/2}$	150



OUTLET PIPE - 36" RCP

ALL FLOW THAT ENTER WATER CONTROL STRUCTURE THROUGH STOP LOG SPILLWAY OR DROP INLET MUST PASS THROUGH DAM VIA 36" RCP. THE CAPACITY OF THIS CONDUIT MUST BE COMPUTED TO DETERMINE CONTROL.

CONDUIT IS STEEP SLOPE THEREFORE INLET-ORIFICE CONTROL

$$Q = C_d A \sqrt{2gh}$$

$$C_d = 0.6$$

$$A = \frac{\pi (3)^2}{4} = 7.07 \text{ sf.}$$

$$\text{INV. of } 36" \text{ RCP} = 147'$$

STAGE	HEAD	Q (cfs)
175.	28	180
176.	29	183
177	30	186
178	31	189
179	32	192
180.5	33.5	196
181	34	198
182	35	201



### EMBANKMENT OVERTOPPING

LENGTH = 130

C = 3.0 (Broad crest weir)

$$Q = CLH^{3/2}$$

STAGE	HEAD	Q
181	0.5	137
182	1.5	716

### COMPOSITE STAGE DISCHARGE

STAGE	Q SPILLWAY/ ORIFICE	Q DROP INLET	Q PIPE (36") (Capacity)	Q EMB. OVERTOP	Q CONTROLS (CFS)
175	0	0	180	0	0
176	19.7	0	183	0	19.7
177	55.8	0	186	0	55.8
178	82	11.1	189	0	93.1
179	100	73.3	192	0	173.3
180.5	122	121	196	0	196.0
181	129	131	198	137	335.0
182	141	150	201	716	917.0

## CRYSTAL LAKE

1 HR STM

FLOOD ROUTING

JGM

12/19/79

## INPUT DATA:

S=175.00FT Q= 93CFS  
 S=179.00FT Q= 917CFS  
 S=190.00FT Q= 2,000CFS  
 IE=175.0 IV=

## STAGE / DISCHARGE

OCFS S=176.00FT Q= 19CFS  
 173CFS S=180.50FT Q= 196CFS  
 2,000CFS  
 0.0 E=175.0 A= 30.80 E=190.0 A= 55.00

19CFS S=177.00FT Q= 55CFS  
 196CFS S=181.00FT Q= 335CFS

S=178.00FT Q= 93CFS  
 S=182.00FT Q= 917CFS

HOUR	INFLOW	MASS INFLOW	WATER EL.	TAIL WATER	OUTFLOW	MASS OUTFLOW	STORAGE(R)	STORAGE(A)
0.00	OCFS	0.00AC-F	175.00FT	.00FT	OCFS	0.00AC-F	0.00AC-F	0.00AC-F
0.10	319CFS	1.31AC-F	175.04FT	0.00FT	OCFS	0.00AC-F	1.31AC-F	1.31AC-F
0.20	638CFS	5.27AC-F	175.16FT	0.00FT	3CFS	0.02AC-F	5.25AC-F	5.25AC-F
0.30	957CFS	11.86AC-F	175.37FT	0.00FT	7CFS	0.06AC-F	11.80AC-F	11.80AC-F
0.40	1,276CFS	21.09AC-F	175.66FT	0.00FT	12CFS	0.14AC-F	20.94AC-F	20.94AC-F
0.50	1,595CFS	32.95AC-F	176.03FT	0.00FT	20CFS	0.28AC-F	32.67AC-F	32.67AC-F
0.60	1,436CFS	45.47AC-F	176.40FT	0.00FT	33CFS	0.50AC-F	44.97AC-F	44.97AC-F
0.70	1,276CFS	56.68AC-F	176.73FT	0.00FT	45CFS	0.83AC-F	55.85AC-F	55.85AC-F
0.80	1,117CFS	66.57AC-F	177.01FT	0.00FT	55CFS	1.24AC-F	65.32AC-F	65.32AC-F
0.90	957CFS	75.14AC-F	177.25FT	0.00FT	64CFS	1.74AC-F	73.40AC-F	73.39AC-F
1.00	797CFS	82.39AC-F	177.44FT	0.00FT	71CFS	2.30AC-F	80.08AC-F	80.08AC-F
1.10	638CFS	88.32AC-F	177.59FT	0.00FT	77CFS	2.92AC-F	85.39AC-F	85.39AC-F
1.20	478CFS	92.93AC-F	177.70FT	0.00FT	81CFS	3.58AC-F	89.34AC-F	89.34AC-F
1.30	319CFS	96.22AC-F	177.78FT	0.00FT	84CFS	4.27AC-F	91.95AC-F	91.95AC-F
1.40	159CFS	98.20AC-F	177.81FT	0.00FT	86CFS	4.98AC-F	93.22AC-F	93.22AC-F
1.50	OCFS	98.85AC-F	177.81FT	0.00FT	86CFS	5.69AC-F	93.16AC-F	93.16AC-F
2.00	OCFS	98.85AC-F	177.71FT	0.00FT	82CFS	9.16AC-F	89.68AC-F	89.68AC-F
5.00	OCFS	98.85AC-F	177.20FT	0.00FT	62CFS	27.14AC-F	71.71AC-F	71.71AC-F
10.00	OCFS	98.85AC-F	176.57FT	0.00FT	39CFS	48.29AC-F	50.55AC-F	50.55AC-F
20.00	OCFS	98.85AC-F	175.86FT	0.00FT	16CFS	71.53AC-F	27.32AC-F	27.32AC-F

12/06/79

DKS

## FLOOD ROUTING

CRYSTAL LAKE DAM MDLT 6 HR HYD 79-90-10

INPUT DATA: Q= S=175.00FT Q= S=176.00FT Q= 19CFS S=177.00FT Q= 55CFS S=178.00FT Q= 93CFS  
 S=179.00FT Q= 173CFS S=180.50FT Q= 196CFS S=181.00FT Q= 335CFS S=182.00FT Q= 917CFS  
 S=190.00FT Q= 2,000CFS E=175.0 A= 30.80 E=190.0 A= 55.00  
 IE=175.0 IV= 0.0

HOUR	INFLOW	MASS INFLOW	WATER EL.	TAIL WATER	OUTFLOW	MASS OUTFLOW	STORAGE(R)	STORAGE(A)
0.00	0CFS	0.00AC-F	175.00FT	.00FT	0CFS	0.00AC-F	0.00AC-F	0.00AC-F
1.00	251CFS	10.37AC-F	175.32FT	0.00FT	6CFS	0.26AC-F	10.10AC-F	10.10AC-F
2.00	503CFS	41.52AC-F	176.25FT	0.00FT	28CFS	1.71AC-F	39.81AC-F	39.80AC-F
2.70	679CFS	75.71AC-F	177.19FT	0.00FT	62CFS	4.37AC-F	71.34AC-F	71.34AC-F
3.00	642CFS	92.09AC-F	177.61FT	0.00FT	78CFS	6.12AC-F	85.96AC-F	85.96AC-F
4.00	519CFS	140.07AC-F	178.68FT	0.00FT	148CFS	15.50AC-F	124.56AC-F	124.56AC-F
5.00	395CFS	177.83AC-F	179.33FT	0.00FT	178CFS	29.00AC-F	148.83AC-F	148.83AC-F
6.00	272CFS	205.40AC-F	179.67FT	0.00FT	183CFS	43.95AC-F	161.44AC-F	161.44AC-F
7.00	148CFS	222.75AC-F	179.72FT	0.00FT	184CFS	59.15AC-F	163.60AC-F	163.60AC-F
8.20	0CFS	230.09AC-F	179.44FT	0.00FT	180CFS	77.22AC-F	152.87AC-F	152.87AC-F
10.00	0CFS	230.09AC-F	178.77FT	0.00FT	155CFS	102.18AC-F	127.91AC-F	127.91AC-F
15.00	0CFS	230.09AC-F	177.46FT	0.00FT	72CFS	149.40AC-F	80.68AC-F	80.68AC-F
20.00	0CFS	230.09AC-F	176.73FT	0.00FT	46CFS	174.07AC-F	56.01AC-F	56.01AC-F
30.00	0CFS	230.09AC-F	175.92FT	0.00FT	18CFS	200.80AC-F	29.28AC-F	29.28AC-F
40.00	0CFS	230.09AC-F	175.55FT	0.00FT	10CFS	212.85AC-F	17.23AC-F	17.23AC-F
50.00	0CFS	230.09AC-F	175.32FT	0.00FT	6CFS	219.99AC-F	10.10AC-F	10.10AC-F



CRYSTAL LAKE DAM MDLT 24 HR HYD 79-90-10

FLOOD ROUTING

DKS

12/06/79

## STAGE / DISCHARGE

INPUT DATA: S=175.00FT Q= 0CFS S=176.00FT Q= 19CFS S=177.00FT Q= 55CFS S=178.00FT Q= 93CFS  
 S=179.00FT Q= 173CFS S=180.50FT Q= 196CFS S=181.00FT Q= 335CFS S=182.00FT Q= 917CFS  
 S=190.00FT Q= 2,000CFS  
 IE=175.0 IV= 0.0 E=175.0 A= 30.80 E=190.0 A= 55.00

HOUR	INFLOW	MASS INFLOW	WATER EL.	TAIL WATER	OUTFLOW	MASS OUTFLOW	STORAGE(R)	STORAGE(A)
0.00	0CFS	0.00AC-F	175.00FT	.00FT	0CFS	0.00AC-F	0.00AC-F	0.00AC-F
3.00	59CFS	7.31AC-F	175.21FT	0.00FT	4CFS	0.53AC-F	6.77AC-F	6.78AC-F
6.00	117CFS	29.13AC-F	175.82FT	0.00FT	16CFS	3.09AC-F	26.04AC-F	26.04AC-F
9.00	176CFS	65.45AC-F	176.70FT	0.00FT	45CFS	10.69AC-F	54.75AC-F	54.75AC-F
10.70	209CFS	92.49AC-F	177.26FT	0.00FT	65CFS	18.48AC-F	74.01AC-F	74.01AC-F
12.00	196CFS	114.25AC-F	177.66FT	0.00FT	80CFS	26.35AC-F	87.90AC-F	87.90AC-F
15.00	167CFS	159.25AC-F	178.25FT	0.00FT	113CFS	50.43AC-F	108.81AC-F	108.81AC-F
18.00	137CFS	196.94AC-F	178.46FT	0.00FT	130CFS	80.65AC-F	116.28AC-F	116.28AC-F
21.00	108CFS	227.31AC-F	178.42FT	0.00FT	126CFS	112.51AC-F	114.80AC-F	114.80AC-F
24.00	78CFS	250.37AC-F	178.23FT	0.00FT	112CFS	142.15AC-F	108.21AC-F	108.21AC-F
27.00	49CFS	263.11AC-F	177.97FT	0.00FT	92CFS	167.47AC-F	98.63AC-F	98.63AC-F
30.00	20CFS	274.66AC-F	177.61FT	0.00FT	78CFS	188.64AC-F	86.02AC-F	86.02AC-F
32.00	0CFS	276.32AC-F	177.31FT	0.00FT	67CFS	200.72AC-F	75.59AC-F	75.59AC-F
35.00	0CFS	276.32AC-F	176.88FT	0.00FT	51CFS	215.48AC-F	60.83AC-F	60.83AC-F
40.00	0CFS	276.32AC-F	176.36FT	0.00FT	32CFS	232.90AC-F	43.41AC-F	43.41AC-F
50.00	0CFS	276.32AC-F	175.75FT	0.00FT	14CFS	252.58AC-F	23.73AC-F	23.73AC-F
75.00	0CFS	276.32AC-F	175.16FT	0.00FT	3CFS	271.28AC-F	5.04AC-F	5.04AC-F

INPUT DATA: Q= S=175.00FT Q= S=179.00FT Q= S=190.00FT Q= IE=175.0 IV=


STAGE / DISCHARGE Q= S=176.00FT Q= S=180.50FT Q= S=190.00FT Q= S=200.00FT Q=


19CFS S=177.00FT Q= 55CFS S=178.00FT Q= 93CFS

196CFS S=181.00FT Q= 335CFS S=182.00FT Q= 917CFS

0.0 E=175.0 A= 30.80 E=190.0 A= 55.00

HOUR	INFLOW	MASS INFLOW	WATER EL.	TAIL WATER	OUTFLOW	MASS OUTFLOW	STORAGE(R)	STORAGE(A)
0.00	0CFS	0.00AC-F	175.00FT	.00FT	0CFS	0.00AC-F	0.00AC-F	0.00AC-F
1.00	125CFS	5.16AC-F	175.16FT	0.00FT	3CFS	0.13AC-F	5.03AC-F	5.03AC-F
2.00	252CFS	20.74AC-F	175.63FT	0.00FT	12CFS	0.78AC-F	19.95AC-F	19.96AC-F
2.70	340CFS	37.86AC-F	176.13FT	0.00FT	24CFS	1.85AC-F	36.00AC-F	36.00AC-F
3.00	321CFS	46.06AC-F	176.36FT	0.00FT	32CFS	2.56AC-F	43.49AC-F	43.49AC-F
4.00	260CFS	70.07AC-F	176.97FT	0.00FT	54CFS	6.19AC-F	63.87AC-F	63.87AC-F
5.00	198CFS	88.99AC-F	177.37FT	0.00FT	69CFS	11.33AC-F	77.65AC-F	77.65AC-F
6.00	136CFS	102.79AC-F	177.59FT	0.00FT	77CFS	17.44AC-F	85.35AC-F	85.35AC-F
7.00	74CFS	111.47AC-F	177.65FT	0.00FT	80CFS	23.98AC-F	87.49AC-F	87.49AC-F
8.20	0CFS	115.14AC-F	177.53FT	0.00FT	75CFS	31.72AC-F	83.41AC-F	83.41AC-F
10.00	0CFS	115.14AC-F	177.23FT	0.00FT	64CFS	42.18AC-F	72.96AC-F	72.96AC-F
15.00	0CFS	115.14AC-F	176.59FT	0.00FT	41CFS	64.03AC-F	51.10AC-F	51.10AC-F
20.00	0CFS	115.14AC-F	176.17FT	0.00FT	25CFS	77.89AC-F	37.25AC-F	37.25AC-F
25.00	0CFS	115.14AC-F	175.89FT	0.00FT	17CFS	86.90AC-F	28.24AC-F	28.24AC-F
30.00	0CFS	115.14AC-F	175.69FT	0.00FT	13CFS	93.37AC-F	21.76AC-F	21.76AC-F

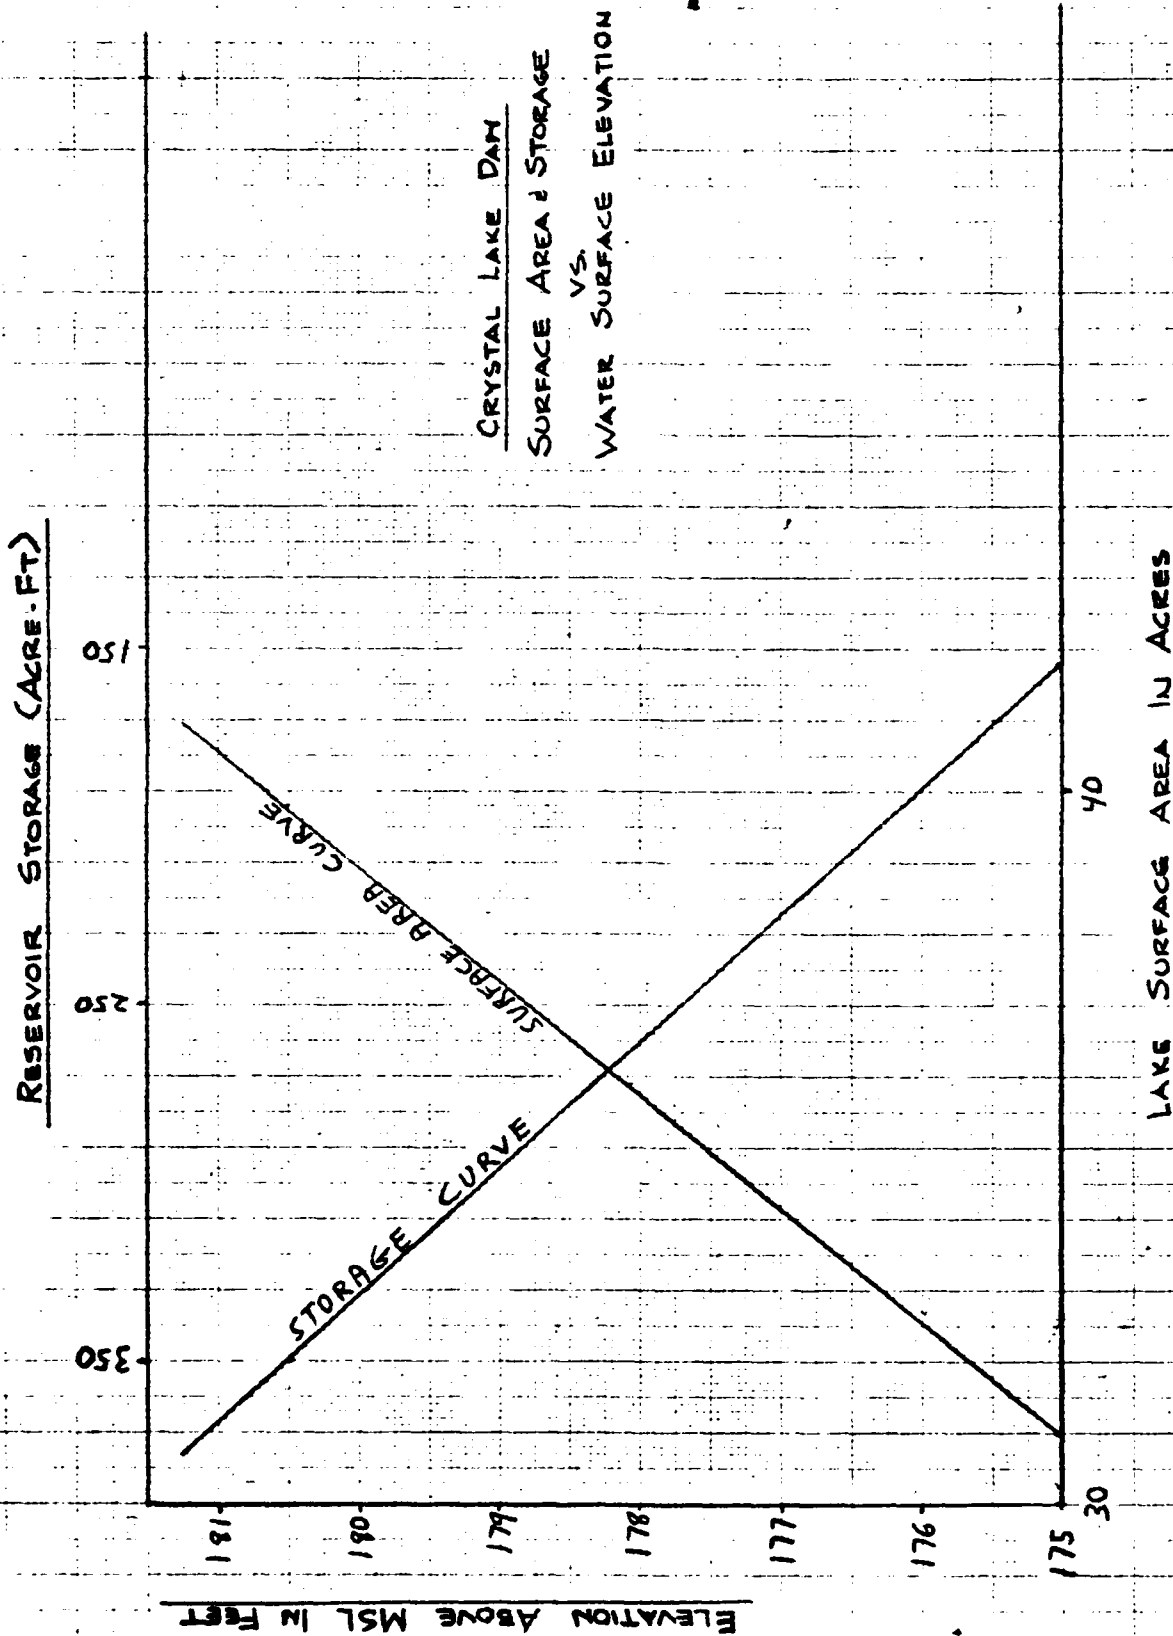

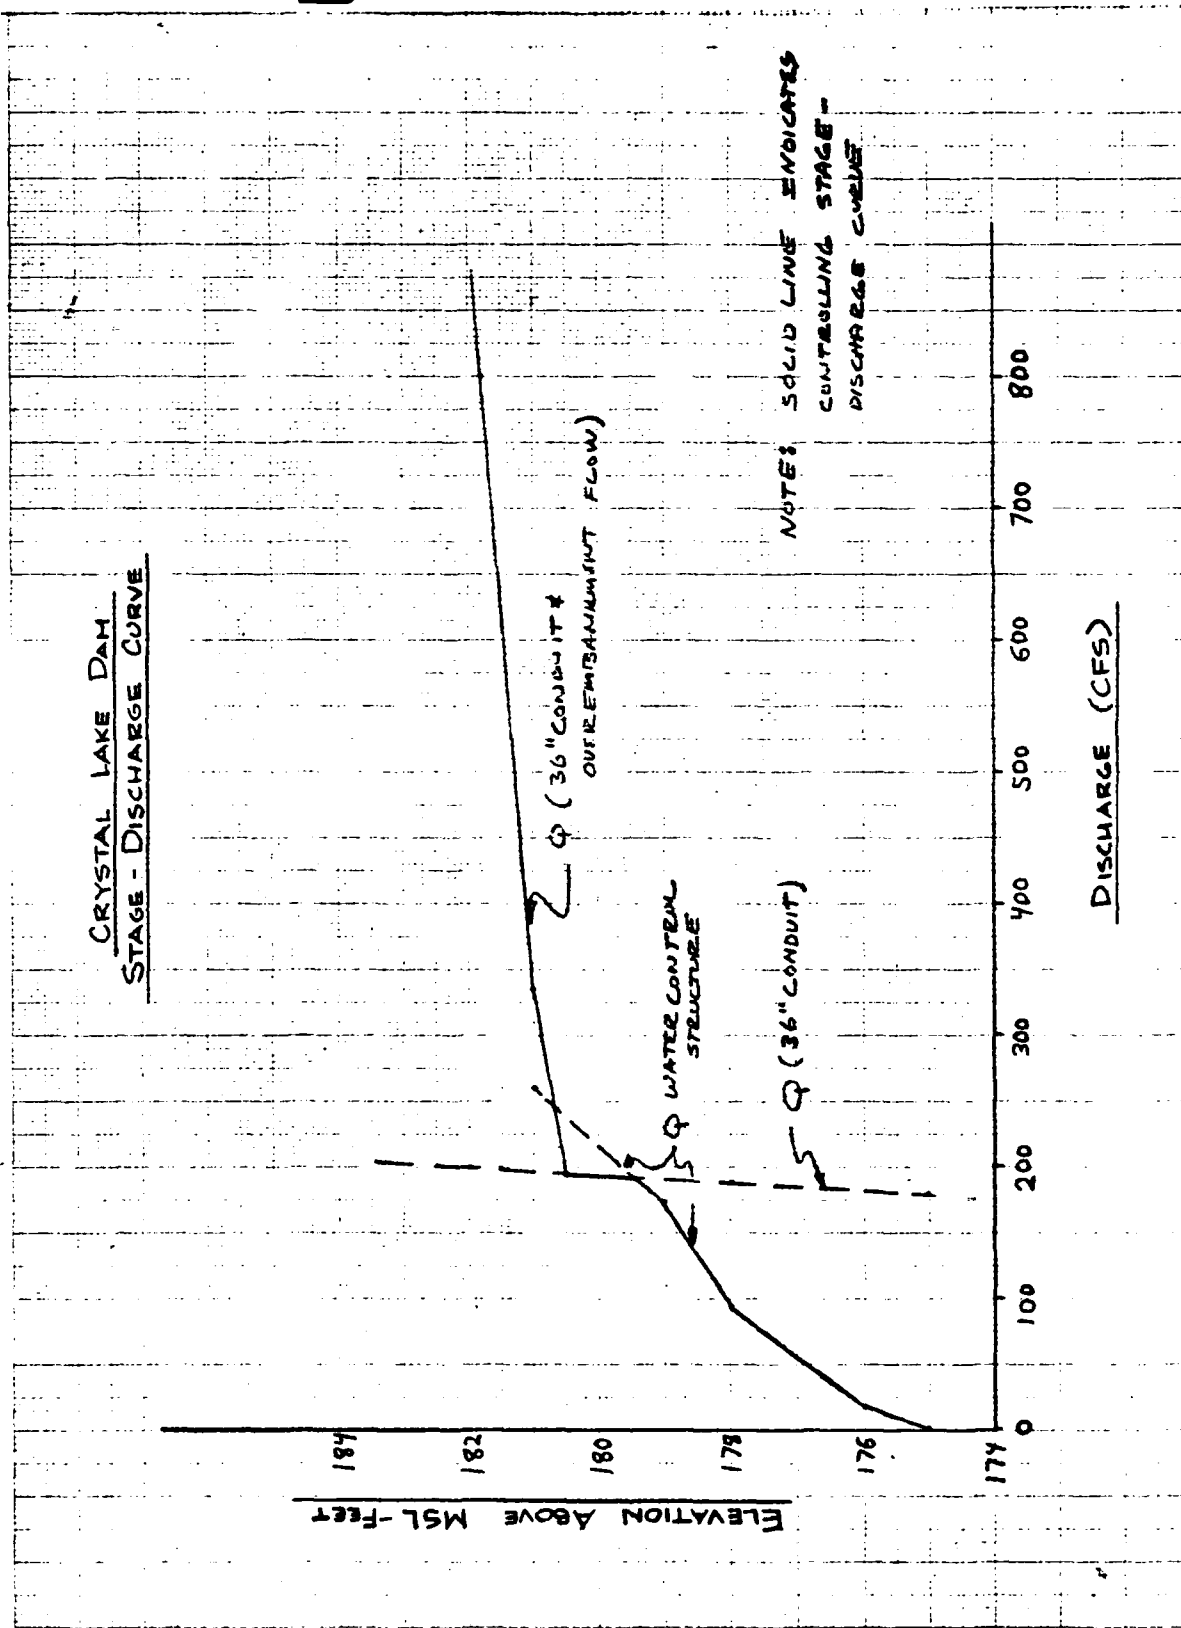

D-19

## FGA FLOOD WAVE ROUTING

APPROXIMATE FLOOD WAVE ROUTING BASED UPON U.S. ARMY CORPS  
OF ENGINEERS' "RULE OF THUMB GUIDANCE FOR ESTIMATING  
DOWNSTREAM DAM FAILURE HYDROGRAPHS" DATED APRIL, 1978.

INITIAL STATION = 0 +0  
INITIAL WAVE HEIGHT = 50.0 FT  
ASSUMED BREACH WIDTH = 28.0 FT  
INITIAL RESERVOIR STORAGE = 350 ACRE-FT  
COMPUTED FLOOD WAVE PEAK FLOW = 16,634 CFS

## STATION 1+60

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.080					
-450.0 FT	200.0 FT	-80.0 FT	190.0 FT	-10.0 FT	150.0 FT
-10.0 FT	149.0 FT				
N = 0.040					
-10.0 FT	149.0 FT	-5.0 FT	147.0 FT	5.0 FT	147.0 FT
10.0 FT	149.0 FT				
N = 0.080					
10.0 FT	149.0 FT	30.0 FT	150.0 FT	70.0 FT	170.0 FT
90.0 FT	180.0 FT	130.0 FT	190.0 FT	220.0 FT	200.0 FT

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
86.3 SF	21.0 FT	0.080	10.6 FPS	919CFS
248.6 SF	20.7 FT	0.040	43.4 FPS	10,811CFS
307.3 SF	42.2 FT	0.080	15.5 FPS	4,793CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
147.0 FT	12.9 FT	159.9 FT	642 SF	25.7 FPS	16,525 CFS	0.0500

# STATION 10 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-590.0 FT	160.0 FT	-460.0 FT	150.0 FT	-400.0 FT	140.0 FT
-280.0 FT	130.0 FT	-100.0 FT	120.0 FT	-60.0 FT	110.0 FT
-10.0 FT	107.0 FT	-5.0 FT	105.0 FT	5.0 FT	105.0 FT
10.0 FT	107.0 FT	300.0 FT	110.0 FT	590.0 FT	110.0 FT

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
1,224.8 SF	654.8 FT	0.040	12.6 FPS	15,446 CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
105.0 FT	5.9 FT	110.9 FT	1,224 SF	12.6 FPS	15,446 CFS	0.0500

# STATION 20 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-900.0 FT	130.0 FT	-600.0 FT	110.0 FT	-400.0 FT	100.0 FT
-170.0 FT	90.0 FT	-10.0 FT	88.0 FT	-5.0 FT	86.0 FT
5.0 FT	86.0 FT	10.0 FT	88.0 FT	700.0 FT	90.0 FT
800.0 FT	90.0 FT	1500.0 FT	90.0 FT	1900.0 FT	100.0 FT
2400.0 FT	110.0 FT	1700.0 FT	150.0 FT		

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
2,182.8 SF	1717.7 FT	0.040	6.0 FPS	13,114 CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
86.0 FT	4.7 FT	90.7 FT	2,182 SF	6.0 FPS	13,114 CFS	0.0190

# STATION 33 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-1280.0 FT	130.0 FT	-920.0 FT	110.0 FT	-820.0 FT	100.0 FT
-510.0 FT	90.0 FT	-100.0 FT	80.0 FT	-10.0 FT	80.0 FT
-5.0 FT	78.0 FT	5.0 FT	78.0 FT	10.0 FT	80.0 FT
200.0 FT	80.0 FT	1080.0 FT	80.0 FT	1370.0 FT	90.0 FT
1850.0 FT	100.0 FT	2000.0 FT	110.0 FT		

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
2,390.1 SF	1313.3 FT	0.040	4.2 FPS	10,252 CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
78.0 FT	3.8 FT	81.8 FT	2,390 SF	4.2 FPS	10,252 CFS	0.0060



# STATION 51 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-1100.0 FT	150.0 FT	-780.0 FT	110.0 FT	-490.0 FT	100.0 FT
-370.0 FT	80.0 FT	-10.0 FT	77.0 FT	-5.0 FT	75.0 FT
5.0 FT	75.0 FT	10.0 FT	77.0 FT	350.0 FT	80.0 FT
530.0 FT	100.0 FT				

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
2,170.1 SF	742.1 FT	0.040	3.3 FPS	7,372 CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
75.0 FT	6.4 FT	81.4 FT	2,170 SF	3.3 FPS	7,372 CFS	0.0020

# STATION 67 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-800.0 FT	120.0 FT	-400.0 FT	100.0 FT	-100.0 FT	90.0 FT
-80.0 FT	80.0 FT	-30.0 FT	73.0 FT	30.0 FT	73.0 FT
50.0 FT	80.0 FT	150.0 FT	100.0 FT	400.0 FT	120.0 FT

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
1,329.4 SF	165.0 FT	0.040	4.7 FPS	6,275CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
73.0 FT	11.5 FT	84.5 FT	1,329 SF	4.7 FPS	6,275 CFS	0.0010

# STATION 78 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-1100.0 FT	150.0 FT	-600.0 FT	100.0 FT	-420.0 FT	90.0 FT
-170.0 FT	80.0 FT	-10.0 FT	72.0 FT	-5.0 FT	70.0 FT
5.0 FT	70.0 FT	10.0 FT	72.0 FT	330.0 FT	90.0 FT
600.0 FT	100.0 FT	850.0 FT	120.0 FT		

AREA	WETTED PERIMETER	N	VELOCITY	FLOW
1,311.4 SF	312.9 FT	0.040	4.3 FPS	5,662 CFS


INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
70.0 FT	9.7 FT	79.7 FT	1,311 SF	4.3 FPS	5,662 CFS	0.0020

# STATION 98 +0

OFFSET	ELEV.	OFFSET	ELEV.	OFFSET	ELEV.
N = 0.040					
-450.0 FT	60.0 FT	-300.0 FT	50.0 FT	-90.0 FT	40.0 FT
-10.0 FT	17.0 FT	-5.0 FT	15.0 FT	5.0 FT	15.0 FT
10.0 FT	17.0 FT	250.0 FT	50.0 FT	350.0 FT	60.0 FT


AREA	WETTED PERIMETER	N	VELOCITY	FLOW
377.0 SF	90.7 FT	0.040	14.2 FPS	5,368 CFS

INVERT	DEPTH	W. SURFACE	AREA	VELOCITY	FLOW	SLOPE
15.0 FT	8.3 FT	23.3 FT	377 SF	14.2 FPS	5,368 CFS	0.0220

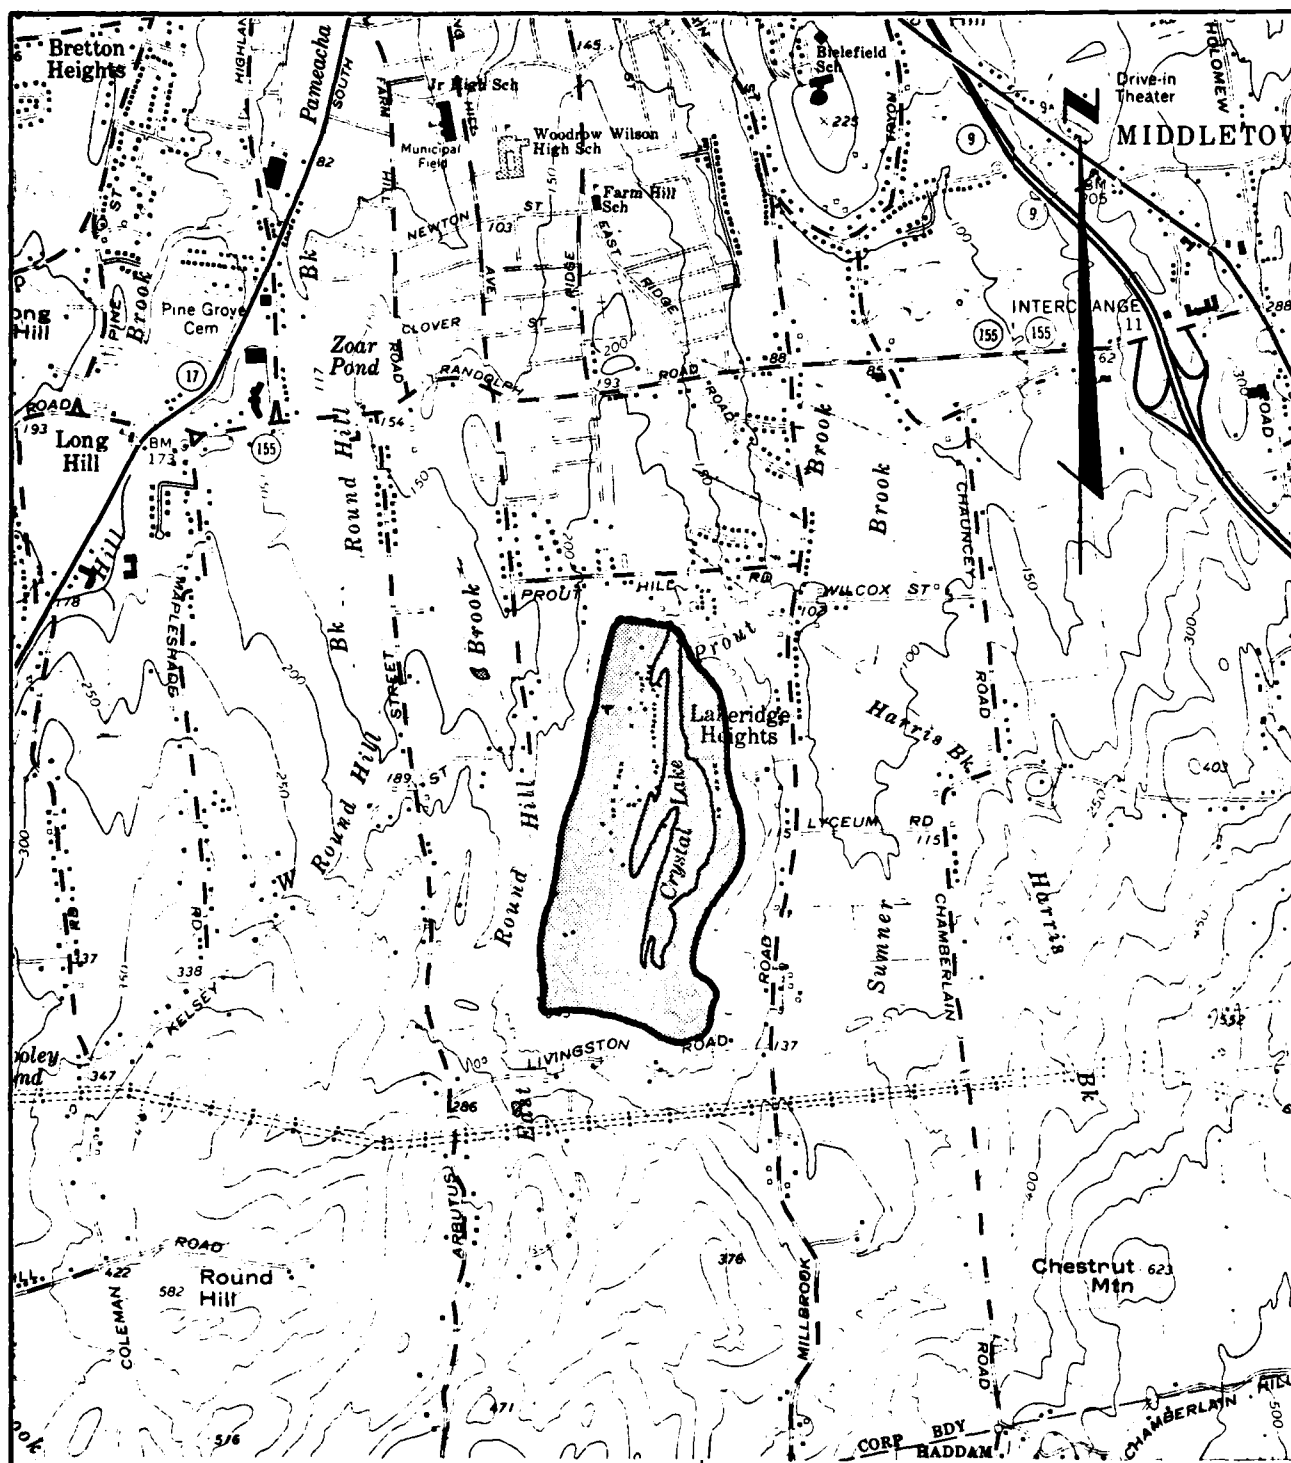

# CRYSTAL LAKE DAM DRAINAGE MAP

MIDDLETOWN, CONNECTICUT

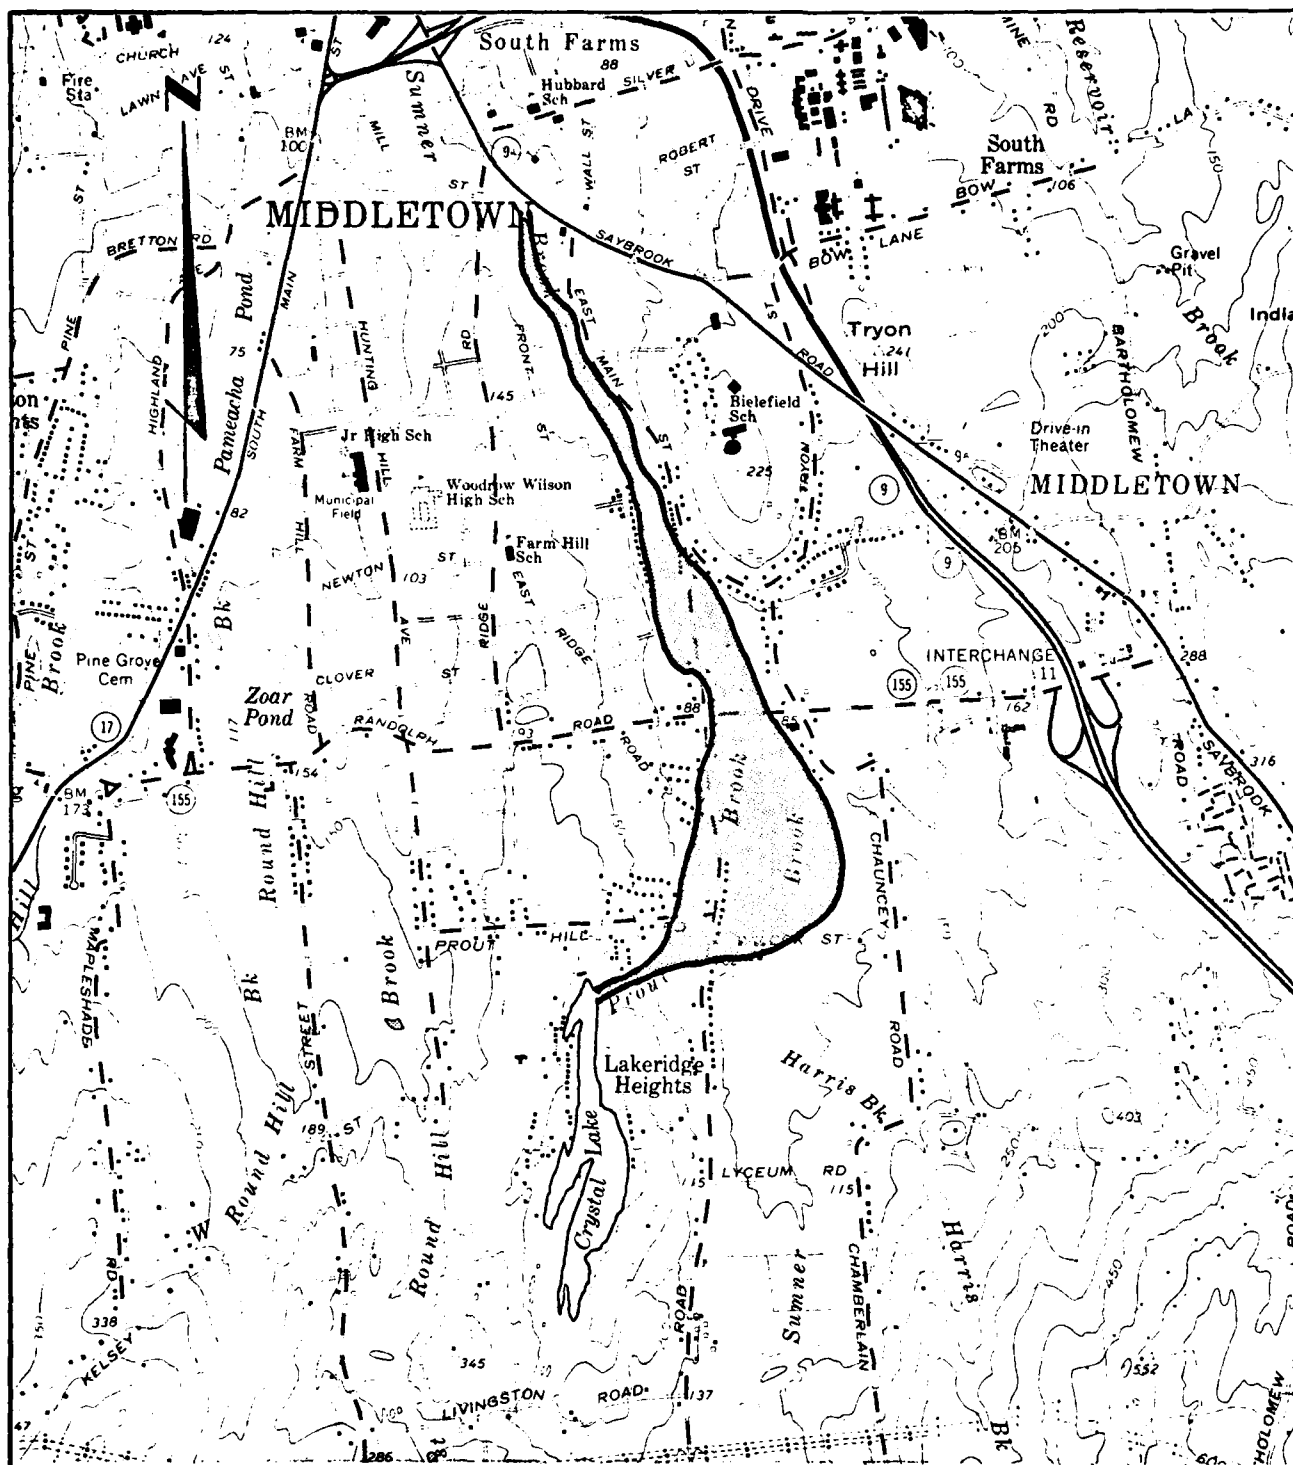

SCALE IN FEET  
2000 1000 0 2000

# CRYSTAL LAKE DAM DAM FAILURE ANALYSIS

## IMPACT AREAS

MIDDLETOWN, CONNECTICUT

FLAHERTY • GIAVARA ASSOCIATES, P.C.

D-29

APPENDIX E

INFORMATION AS CONTAINED IN THE  
NATIONAL INVENTORY OF DAMS



## INVENTORY OF DAMS IN THE UNITED STATES

IDENTITY NUMBER	STATE	DIVISION	COUNTY	CORNER	NAME	LATITUDE (NORTH)	LONGITUDE (WEST)	REPORT DATE
CT 130	NED	CT 007	02		CRYSTAL LAKE DAM	4131.3	7230.3	16 JAN 60

POPULAR NAME	NAME OF IMPONDMENT
	CRYSTAL LAKE

REGION	RIVER OR STREAM	NEAREST DOWNSTREAM CITY - TOWN - VILLAGE	DIST FROM DAM (MI.)	POPULATION
01 00	PHOUT BROOK	MIDDLETOWN	2	36100

TYPE OF DAM	YEAR COMPLETED	PURPOSES	STRUCTURAL HEIGHT (FT.)	HYDRAULIC HEIGHT (FT.)	IMPONDING CAPACITIES (ACRES)	MAXIMUM	NORMAL
REERFC	1966	R	50	45	350	154	

DIST OWN FED R PRV/FED SCS A VER/DATE  
N N N N N

REMARKS
20-ESTIMATE 22-REBUILT

D/S HAS. 1965	SPILLWAY TYPE	MAXIMUM DISCHARGE (FT.)	VOLUME OF DAM (CY)	POWER CAPACITY (KW)	INSTALLED	PROPOSED	NO	LENGTH	WIDTH	DEPTH	WHEELS	WHEELS	WHEELS
1	130 U	180											


OWNER	ENGINEERING BY	CONSTRUCTION BY
CONN DEP ENVIR PROTECT	ONDERDONK AND LATHROP	

DESIGN	CONSTRUCTION	OPERATION	MAINTENANCE
		CONN DEP	CONN DEP


INSPECTION BY	INSPECTION DATE	AUTHORITY FOR INSPECTION
FLAMERTY GIAVARA ASSOCIATES	01 OCT 79	PL 92-367

REMARKS





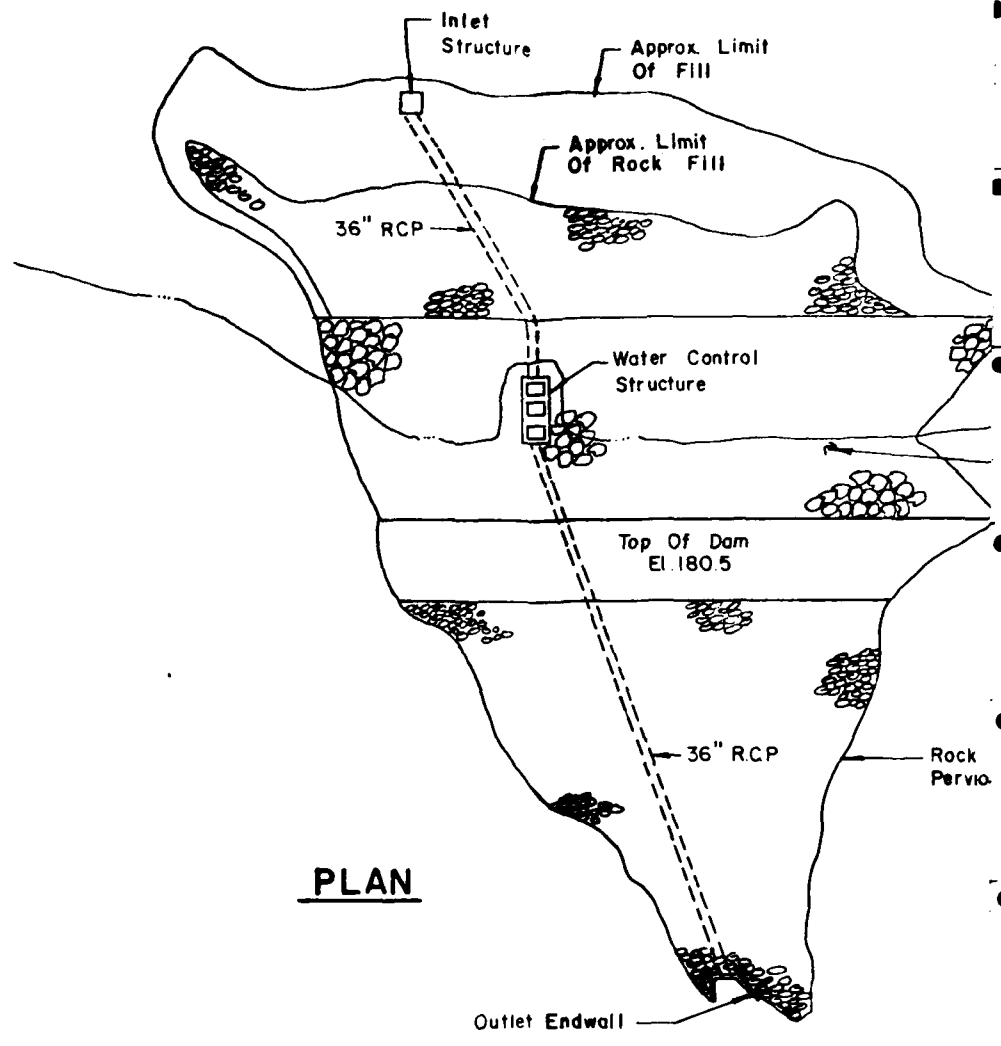

PLAN

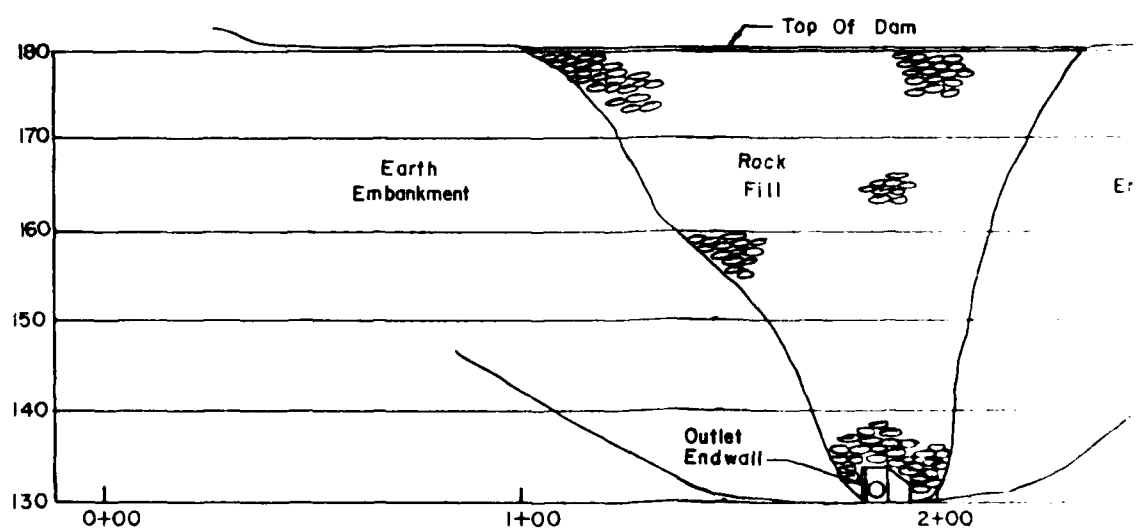


DOWNSTREAM ELEVATION OF D.

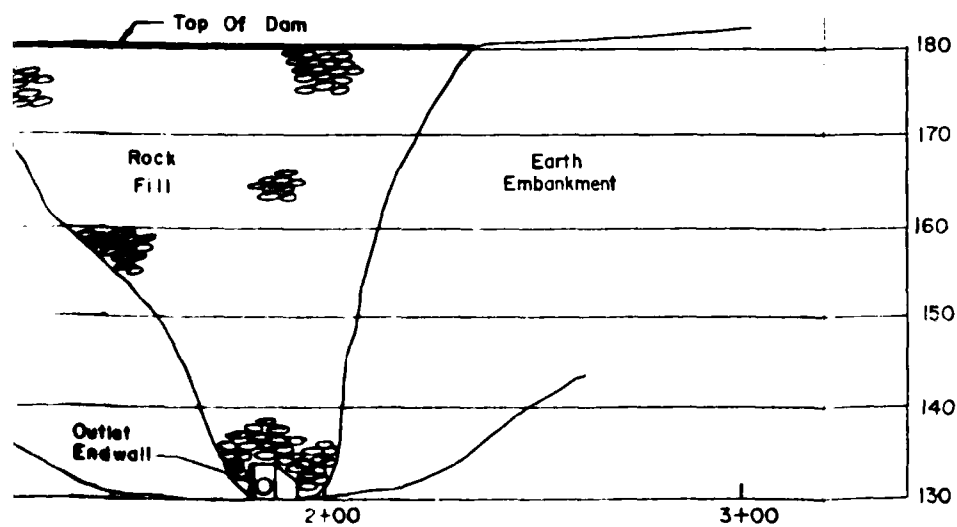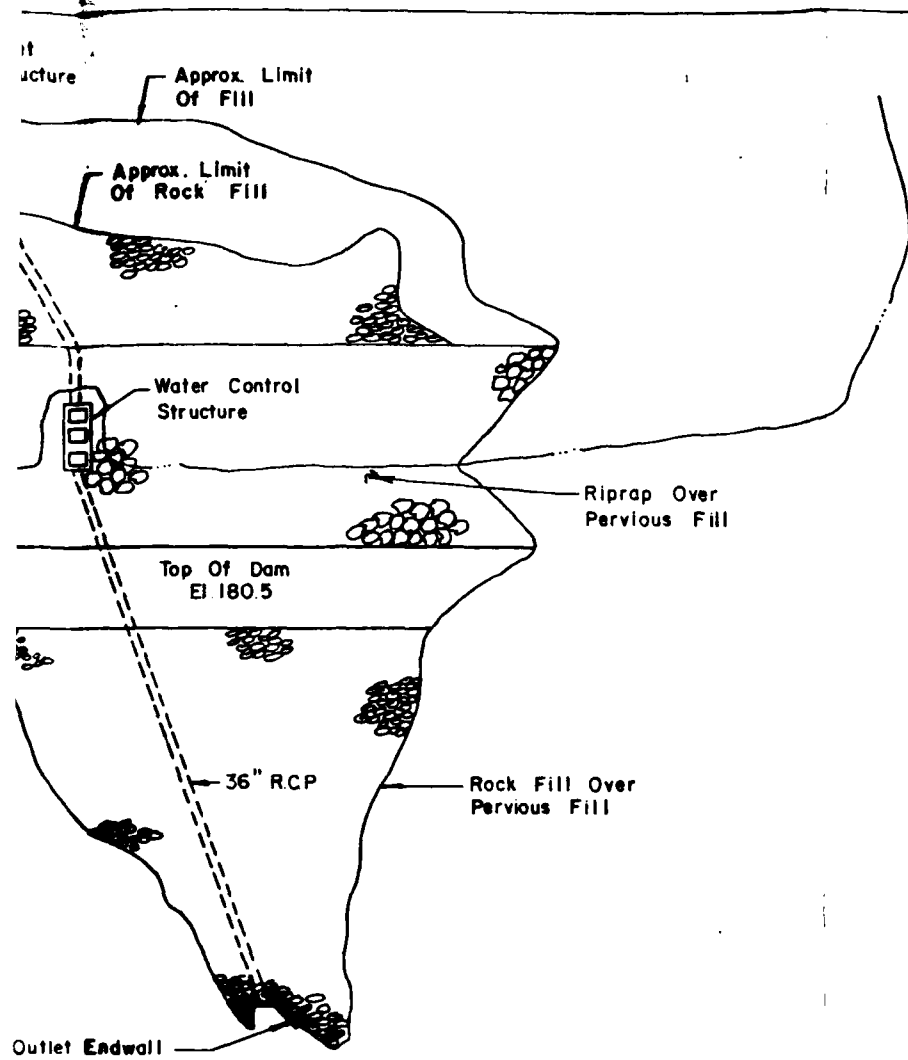


STREAM ELEVATION OF DAM

CRYSTAL LAKE DAM

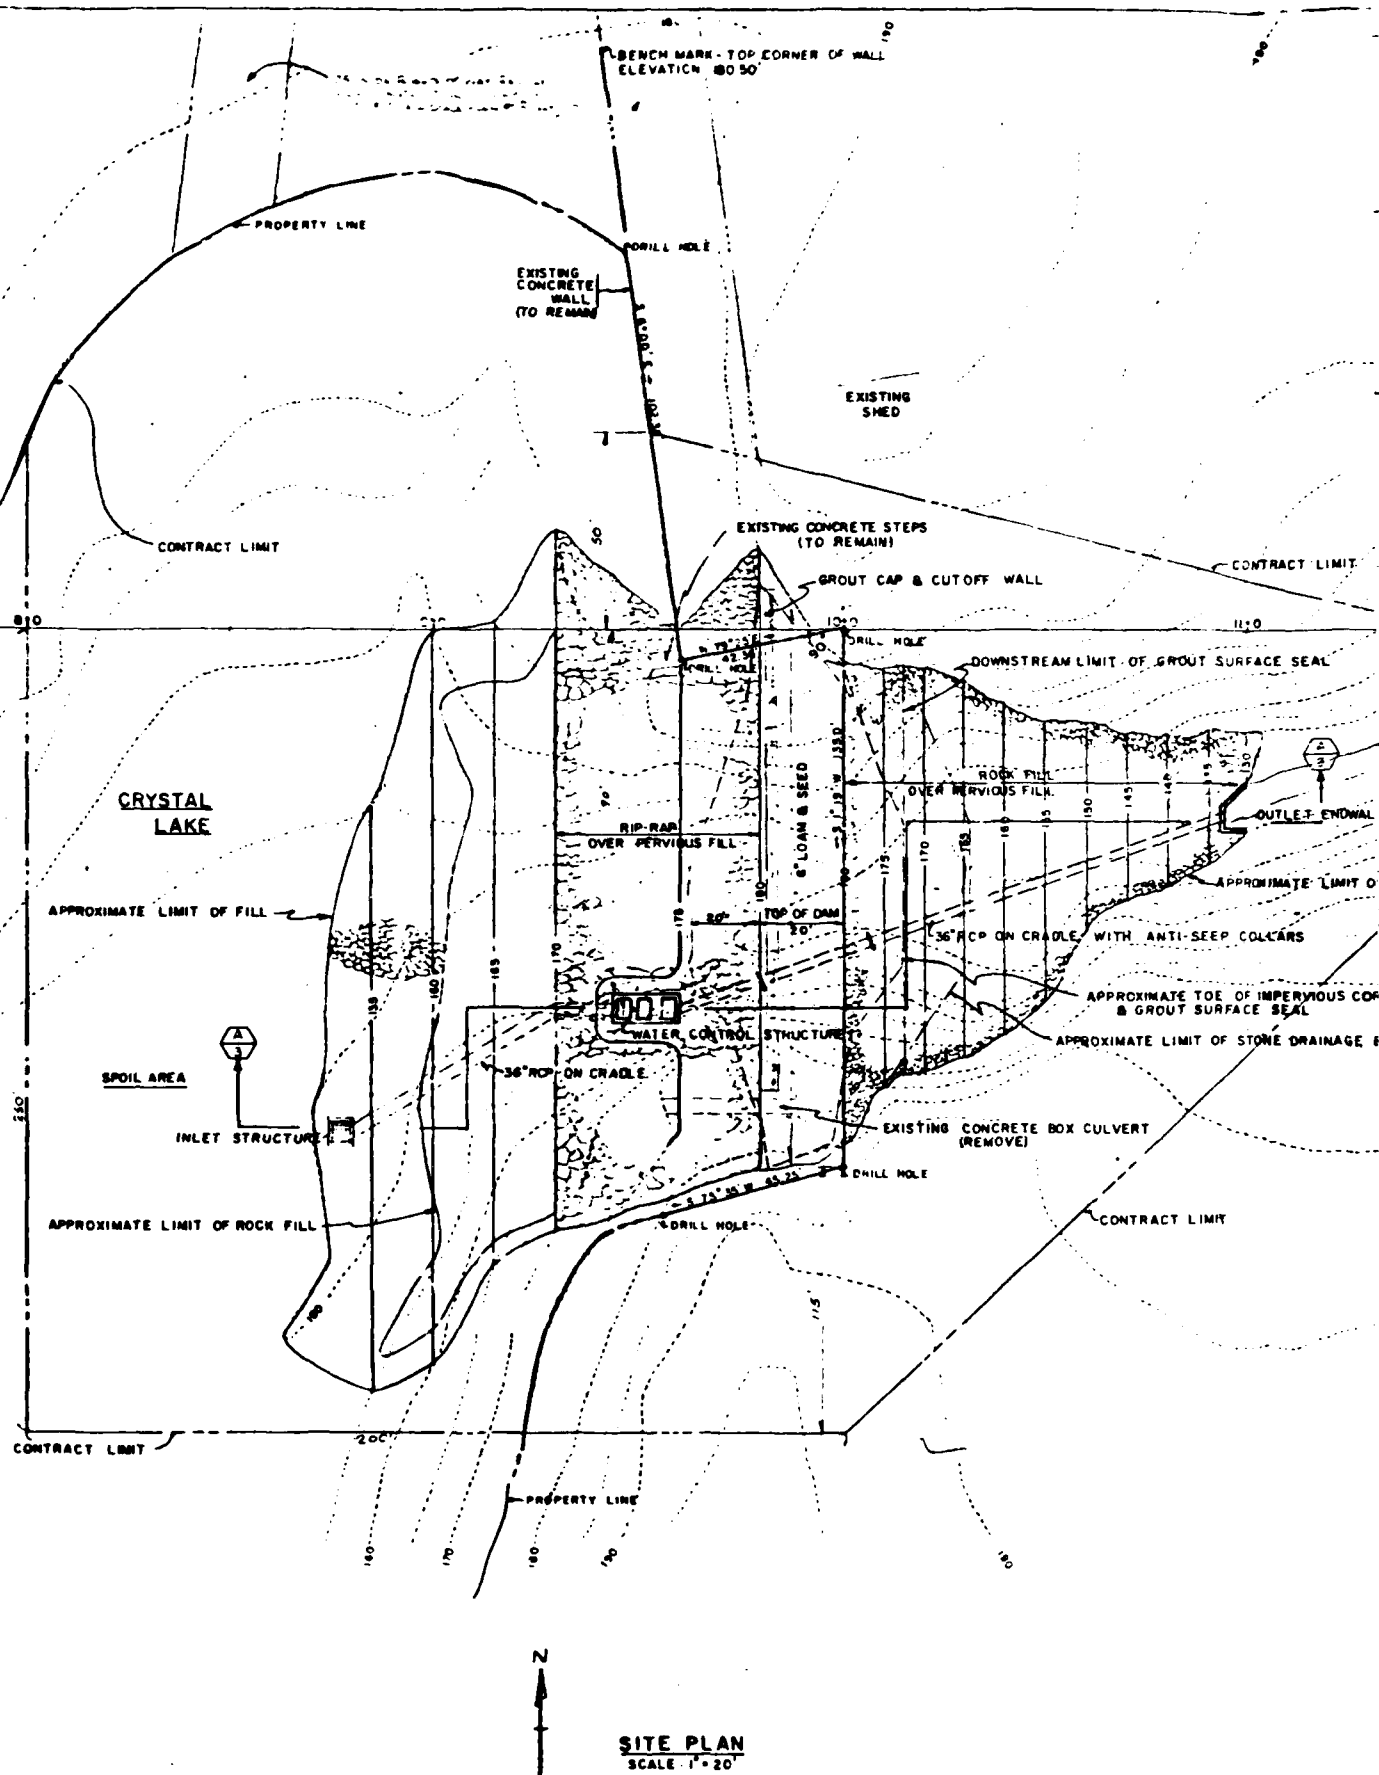


# DESIGN DATA

DRAINAGE AREA	200 ACRES
LAKE AREA	33 ACRES
DAM ELEVATION	180.0 FT.
SPILLWAY ELEVATION	175.0 FT.
STOP LOG CONTROL TO ELEVATION	188.0 FT.
MAXIMUM DRAWDOWN ELEVATION	188.0 FT.
DESIGN STORM RAINFALL	4 IN/HR
LAKE STORAGE (100% RUNOFF) AT ELEVATION 172.0	4 IN. RAINFALL
TIME OF CONCENTRATION	84 MIN.
DESIGN RUNOFF COEFFICIENT	0.33
SPILLWAY WIDTH	8 FT.
DISCHARGE AT 2' HEAD	55 CFS
DISCHARGE WITH GATES OPENED AT 25' HEAD	100 CFS

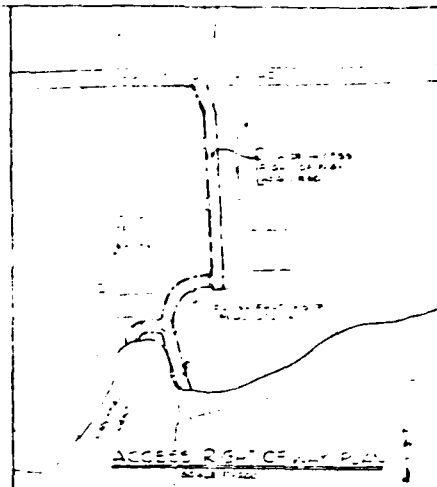

## NOTE

PLANS BASED ON MAP ENTITLED "CONTOUR PLAN OF PORTION OF CRYSTAL LAKE MIDDLETOWN, CONN. PROJECT NO. 81-88-53, DATED DECEMBER, 1962, SCALE 1\"/>

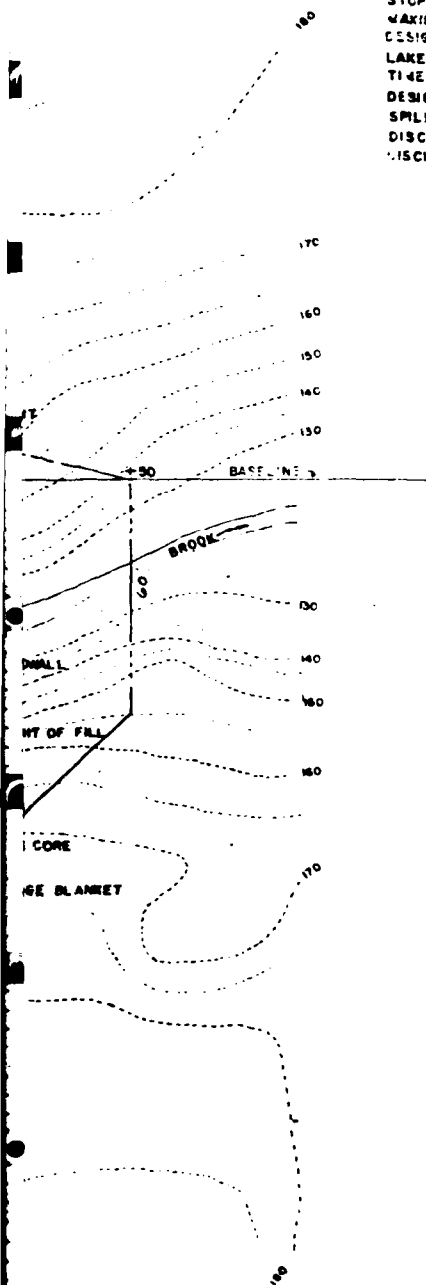

REDUCED NOT TO SCALE

## SITE PLAN

STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY, JR., COMMISSIONER	
DRAWN BY S.M.	PROJECT NO. B. 81-88-53
CHECKED S.M.	DATE 12-1-62
CONSTRUCTION OF DAM CRYSTAL LAKE MIDDLETOWN CONNECTICUT	
PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS GLASTONBURY CONNECTICUT	
DATE AS NOTED	DATE 12-1-62

REVISIONS		
NO.	DESCRIPTION	DATE



2

# BOHRING - 1 EL 117

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 2 EL 118

15	RED BROWN SAND & SILT	100	150
20	END OF HOLE 150		
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 3 EL 119

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 4 EL 120

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 6 EL 125

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 7 EL 126

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 8 EL 127

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

# BOHRING - 9 EL 128

10	RED BROWN SAND & SILT	100	150
15	END OF HOLE 150		
20			
25			
30			
35			
40			
45			
50			
55			
60			
65			
70			
75			
80			
85			
90			
95			
100			

BOHRING LOGS  
SCALE 1" = 10'

# ING - 4 11.10.6

1	10
2	20
3	30
4	40
5	50
6	60
7	70
8	80
9	90
10	100
11	110
12	120
13	130
14	140
15	150
16	160
17	170
18	180
19	190
20	200
21	210
22	220
23	230
24	240
25	250
26	260
27	270
28	280
29	290
30	300
31	310
32	320
33	330
34	340
35	350
36	360
37	370
38	380
39	390
40	400
41	410
42	420
43	430
44	440
45	450
46	460
47	470
48	480
49	490
50	500
51	510
52	520
53	530
54	540
55	550
56	560
57	570
58	580
59	590
60	600
61	610
62	620
63	630
64	640
65	650
66	660
67	670
68	680
69	690
70	700
71	710
72	720
73	730
74	740
75	750
76	760
77	770
78	780
79	790
80	800
81	810
82	820
83	830
84	840
85	850
86	860
87	870
88	880
89	890
90	900
91	910
92	920
93	930
94	940
95	950
96	960
97	970
98	980
99	990
100	1000

# BORING - 5 11.10.6

1	10
2	20
3	30
4	40
5	50
6	60
7	70
8	80
9	90
10	100
11	110
12	120
13	130
14	140
15	150
16	160
17	170
18	180
19	190
20	200
21	210
22	220
23	230
24	240
25	250
26	260
27	270
28	280
29	290
30	300
31	310
32	320
33	330
34	340
35	350
36	360
37	370
38	380
39	390
40	400
41	410
42	420
43	430
44	440
45	450
46	460
47	470
48	480
49	490
50	500
51	510
52	520
53	530
54	540
55	550
56	560
57	570
58	580
59	590
60	600
61	610
62	620
63	630
64	640
65	650
66	660
67	670
68	680
69	690
70	700
71	710
72	720
73	730
74	740
75	750
76	760
77	770
78	780
79	790
80	800
81	810
82	820
83	830
84	840
85	850
86	860
87	870
88	880
89	890
90	900
91	910
92	920
93	930
94	940
95	950
96	960
97	970
98	980
99	990
100	1000

# BORING - 24 11.10.6


1	10
2	20
3	30
4	40
5	50
6	60
7	70
8	80
9	90
10	100
11	110
12	120
13	130
14	140
15	150
16	160
17	170
18	180
19	190
20	200
21	210
22	220
23	230
24	240
25	250
26	260
27	270
28	280
29	290
30	300
31	310
32	320
33	330
34	340
35	350
36	360
37	370
38	380
39	390
40	400
41	410
42	420
43	430
44	440
45	450
46	460
47	470
48	480
49	490
50	500
51	510
52	520
53	530
54	540
55	550
56	560
57	570
58	580
59	590
60	600
61	610
62	620
63	630
64	640
65	650
66	660
67	670
68	680
69	690
70	700
71	710
72	720
73	730
74	740
75	750
76	760
77	770
78	780
79	790
80	800
81	810
82	820
83	830
84	840
85	850
86	860
87	870
88	880
89	890
90	900
91	910
92	920
93	930
94	940
95	950
96	960
97	970
98	980
99	990
100	1000

# ING - 9 11.10.6

1	10
2	20
3	30
4	40
5	50
6	60
7	70
8	80
9	90
10	100
11	110
12	120
13	130
14	140
15	150
16	160
17	170
18	180
19	190
20	200
21	210
22	220
23	230
24	240
25	250
26	260
27	270
28	280
29	290
30	300
31	310
32	320
33	330
34	340
35	350
36	360
37	370
38	380
39	390
40	400
41	410
42	420
43	430
44	440
45	450
46	460
47	470
48	480
49	490
50	500
51	510
52	520
53	530
54	540
55	550
56	560
57	570
58	580
59	590
60	600
61	610
62	620
63	630
64	640
65	650
66	660
67	670
68	680
69	690
70	700
71	710
72	720
73	730
74	740
75	750
76	760
77	770
78	780
79	790
80	800
81	810
82	820
83	830
84	840
85	850
86	860
87	870
88	880
89	890
90	900
91	910
92	920
93	930
94	940
95	950
96	960
97	970
98	980
99	990
100	1000

# BORING - 10 11.10.6

1	10
2	20
3	30
4	40
5	50
6	60
7	70
8	80
9	90
10	100
11	110
12	120
13	130
14	140
15	150
16	160
17	170
18	180
19	190
20	200
21	210
22	220
23	230
24	240
25	250
26	260
27	270
28	280
29	290
30	300
31	310
32	320
33	330
34	340
35	350
36	360
37	370
38	380
39	390
40	400
41	410
42	420
43	430
44	440
45	450
46	460
47	470
48	480
49	490
50	500
51	510
52	520
53	530
54	540
55	550
56	560
57	570
58	580
59	590
60	600
61	610
62	620
63	630
64	640
65	650
66	660
67	670
68	680
69	690
70	700
71	710
72	720
73	730
74	740
75	750
76	760
77	770
78	780
79	790
80	800
81	810
82	820
83	830
84	840
85	850
86	860
87	870
88	880
89	890
90	900
91	910
92	920
93	930
94	940
95	950
96	960
97	970
98	980
99	990
100	1000

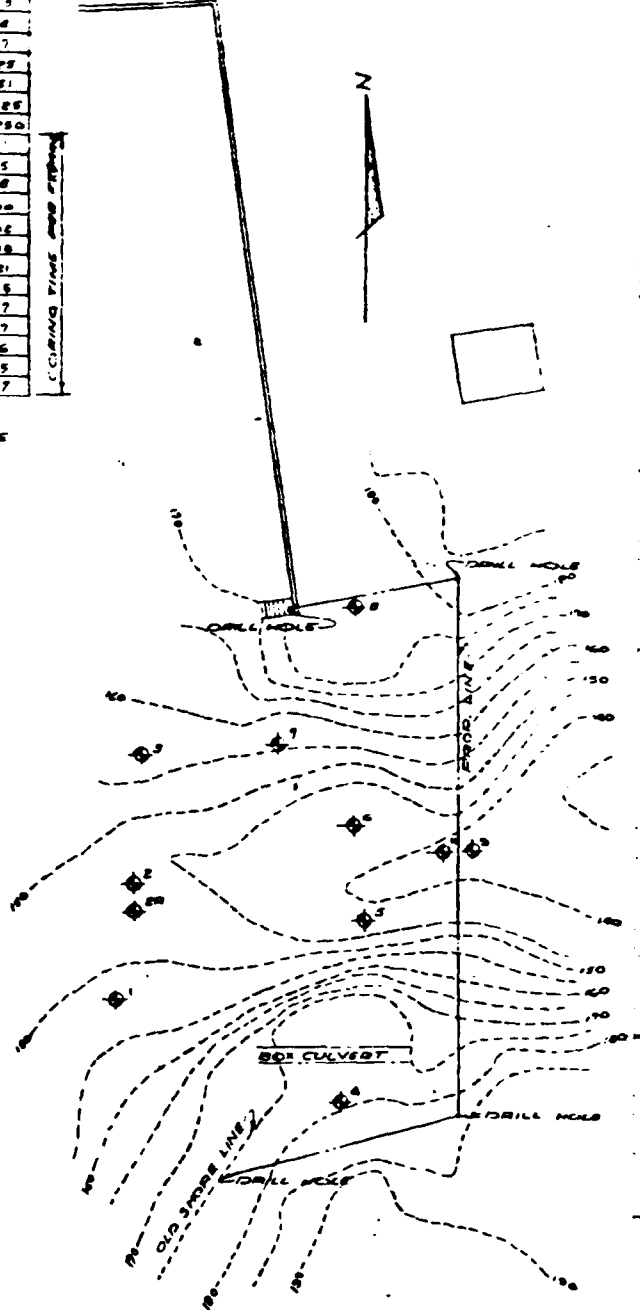


LOCATION PLAN  
SCALE 1" = 50'


## NOTE

1. ALL BORING DONE WITH SERIES 300
2. DOUBLE TUBE CORE BRACK.
3. COLUMN AT EXTREME RIGHT OF LOGS INDICATES ROCK CORING TIME IN MIN. PER FT.
4. ADJACENT COLUMN TO THE LEFT INDICATES BLOW'S PER FOOT ON 2" PLAT SPONG SAMPLES.
5. COLUMN AT EXTREME LEFT OF LOGS INDICATES STRATA CHANGE.
6. BORING INCHARGE: CH. FURNACE BY ENGINEERING SERVICES INC., C. STONBURY, CONN., MARCH, 1963.

REVISIONS		
NO	DESCRIPTION	DATE

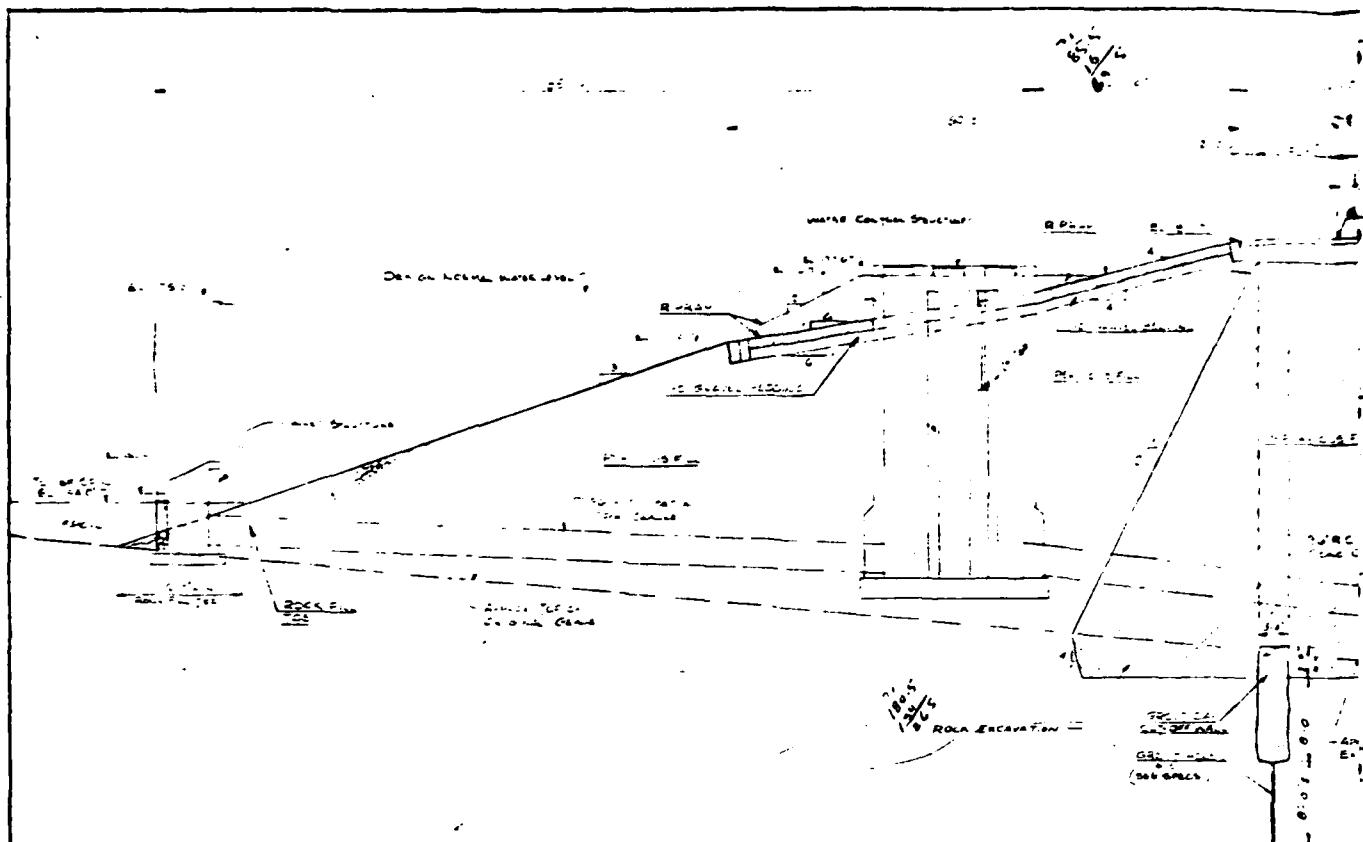


**SECTION 1TH**  
SCALE: 1/8" = 1'

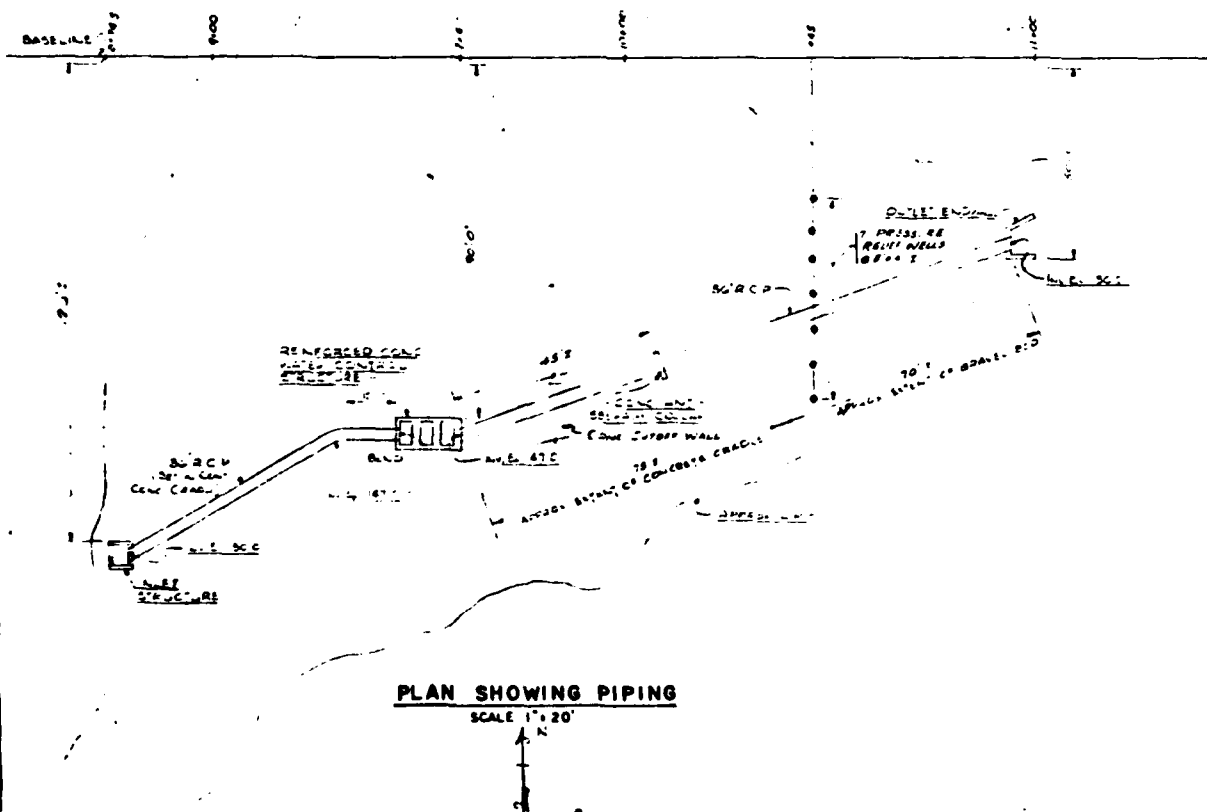

**PLAN SHOWING PIPING**  
SCALE: 1" = 20'

Top of Dam, Sta 9+40

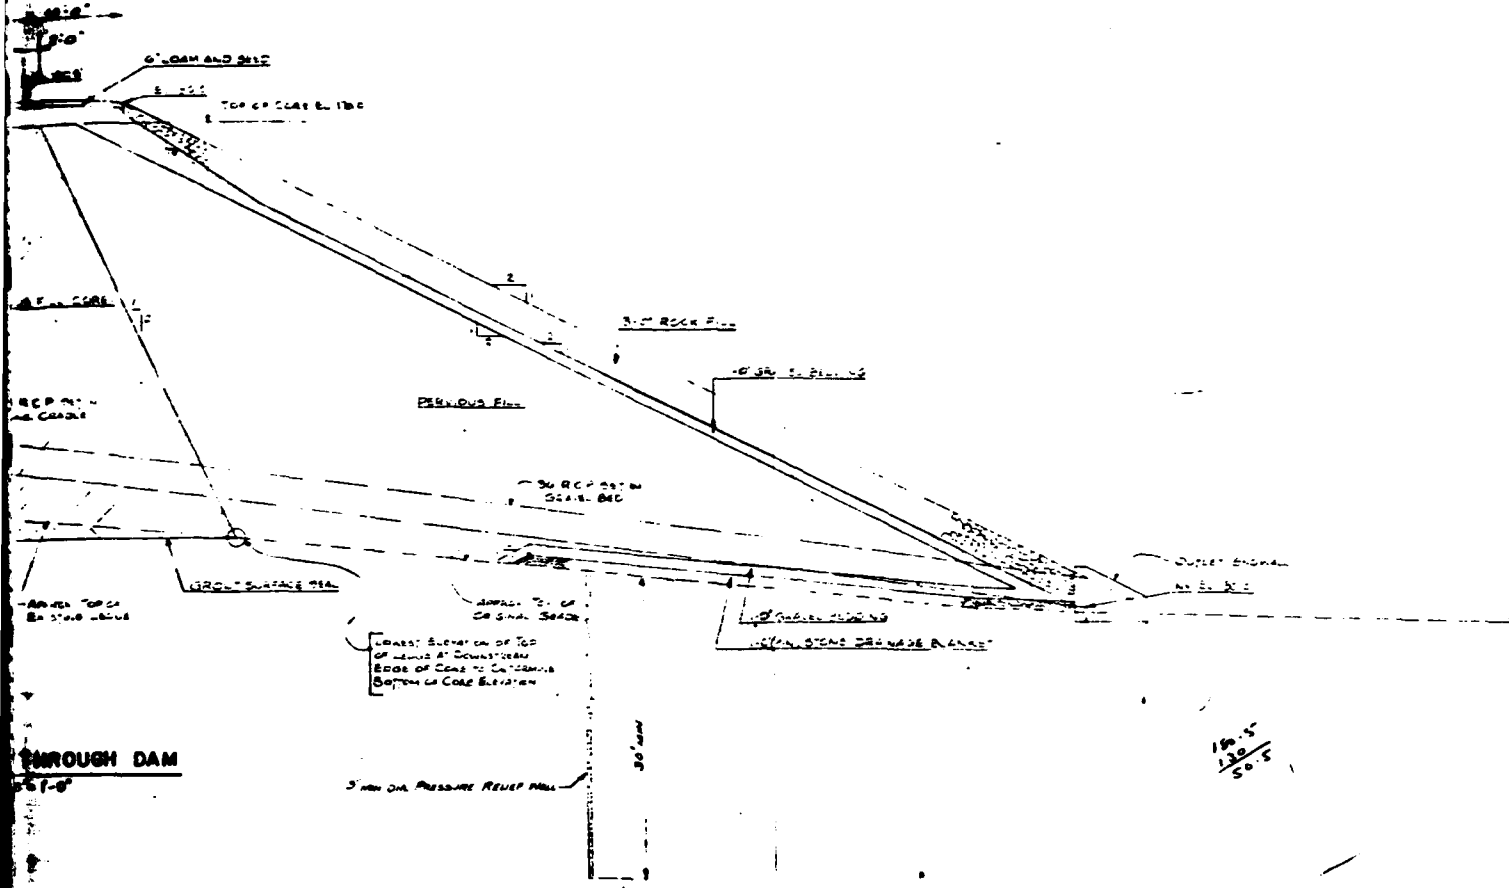


THROUGH DAM  
Sta 9+0

REDUCED NOT TO SCALE  
DAM SECTION & PIPING

REVISIONS		
NO	DESCRIPTION	DATE

STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY, JR., COMMISSIONER			
DRAWN BY R.A.G. CHECKED R.P.L. APPROVED A.S.O.	CONSTRUCTION OF DAM CRYSTAL LAKE MIDDLETOWN CONNECTICUT	PROJECT NO. BI 88-53 SHEET NO. 3	PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS GLASTONBURY CONNECTICUT DATE 10 SEP 1953



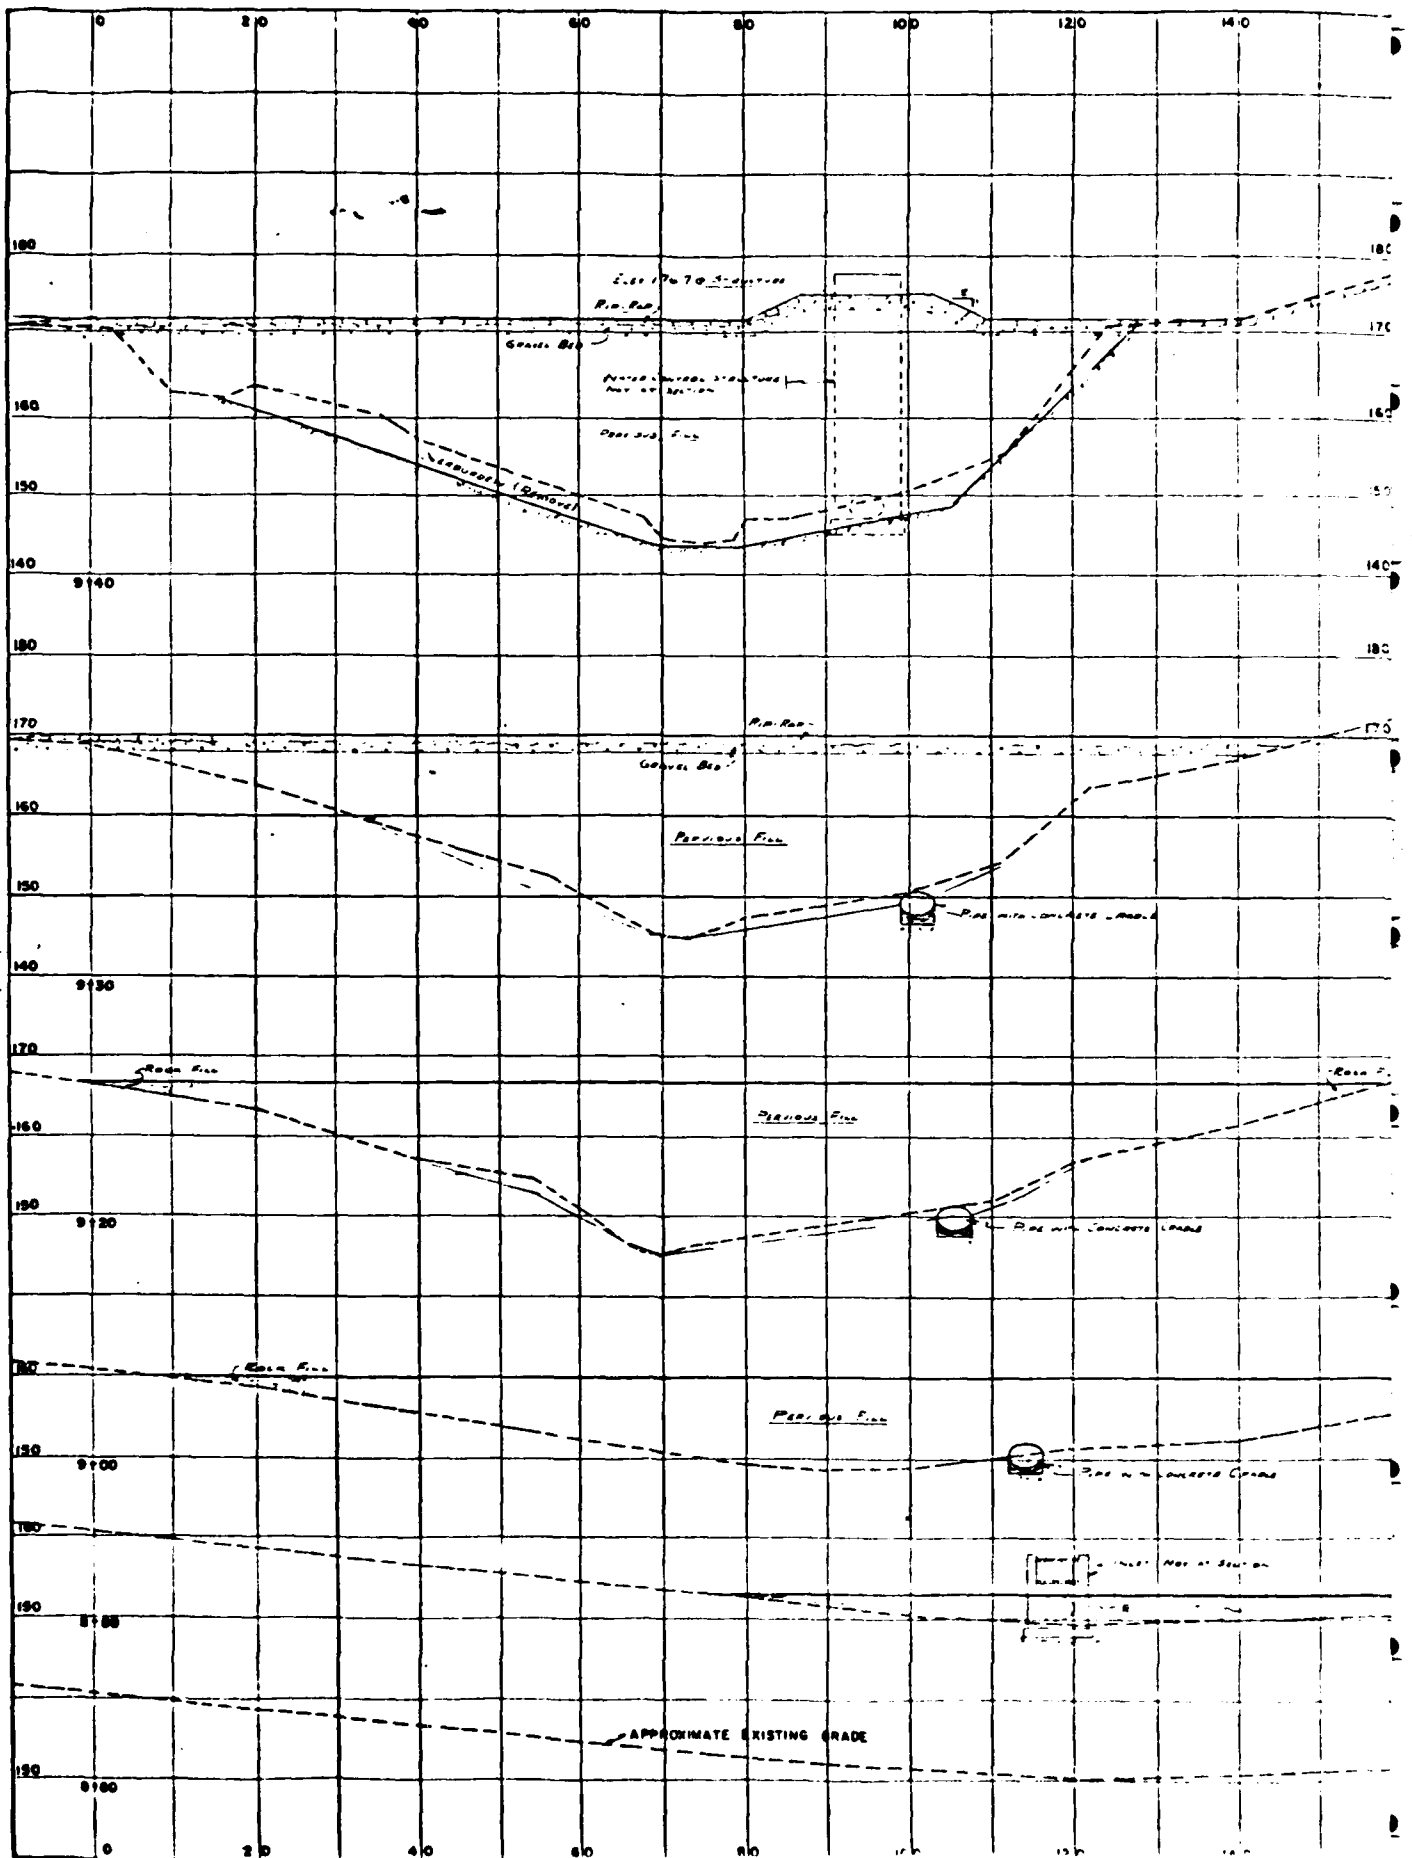

# SECTION SHOWING GROUT CAP & CUTOFF WALL

MINIMUM LENGTH OF PRESSURE GROUTING

9+80  
NOTE PRESSURE GROUTING AT THIS STATION; SEE SPECIFICATIONS

APPROXIMATE LEDGE

36" PIPE ON CONCRETE CRADLE

REDUCED NOT TO SCALE  
CROSS-SECTIONS 8+60 TO 9+80

STATE OF CONNECTICUT  
PUBLIC WORKS DEPARTMENT  
T. J. MURPHY JR. COMMISSIONER

CONSTRUCTION OF DAM  
CRYSTAL LAKE  
MIDDLETOWN CONNECTICUT

PLANS PREPARED BY  
ONDERDONK AND LATHROP  
CONSULTING ENGINEERS  
BLASTONBURY CONNECTICUT


DRAWN BY  
CHECKED  
BY  
APPROVED  
4.8.0


PROJECT NO.  
81-88-53  
SHEET NO.  
4

REVISIONS	DATE
DESCRIPTION	



SCALE 1"=10'  
DATE 5-1-53

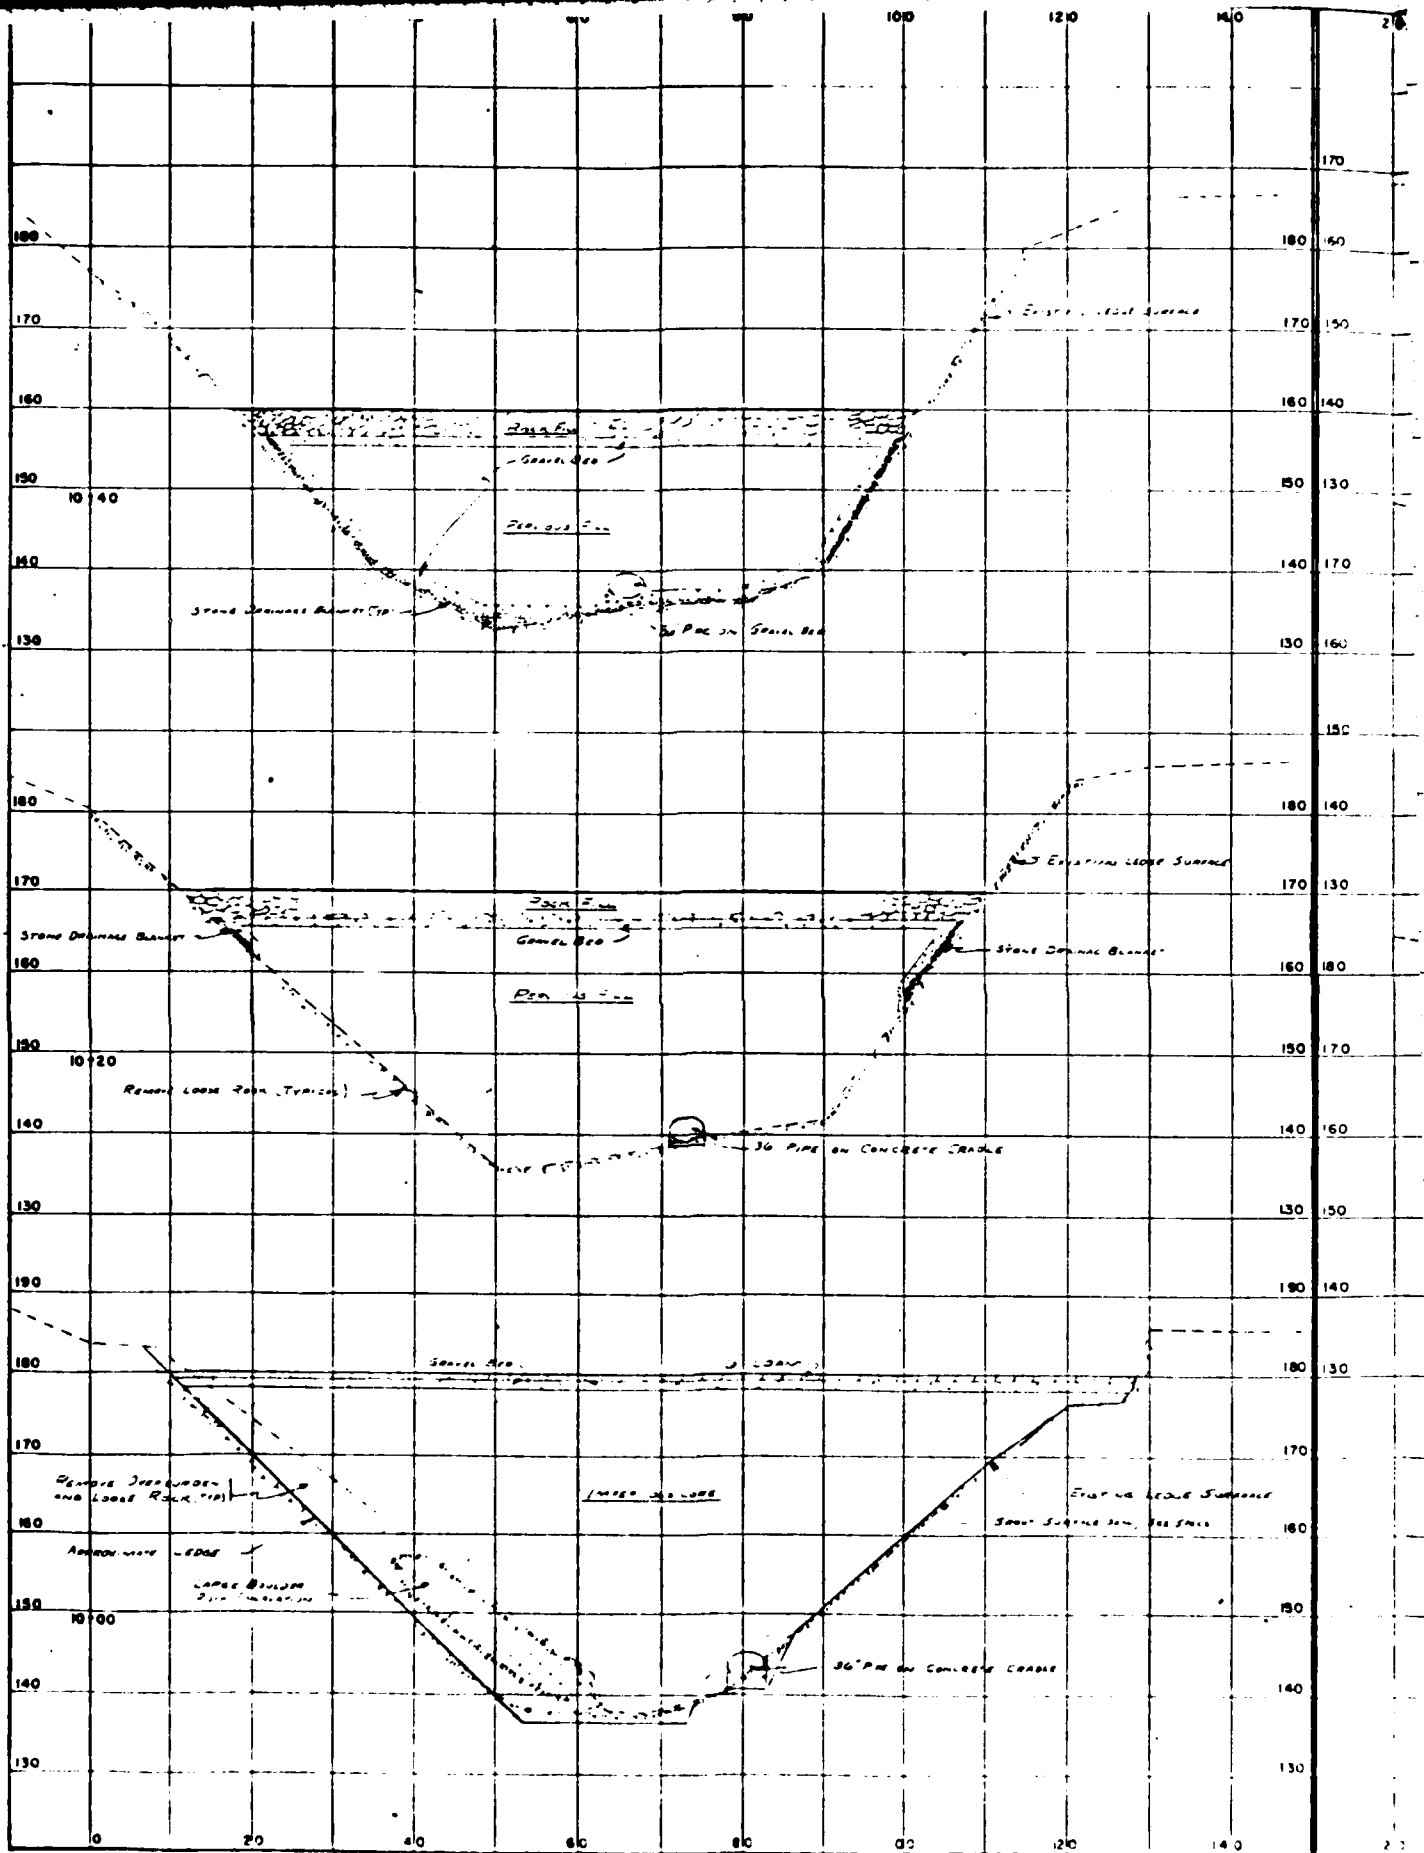

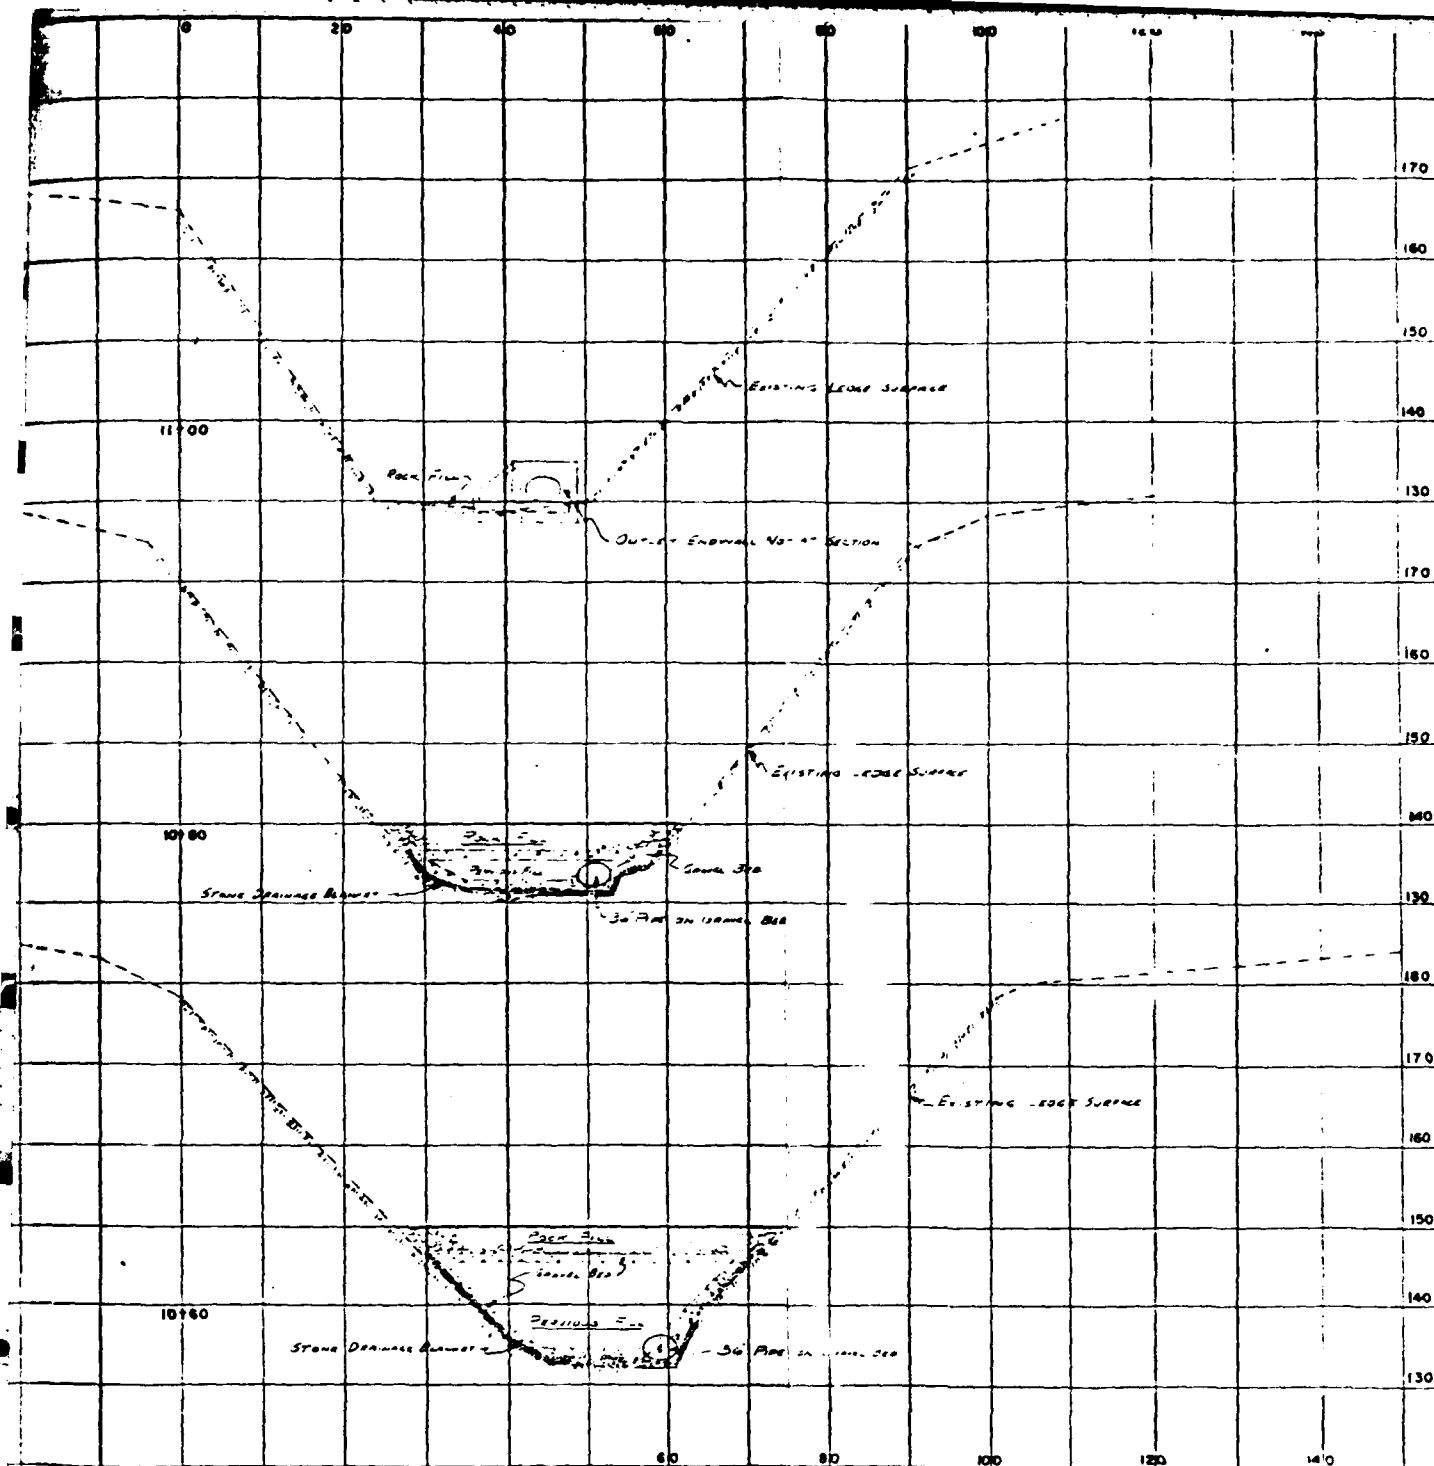

REDUCED NOT TO SCALE  
CROSS-SECTIONS 10:00 TO 11:00

STATE OF CONNECTICUT  
PUBLIC WORKS DEPARTMENT  
T. J. MURPHY, JR. COMMISSIONER

CONSTRUCTION OF DAM 81-BB-53  
CRYSTAL LAKE  
MIDDLETOWN CONNECTICUT 5

PLANS PREPARED BY  
ONDERDONK AND LATHROP  
CONSULTING ENGINEERS  
GLASTONBURY CONNECTICUT





REVISIONS		
NO.	DESCRIPTION	DATE

1" = 10'

2

SCALE: 1025

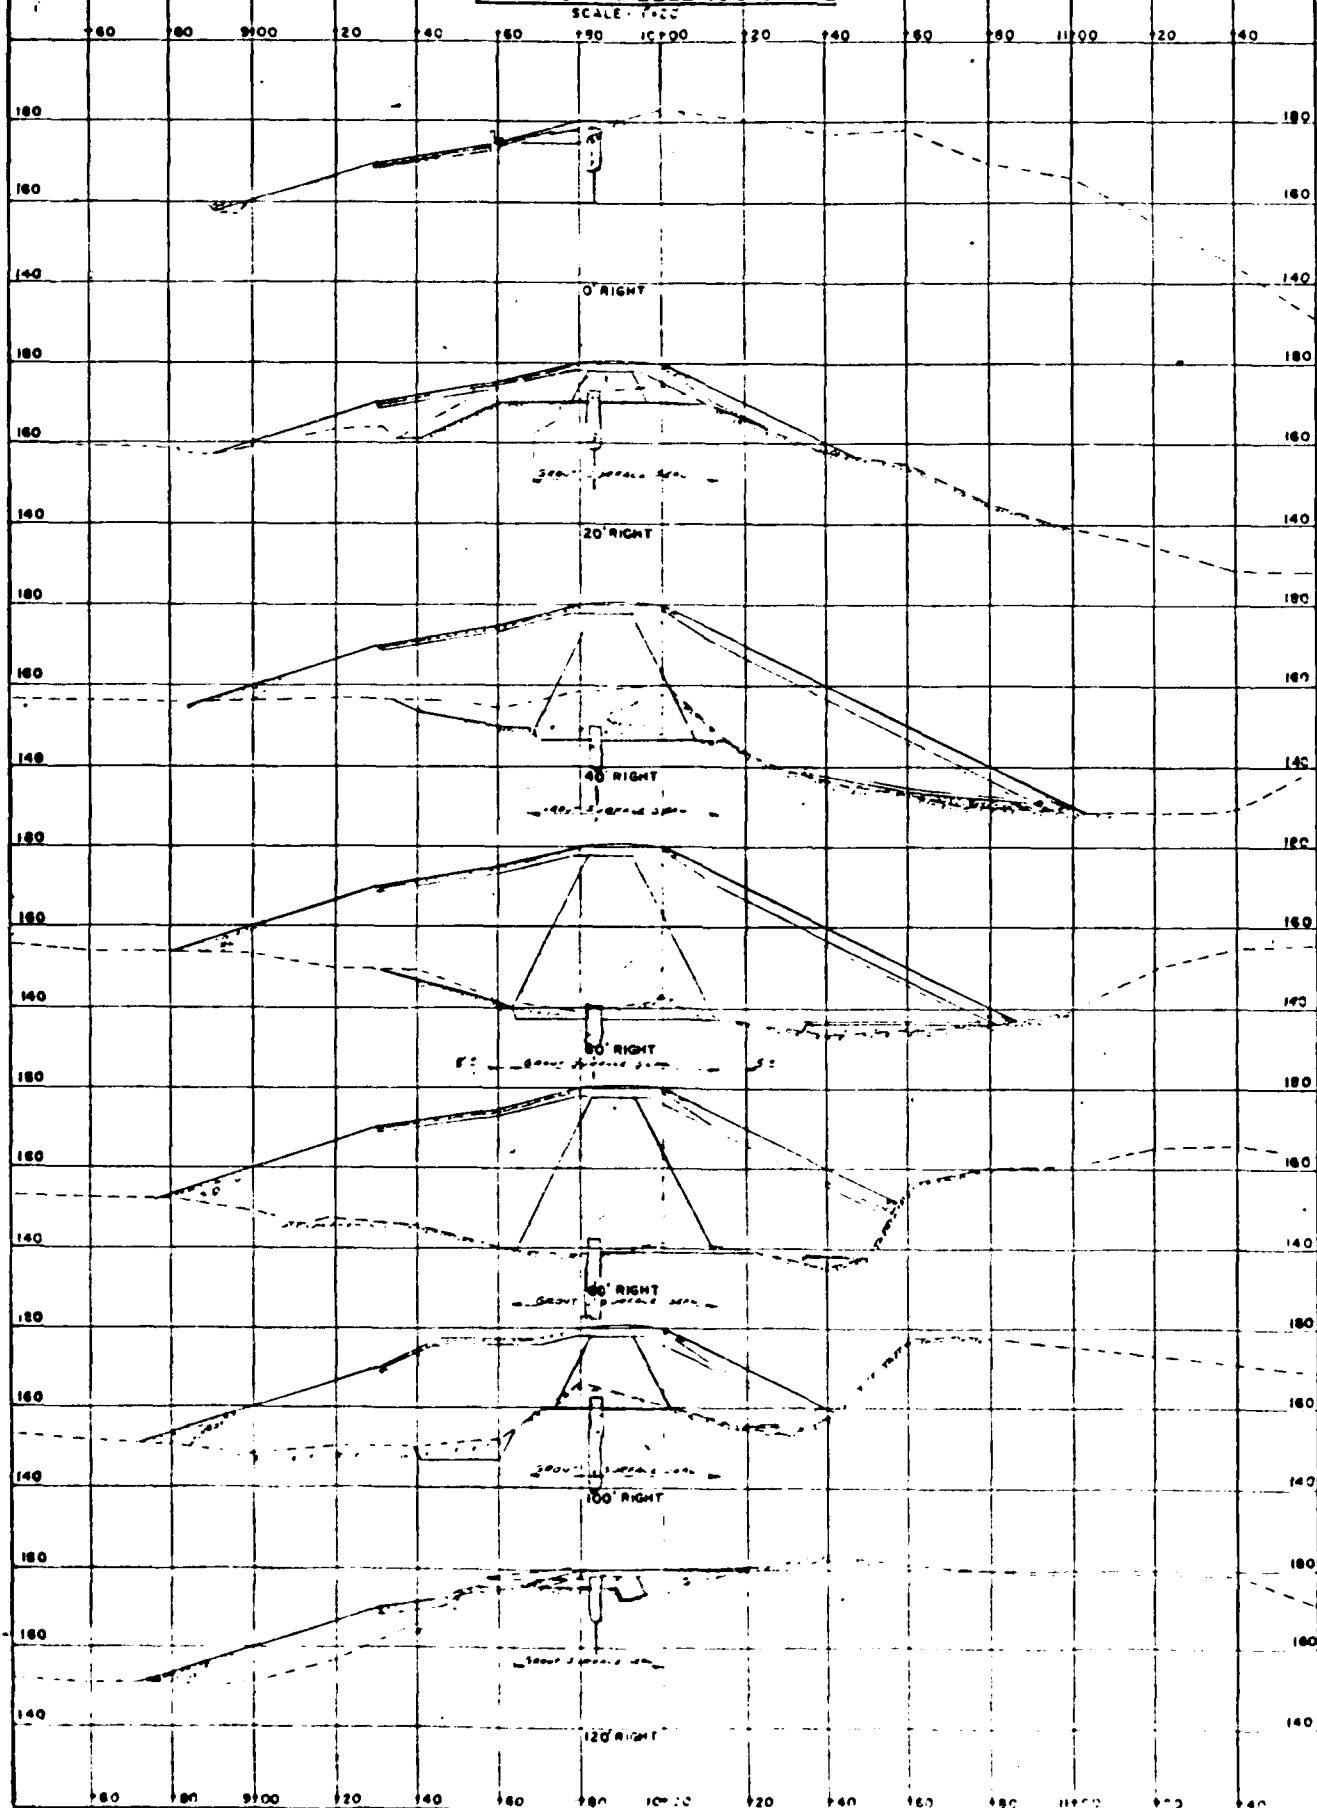


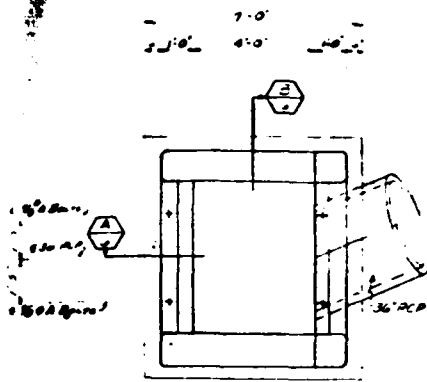


NOTE: BAR RACK NOT SHOWN

PLAN  
SCALE: 3/8"=1'-0"


### INLET STRUCTURE

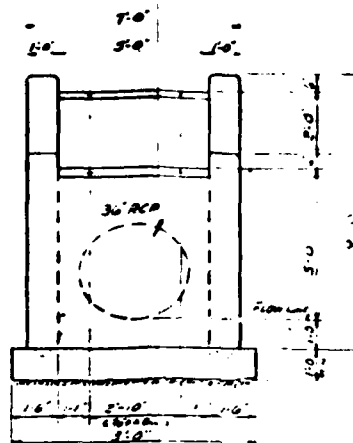


NOTE: BAR RACK NOT SHOWN  
WEST ELEVATION  
SCALE: 3/8"=1'-0"

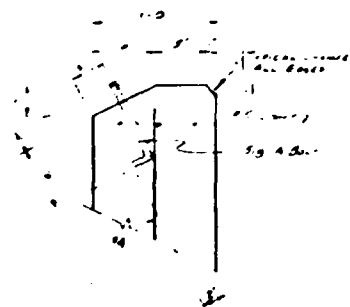


DETAIL  
SCALE: 1/2"=1'-0"

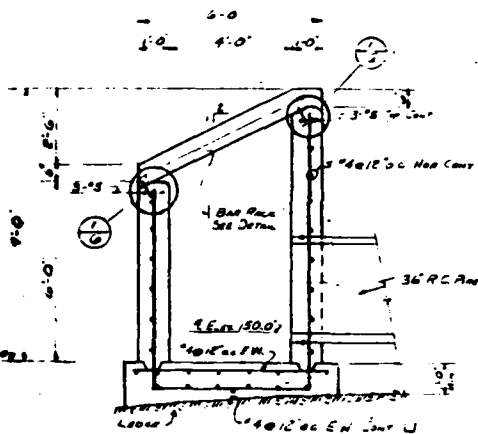


SECTION A-A  
SCALE: 3/8"=1'-0"

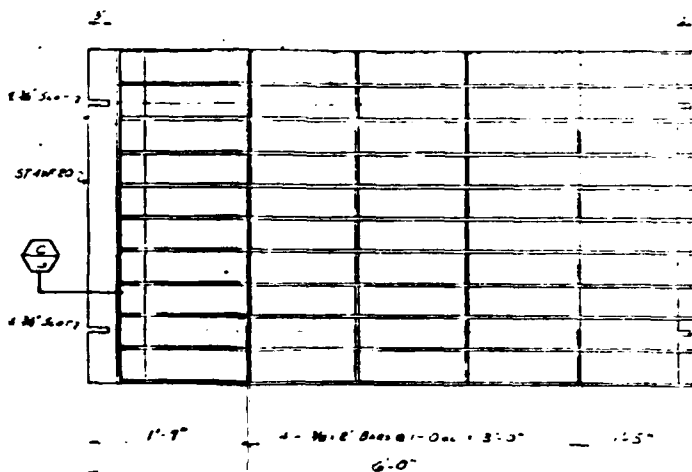

PLAN OF BAR RACK  
NOT TO SCALE



SECTION B-B  
NOT TO SCALE




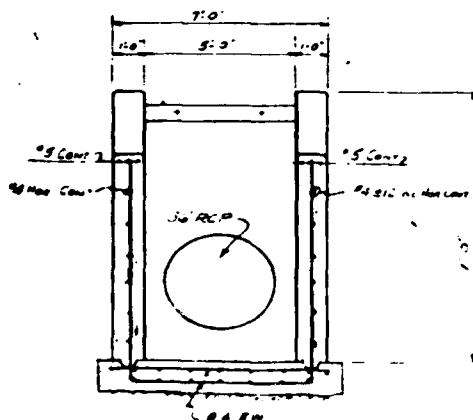


SECTION C-C  
SCALE: 3/8"=1'-0"




REDUCED NOT TO SCALE  
SECTIONS PARALLEL TO BASE LINE &  
DRAWDOWN INLET

STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY, JR. COMMISSIONER		81-88-53
DESIGNED BY J. L. A.	CHECKED BY R. D.	APPROVED BY J. S.
CONSTRUCTION OF DAM CRYSTAL LAKE MIDDLETOWN CONNECTICUT		6
PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS HARTFORD CONNECTICUT		DATE AS NOTED

2

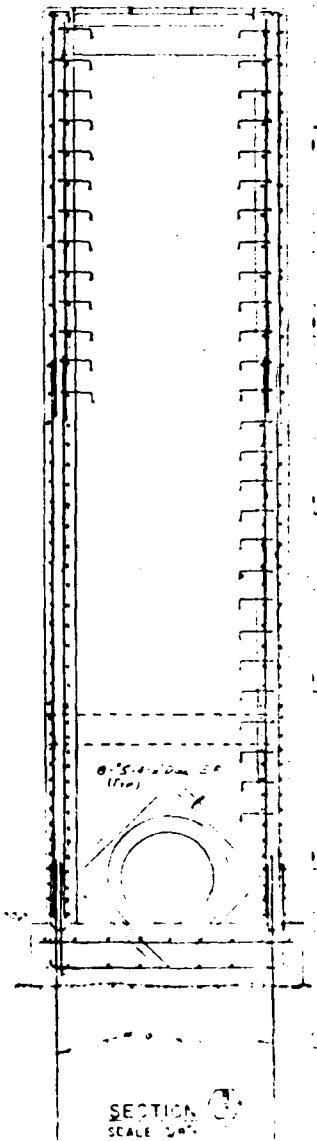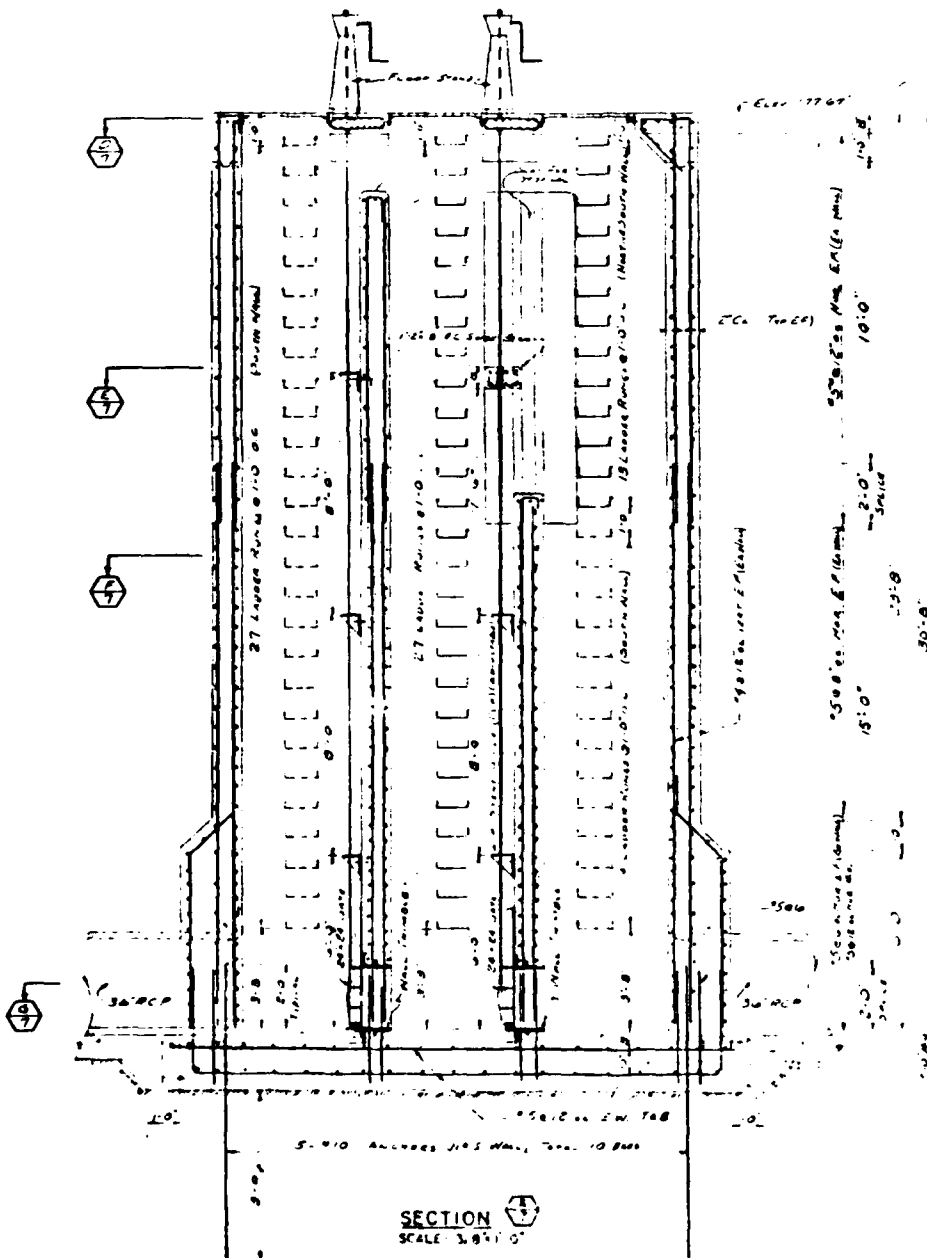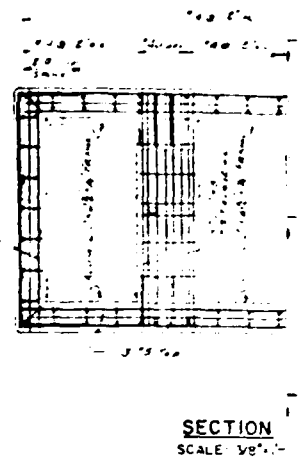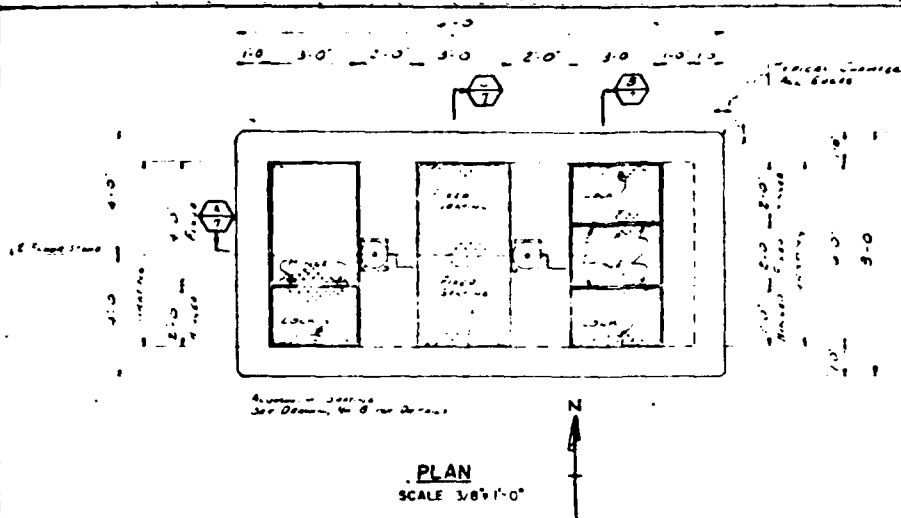

1. Field No. 100, 100  
 2. Field No. 100, 100  
 3. Field No. 100, 100

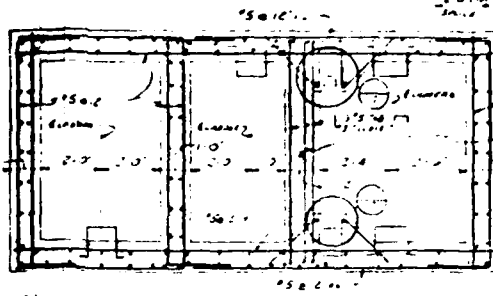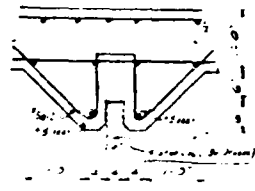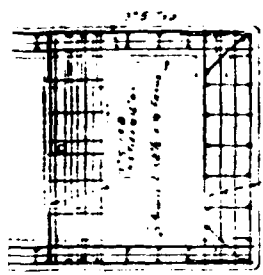


NOTE  
 FOR REINFORCEMENT SEE DETAIL 1


ON 1/8"=1'-0"

DETAIL 1  
 SCALE 3/4"=1'-0"

SECTION 1  
 SCALE 3/8"=1'-0"

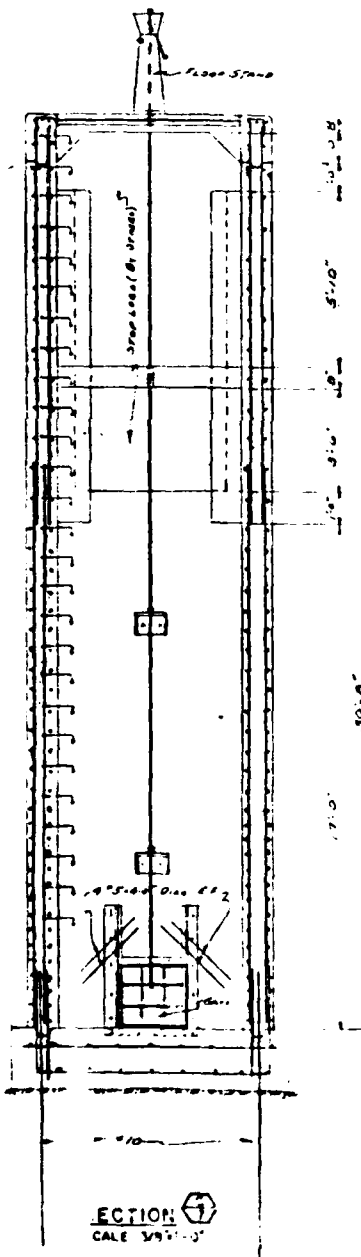


SECTION 1  
 SCALE 3/8"=1'-0"

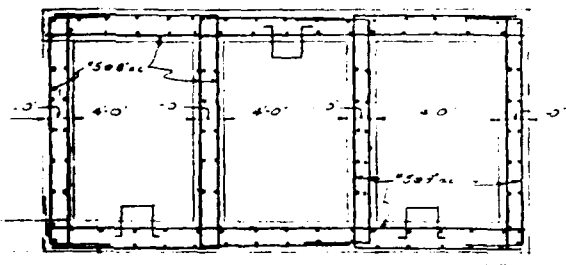

NOTE  
 FOR REINFORCEMENT SEE DETAIL 1

SECTION 2  
 SCALE 3/8"=1'-0"

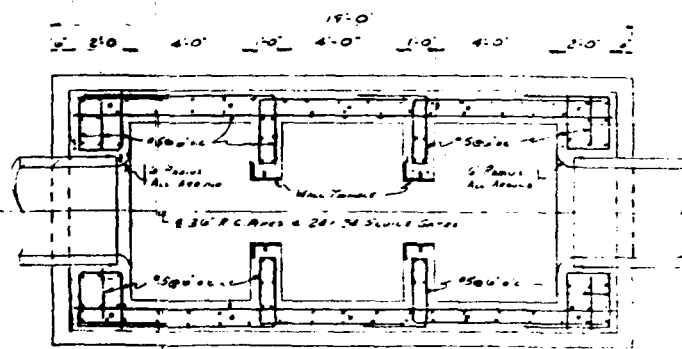

NOTE  
 FOR REINFORCEMENT SEE DETAIL 1

SECTION 3  
 SCALE 3/8"=1'-0"

REDUCED NOT TO SCALE  
 WATER CONTROL STRUCTURE


STATE OF CONNECTICUT PUBLIC WORKS DEPARTMENT T. J. MURPHY, JR. COMMISSIONER	
DRAWN BY S. J. M.	CONSTRUCTION OF DAM 3-88-53
CHECKED D. L.	CRYSTAL LAKE
APPROVED A. J. J.	MIDDLETON CONNECTICUT
PLANS PREPARED BY ONDERDONK AND LATHROP CONSULTING ENGINEERS 100 N. MAIN ST. HARTFORD, CT 06103 AS NOTED	

2





SCALE: 1/2" = 1'-0"



**SECTION** 



SCALE: 3/8" = 1'-0"

END

FILMED

9-84

DTIC